

1. Scope

This document specifies the cable assembly procedures of crimping the crimp contact to the cable (AWG#24 to 28) and inserting the contact to the crimp socket for DF61Y Series.

2. Part Number

Part No.	Description
DF61Y-2S-2.2C(%%)	Crimp socket
DF65-****SCF(A)(%%)	Crimp contact

%% : Peculiar specification number
 **** : Applicable wire size (AWG)

3. Cable Assembly Procedure

3.1. Cable Stripping

Follow the Crimping Quality Standard (ATAD-H0733), and strip the cable jacket. Make sure that there is no damage on the center conductor of the cable.

3.2. Crimping Process


Crimp the contact by using the applicator (AP105-DF65-2428S). Confirm that the crimp height and configuration meet the crimp condition and Crimping Quality Standard (ATAD-H0733).

3.3. Crimped Contact Insertion to Crimp Socket

Hold the cable of crimped contact and insert to each contact cavity of the crimp socket. (Insertion direction is as shown below.)

3.4 Making sure insert situation

Make sure that the contact lance is hooked by the housing lance of the crimp socket.

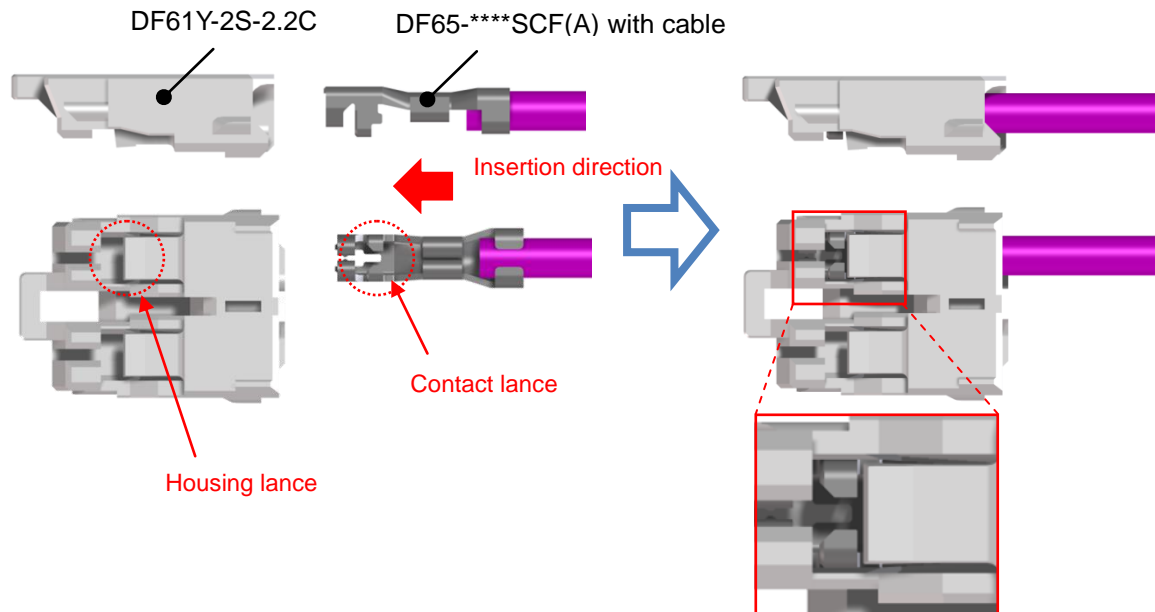

COUNT	DESCRIPTION OF REVISIONS	DESIGNED	CHECKED	DATE
△				
TITLE		HIROSE ELECTRIC CO., LTD.		
DF61Y Series Cable Assembly Procedure		APPROVED	TS. FUKUSHIMA	18. 04. 20
		CHECKED	TS. FUKUSHIMA	18. 04. 20
		DESIGNED	TS. KUMAZAWA	18. 04. 20
		WRITTEN	SN. MIWA	18. 04. 20
TECHICAL SPECIFICATION		ETAD-H0833-00		△ 1 / 2

- Do not insert the crimped contact (DF65-****SCF(A)) at an angle to the socket in order to avoid unexpected damage.
Also, there is some deformation risk of crimped contact lance in case contact is wrenched at “not fully inserted” (to crimp socket) state.

Angled insertion (Incorrect)




Scoop insertion (Incorrect)



- After crimped contact insertion, please don't twist a cable excessively.

Twisted insertion (incorrect)

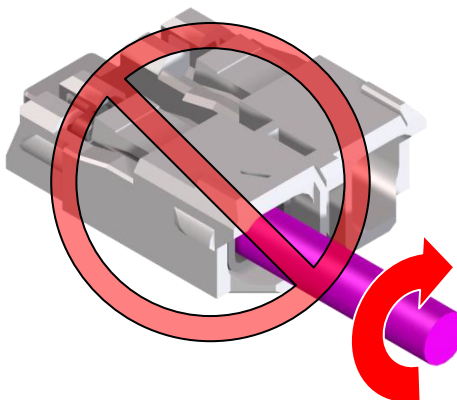

NOTE: Repairing the crimp contact

For removing the inserted contact form socket, lift up the housing lance by using DF-C-PO(B) or a pointed needle, and pull out the cable simultaneously. The repair operation could make the lance strength lower, therefore, please do not reuse the repaired crimp socket and replace it to a new one.

