





A
B
C
D
E
F

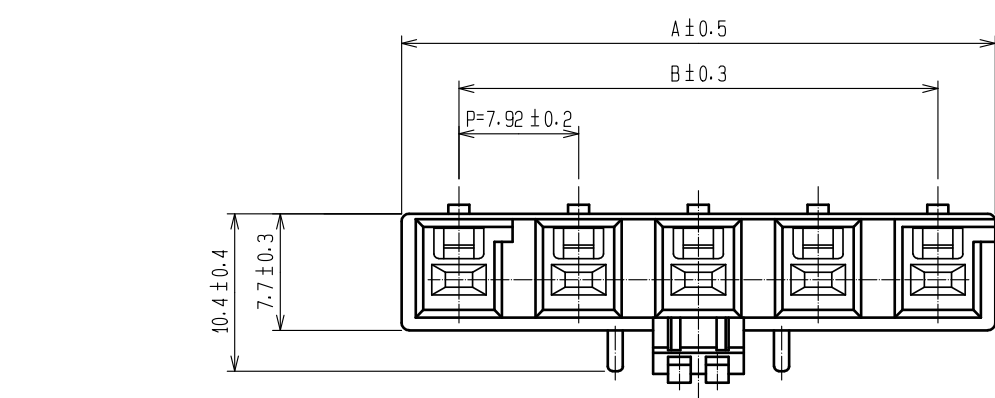



2 CONFIGURATION OF TWO AND FOUR CONTACTS.

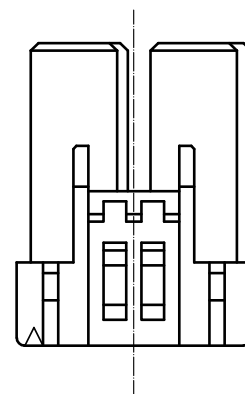

CONFIGURATION OF ONE CONTACT.

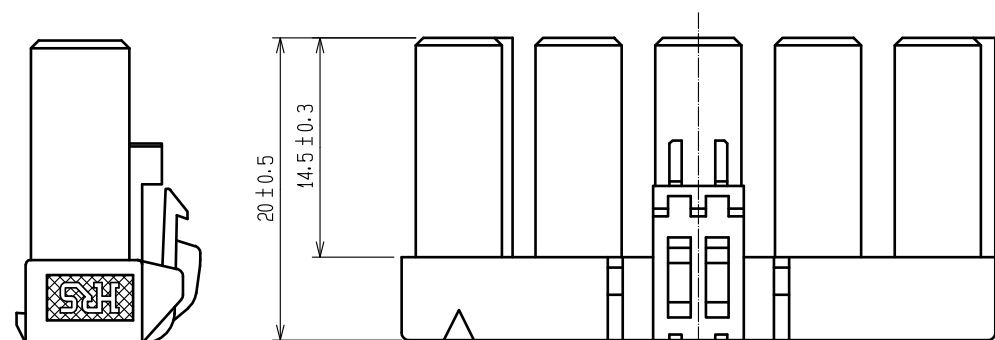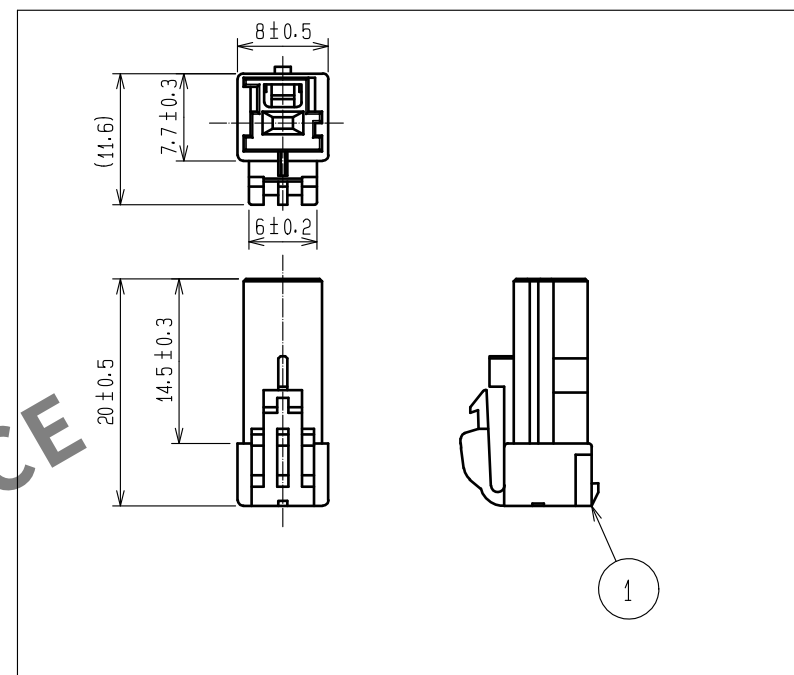

POLARIZATION MARKING

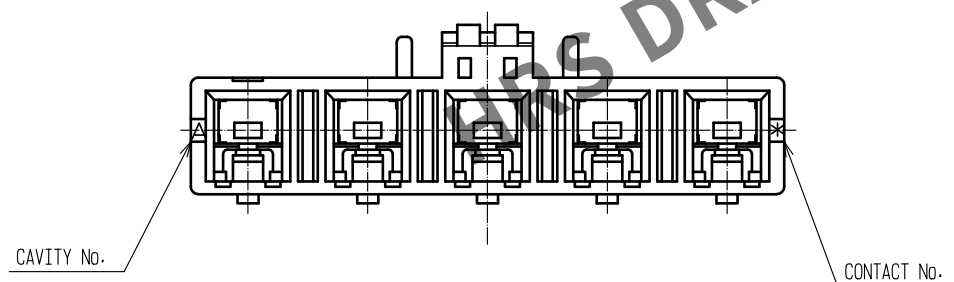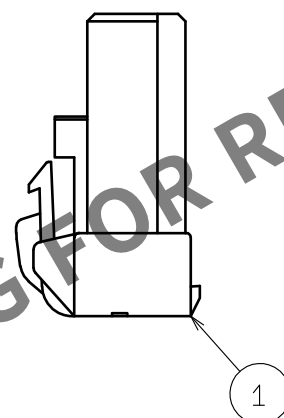

CODE No.	PART No.	CONTACT	A	B
CL680-1026-7-28	DF22R-1S-7.92C(28)	1	8.00	—
CL680-1027-0-28	DF22R-2S-7.92C(28)	2	15.50	7.92
CL680-1028-2-28	DF22R-3S-7.92C(28)	3	23.42	15.84
CL680-1029-5-28	DF22R-4S-7.92C(28)	4	31.34	23.76
CL680-1030-4-28	DF22R-5S-7.92C(28)	5	39.26	31.68

NOTE1:UL (FILE NO.E52653)

C:UL (FILE NO.E52653)

TUV(FILE NO.R9950703) APPROVED PRODUCT.

2 TWO AND FOUR CONTACTS DIFFER IN THE POSITION OF A GUIDE KEY.
3:100 CONNECTORS ARE IN ONE PACK



NO.		MATERIAL		FINISH . REMARKS		NO.		MATERIAL		FINISH . REMARKS	
UNITS mm		SCALE 2 : 1		COUNT 2		DESCRIPTION OF REVISIONS DIS-H-00003577		DESIGNED TO. KUROMATSU		CHECKED TS. FUKUSHIMA	
DATE 18.03.07		APPROVED : TY. OMA 05.12.28		DRAWING NO. EDC3-308611-01		PART NO. DF22R-*S-7.92C(28)		CODE NO. CL680-		1/3	
HRS HIROSE ELECTRIC CO., LTD.		CHECKED : HK. UMEHARA 05.12.28		DESIGNED : IO. DENPOUYA 05.12.26		DRAWN : AK. MIURA 05.12.16					

A
B
C
D
E
F


Mar.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.



Precautions

Notification for harness assembly


- 1) When inserting the crimping terminal to the crimping socket, please do not tilt the crimping terminal or twist the cable.
Insertion at tilted angles or twisting the cable may cause deformation of the crimping terminal or crimping socket.
- 2) After inserting the crimping terminal to the crimping socket, please make sure that the lance has been hooked with pulling the cable lightly.
When checking the hook, please avoid bending the cable for preventing terminal drop-off.

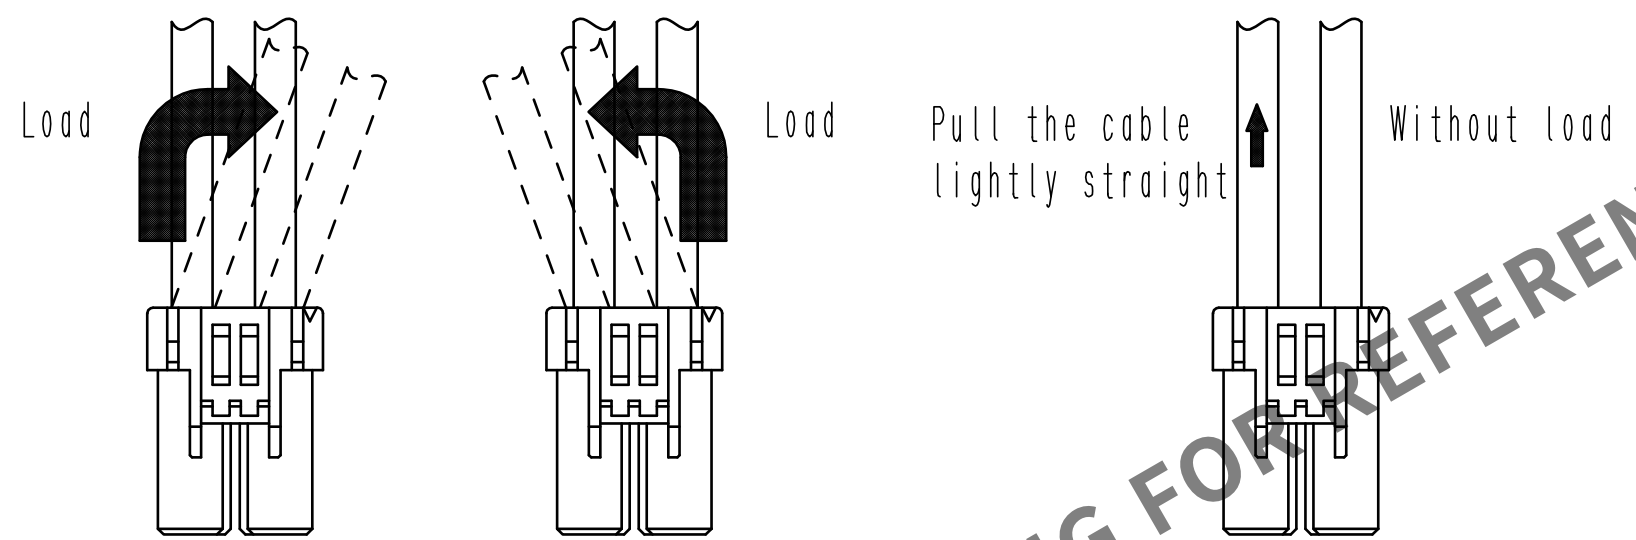

NG

OK

- 3) Bundle cables/Cabtyre Cables
Recommend bundle and strip position of cables are 100 mm or more.
Bunding close to the connectors may cause terminal drop off, breaking cables and unstable connection.

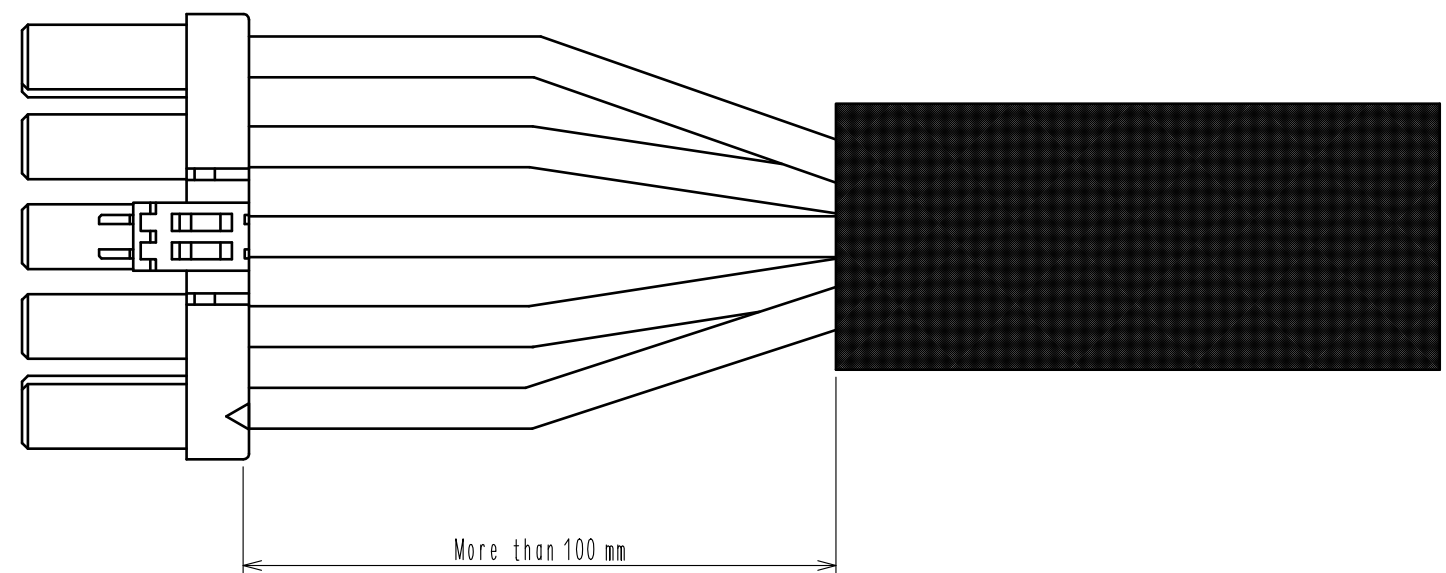

DRAWING NO.	EDC3-308611-01
PART NO.	DF22R-*S-7. 92C(28)
CODE NO.	CL680-

Mar.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.




Precautions


Notification for Insertion/Extraction

- 1) Please insert(extract) the crimping socket straight to the mating connector.
Insertion(extraction) at tilted angles applies load concentration to the connector end and may cause deformation (at connection area, socket and header case, etc). There is firing risk using this kind of deformed connector.


Insertion(Extraction)

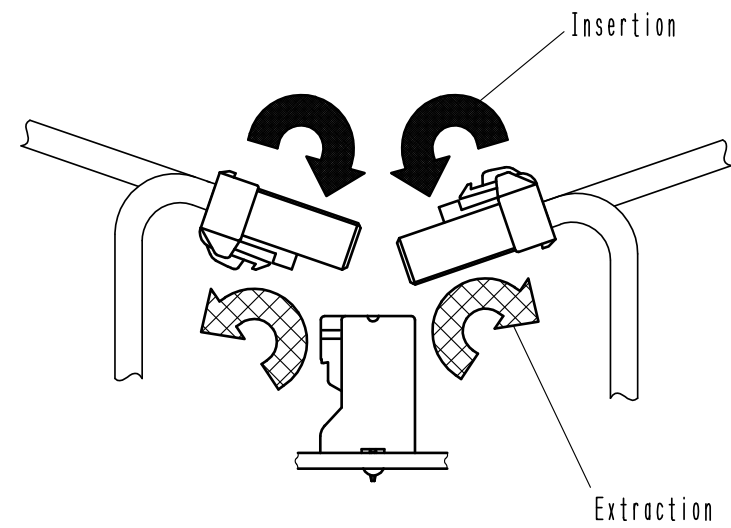

NG

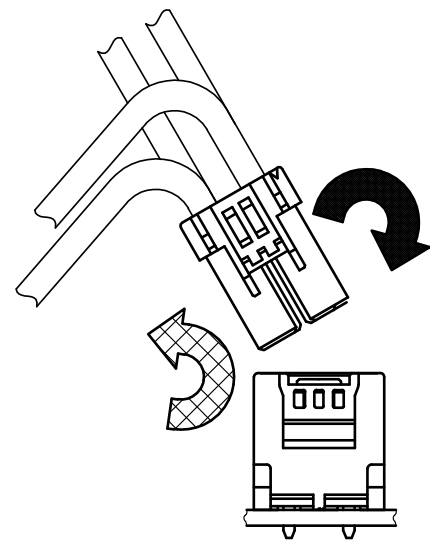

NG

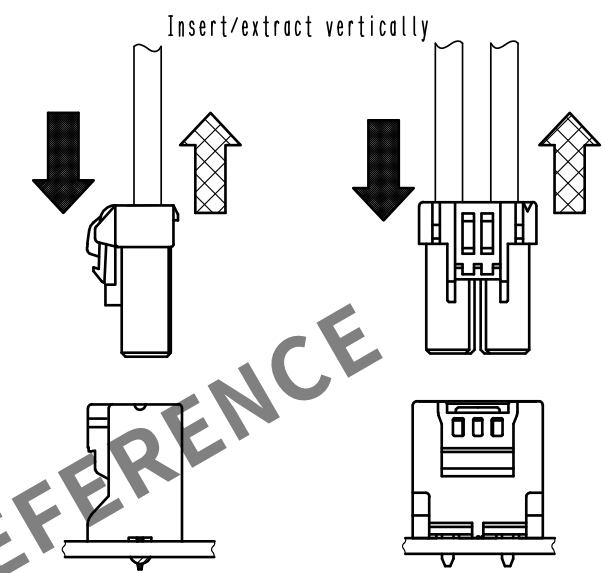


OK

- 2) When it is hard to extract, please lightly insert the connector beforehand and then pull it with releasing the lock.
Forced extraction has a risk of connector breakage.


Notification of wiring

- 1) When using a thick cable, short cable length and bending close to the connector end, these load concentration may cause deformation.
Please note that there is firing risk using deformed connector.
When installing, please refrain from stress concentration such as cable bending close to the connector end or cable twisting.

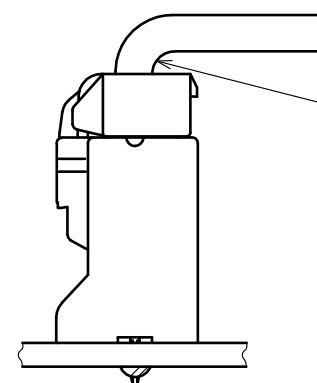

NG

Stress concentration;
Cable bending close
to connector

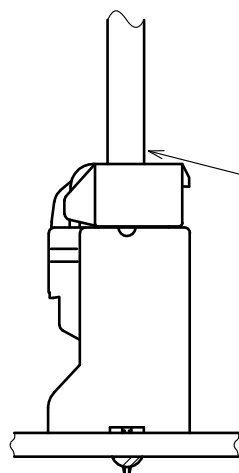

OK

No stress concentration;
No cable bending close
to connector

- 2) When applying load to connector end, please use the retainer for reducing the stress affection on the connector.
Retainer shall be installed after inserted crimping contact completely. It might be impossible to insert it when terminal installation is incompleated.



DRAWING NO.	EDC3-308611-01
PART NO.	DF22R-*S-7. 92C(28)
CODE NO.	CL680-