

This connector features small, thin and back flip design, requiring delicate and careful handling. To prevent connector/FPC breakege and contact failure (meting failure, FPC pattern breakege, etc). read through the instructions shown below and handle the connector properly. Each values indicating here are for reference and may differ from standard value.


[Operation and Precautions]


1. Initial condition

Actuator does not have to be operated before inserting FPC. as the connector is delivered with the actuator opened.

[Caution]

- -Do not close the actuator before inserting FPC.
- Closing the actuator without FPC could make the contact gap smaller, which could increase the FPC insertion force.
- -Do not insert FPC or operate actuator before mounting.

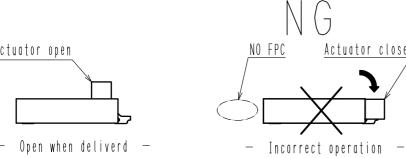

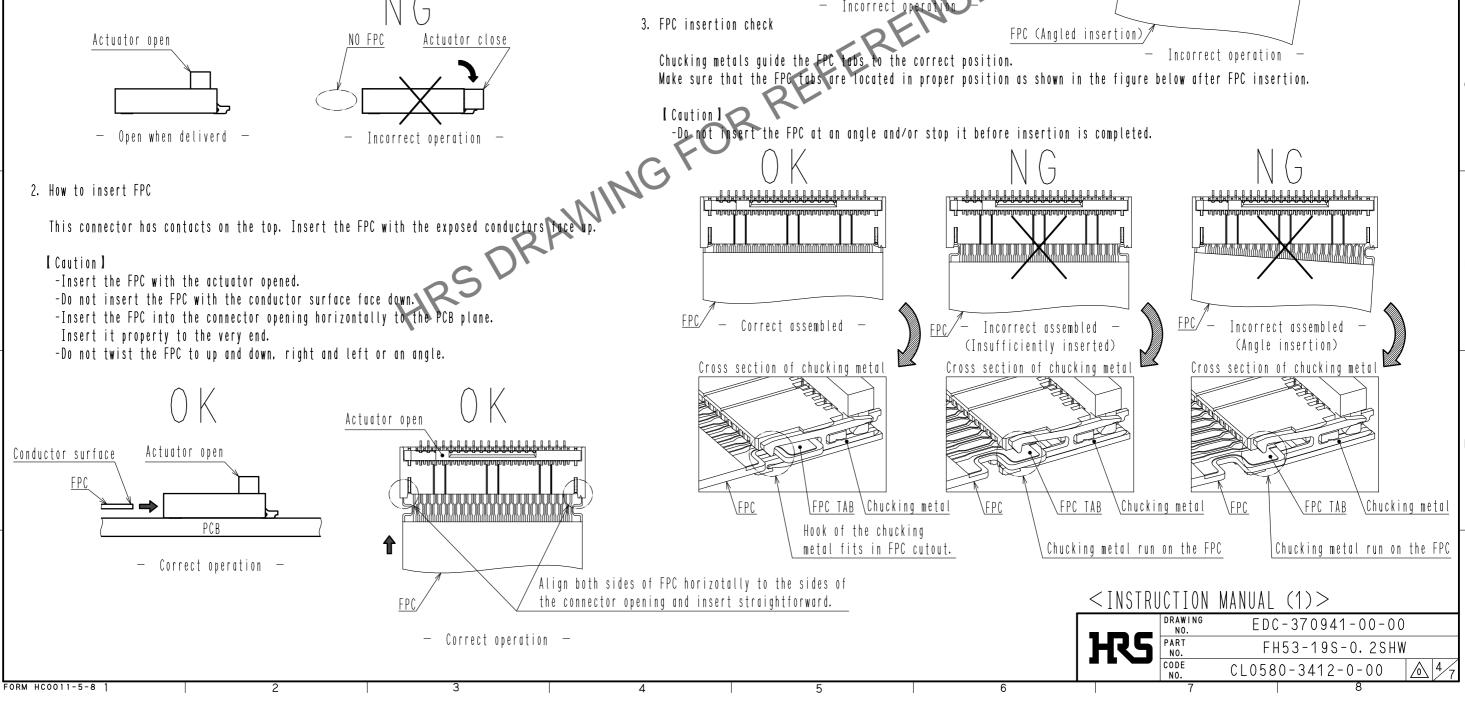

FPC (Angled insertion)

Actuator close

Actuator open

FPC/ - Incorrect operation


Actuator close

Actuator open

Incorrect operation -

FORM HC0011-5-8 1

4. How to lock Apply load to rotate the actuator by 90 degree after inserting the FPC. Do not operate the actuator at one end only Close the actuator at the center [Caution] -The actuator rotates around the rotational axis as shown below. -Do not rotate the actuator to the counter direction. Do not pinch or pick the actuator to lift. -Operate the actuator by hand without using sharp tool such as Tweezers. -To close the actuator, operate at the center of the actuator. Do not apply excess force to the housing during the operation. -To close the actuator, do not operate the actuator at one end only. -Do not apply excess force to the housing during the operation. [Actuator movable range] - Incorrect operation -(Side view) PCB \Rotational axis Actuator — Incorrect operation — PCB Actuator receives inappropriate force Incorrect operation - Correct operation in reverse direction. sharp tool Actuator - Incorrect operation -<INSTRUCTION MANUAL (2)> HRS DRAWING NO.
PART NO.
CODE NO. EDC-370941-00-00 FH53-19S-0.2SHW CL0580-3412-0-00

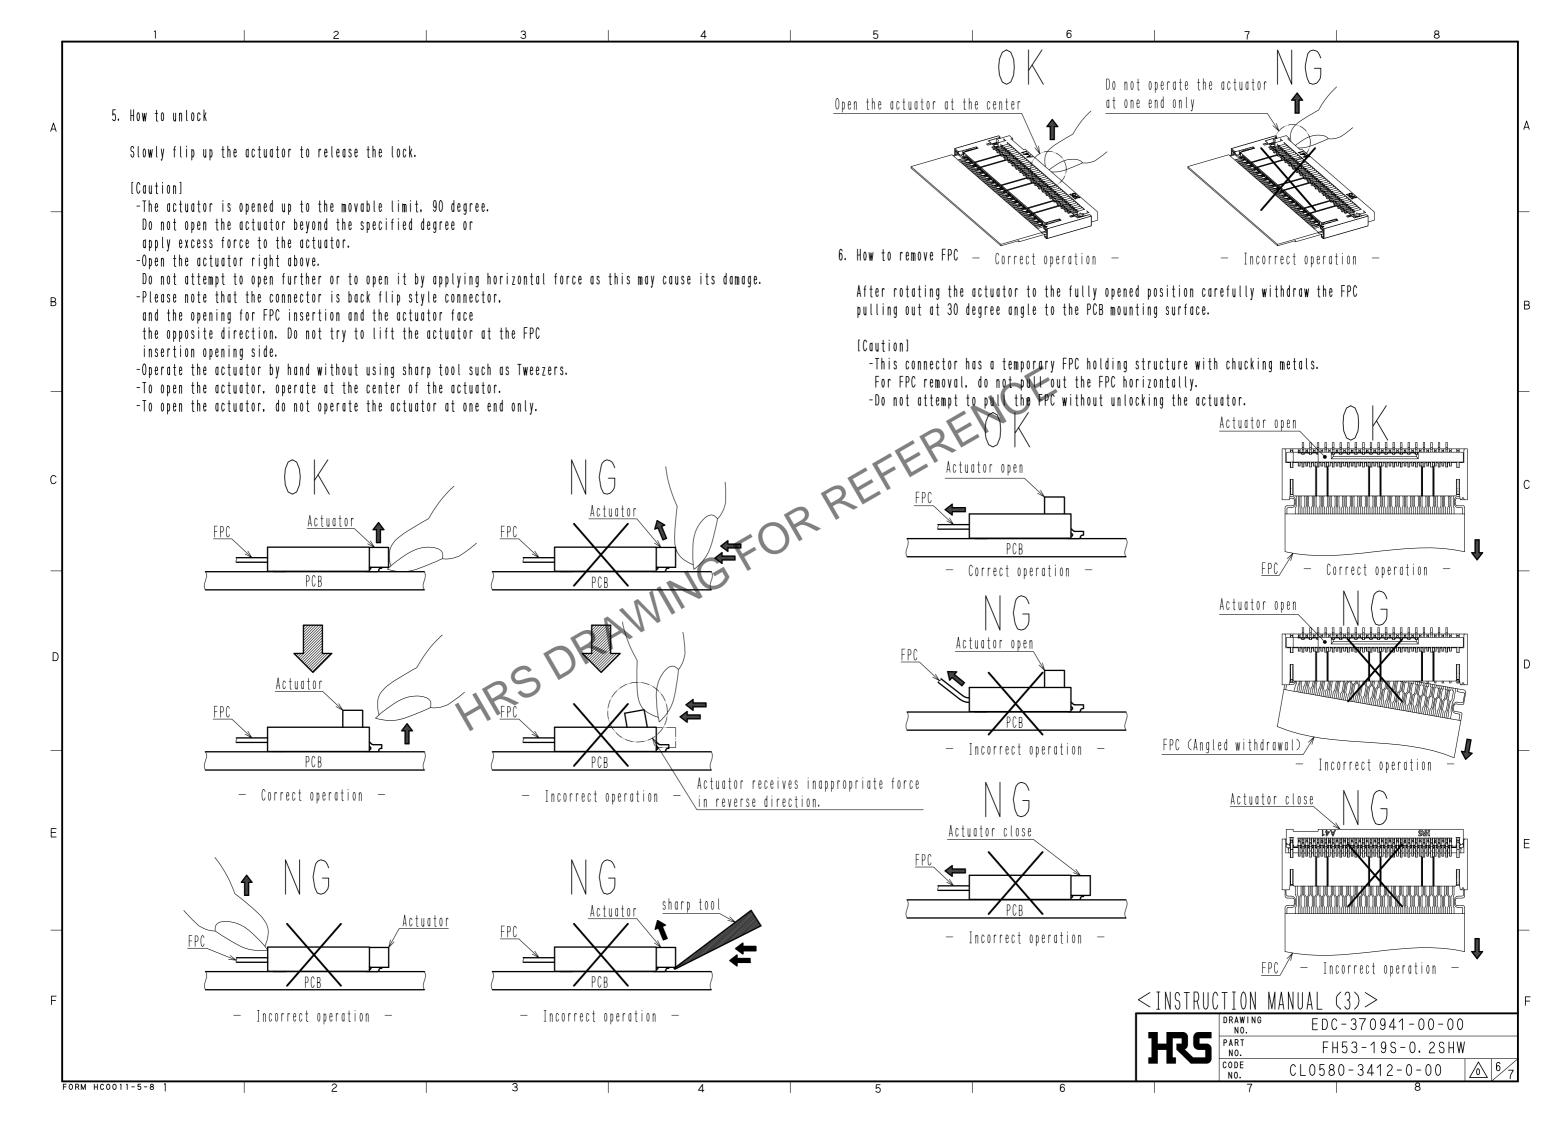

[[Precautions for design]]

- 1. During FPC wiring, ensure that stress is not applied directly to the connector. Do not bend the FPC excessively near the connector during use, or it may cause contact failure or FPC breakage. Stabilizing the FPC is recommended.
- 2. Keep a sufficient FPC insertion space in the stage of the layout in order to avoid incorrect FPC insertion. Appropriate FPC length and component layout are recommended for assembly ease. Too short FPC length makes assembly difficult.
- 3. Follow the recommended PCB mounting pattern, stencil opening design and the FPC design.
- 4. Make adjustments with the FPC manufacturer for FPC bending performance and wire breakage.
- 5. Keep spaces for the actuator movement and its operation for PCB design and component layout.

[FPC routing after connection]

Depending on a FPC rounding, a load is applied to the connector, and a contact failure may occur. To prevent a failure, take the following notes into a consideration during, mechanism design.

[Caution]

FORM HC0011-5-8

В

- -Avoid applying forces to FPC in vertical or horizontal derections.
 In addition, avoid pulling up and down on the FPC.
 -When fixing FPC after FPC cabling, avoid pulling FPC, and route the wire FPC with slack.
 In this regard, the stiffener is parallel to the PCB.
- -Do not mount other components touching to the FPC underneath the FPC stiffener.

[Instructions for mounting on the PCB]


- ◆Warp of PCB
- ◆Minimize warp of the PCB as much as possible. Lead co-planarity including reinforced chucking metals is 0.1 mm or less. Too much warp of the PCB may result in a soldering failure.
- ◆Flexible board design Please make sure to put a stiffener on the backside of the flexible board. We recommend a glass'epoxy material with the thickness of 0.3mm MIN.
- ◆Load to Connector Do not add 0.5N or greater external force when unreel or pick and place the connector etc. In addition, do not insert the FPC or operate the connector before mounting.
- ◆Reflow temperature profile Apply reflow temperature profile within the specified conditions. In individual applications, the actual temperature may vary. depending on solder paste type. volume/thickness and PCB size/thickness. Consult your solder paste and equipment manufacturer for specific recommendations.

[INSTRUCTIONS FOR PCB HANDLING AFTER MOUNTING THE CONNECTOR]

- ◆Load to PCB
 Splitting a large PCB into several pieces
 Scrowing the PCB
 Avoid the handling described above so that no force is exerted on the PCB during the assembly process.
 Otherwise, the connector may become defective.

The warp of a 100mm wide PCB should be 0.5 mm or less.

The warp of PCB suffers stress on connector and the connector may become defective.

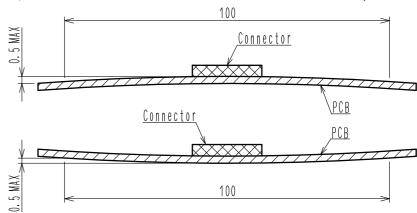

(Other instructions)

- ◆Instructions on manual soldering Follow the instructions shown below when soldering the connector manually during repair work, etc.
- 1. Do not perform manual soldering with the FPC inserted into the connector.
- 2. Do not heat the connector excessively. Be very careful not to let the soldering iron contact any parts other than connector leads. Otherwise, the connector may be deformed or melt.
- 3. Do not supply excessive solder (or flux). If excessive solder (or flux) is supplied on the terminals, solder or flux may adhere to the contacts or rotating parts of the actuator, resulting in poor contact or a rotation failure of the actuator. Supplying excessive solder to the chucking metals may hinder actuator rotation. resulting in breakage of the connector.

