

FORM HC0011-5-8 1

Precautions ◆Notification for harness assembly 1) When inserting the crimping terminal to the crimping socket, please do not tilt the crimping terminal or twist the cable. Insertion at tilted angles or twisting the cable may cause deformation of the crimping terminal or crimping socket. 2) After inserting the crimping terminal to the crimping socket, please make sure that the lance has been hooked with pulling the cable lightly. When checking the hook, please avoid bending the cable for preventing terminal drop-off. without load Pull the cable Load Load lightly straight ING

OF

Bundle cables/Cabtyre Cables


Recommend bundle and strip position of cables are 100 mm ar more.

Bunding close to the connectors may cause terminal drap-off, breaking. 3) Bundle cables/Cabtyre Cables More than 100 mm EDC3-164777-01 HS PART NO. CODE DF22B/C-*RS/P-7.92 2/3 CL680-

Precoutions

◆Notification for Insertion Extraction


1) Please insert(extract) the crimping socket straight to the mating connector. Insertion(extraction) at tilted angles applies load concentration to the connetor end and may cause deformation (at connection area, socket and header case, etc). There is firing risk using this kind of defomed connector.

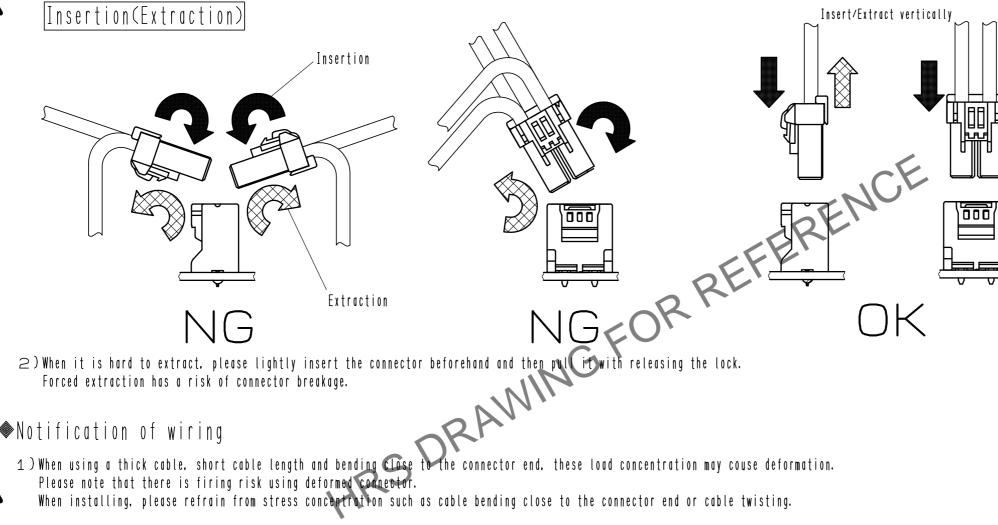

◆Notification of wiring

1) When using a thick cable, short cable length and bending close to the connector end, these load concentration may couse deformation.

Please note that there is firing risk using deformed connector.

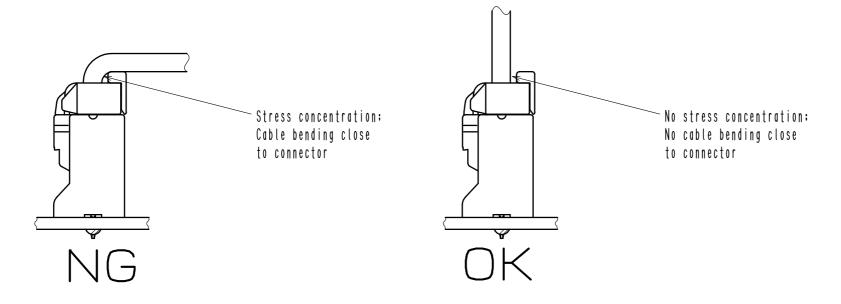

HS	DRAWING NO.	EDC3-164777-01		
	PART NO.	DF22B/C-*RS/P-7.	92	
	CODE NO.	CL680-		3/3

FORM HC0011-5-8 1