



Jun.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

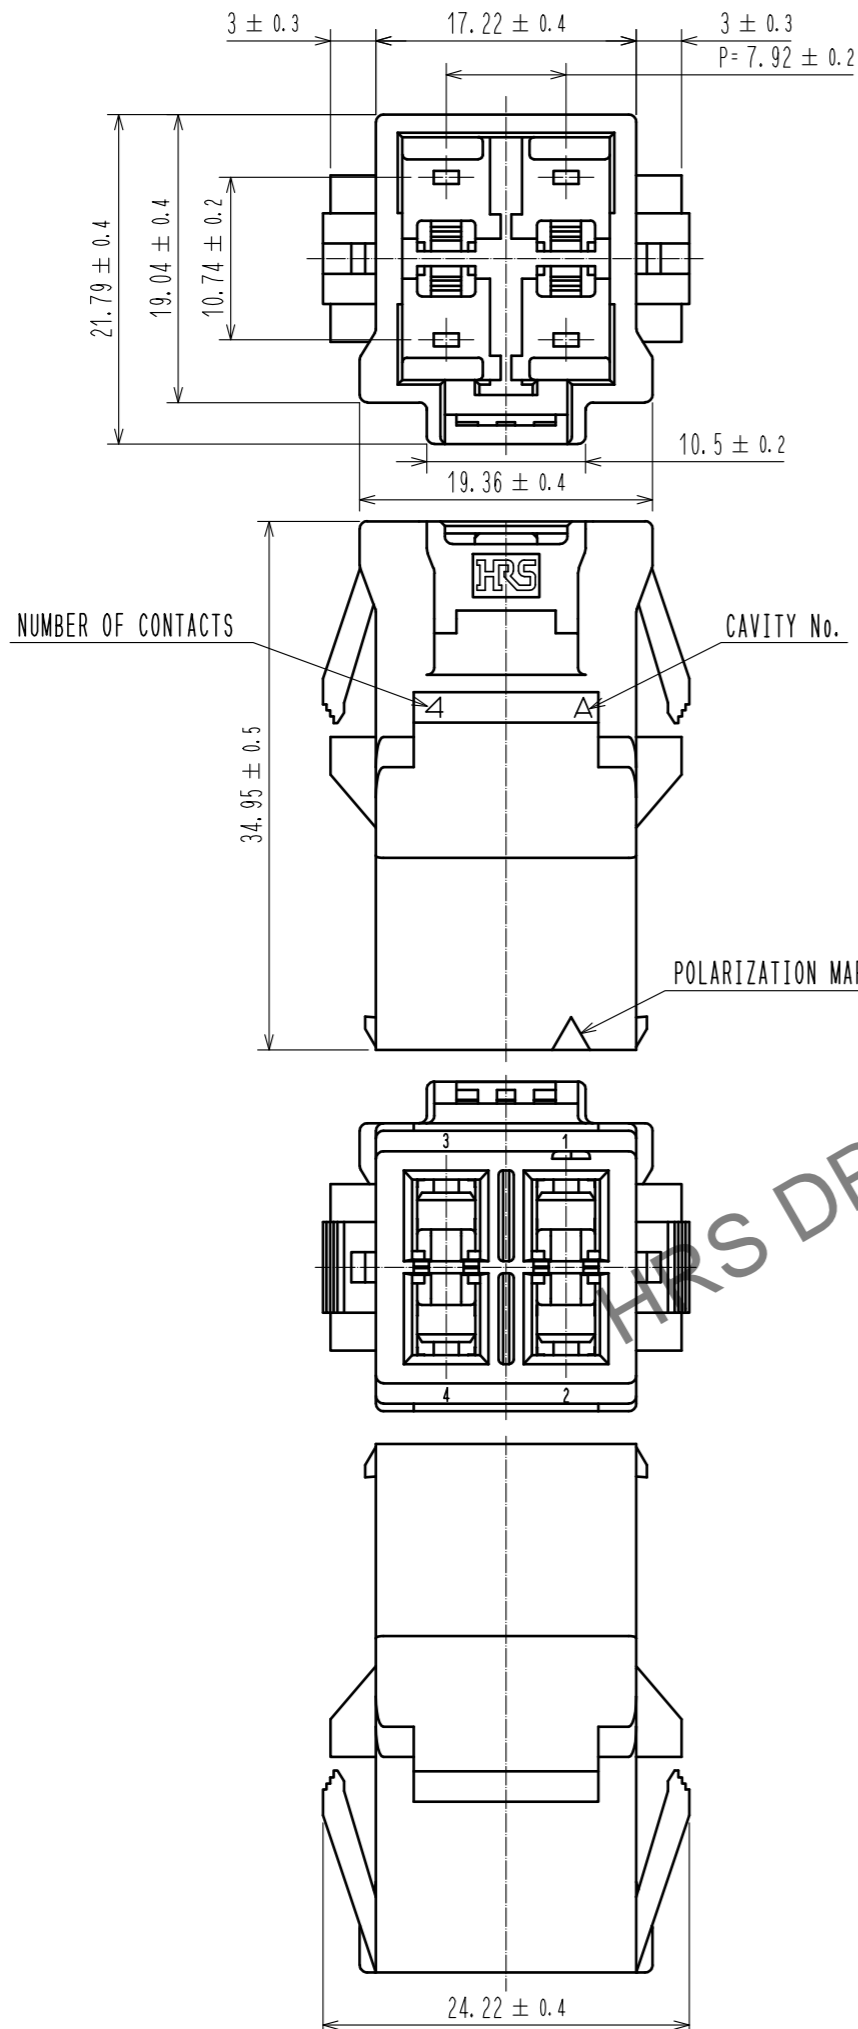


RECOMMENDED PANEL HOLE

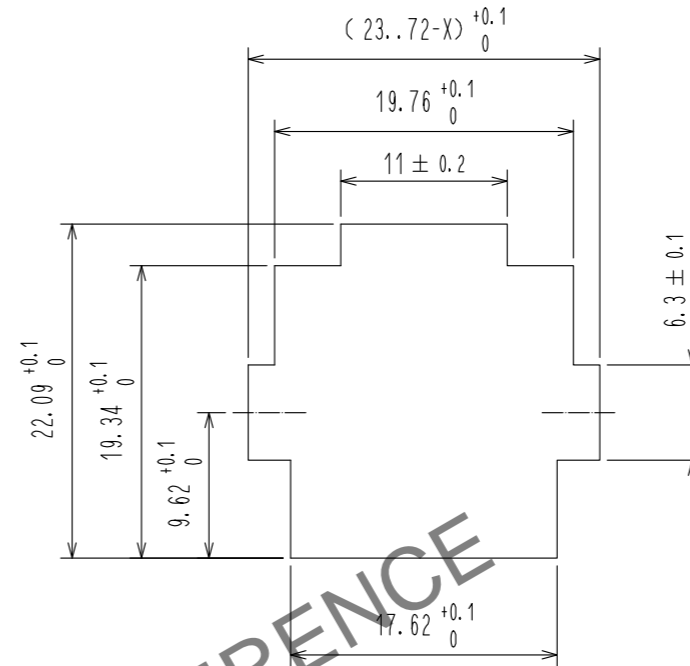

| PANEL THICKNESS | X |
|-----------------|------|
| 2.0 | 0.48 |
| 1.6 | 0.96 |
| 1.2 | 1.44 |
| 0.8 | 1.92 |

APPLICATION DIAGRAM

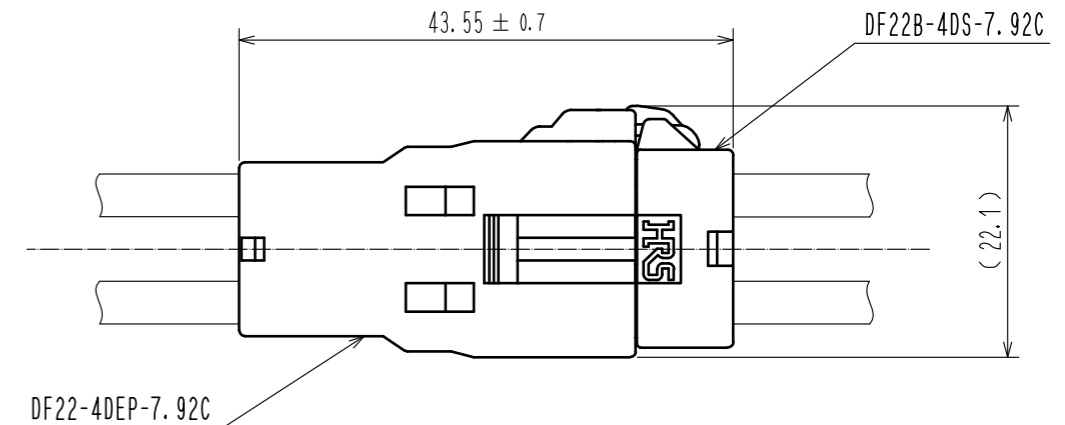

- NOTES1. 100 PIECES PER PACK.
2. UL(FILE NO. E52653).
C-UL(FILE NO. E52653).
TÜV(FILE NO. R9950703). APPROVED PRODUCT.



| NO. | | | | 1 | | | |
|------------------|----|-------|-------|--------------------------|--|------------------|-----------|
| MATERIAL | | | | POLYAMIDE | | | |
| FINISH . REMARKS | | | | NATURAL(WHITE) UL94V-0 | | | |
| UNITS | mm | SCALE | COUNT | DESCRIPTION OF REVISIONS | | DESIGNED | CHECKED |
| | | 2 : 1 | 2 | DIS-H-00006105 | | TS. KUMAZAWA | HS. OKAWA |
| | | | | APPROVED : KI. AKIYAMA | | 20120801 | |
| | | | | CHECKED : HK. UMEHARA | | 20120801 | |
| | | | | DESIGNED : ST. SATO | | 20120731 | |
| | | | | DRAWN : ST. SATO | | 20120731 | |
| | | | | DRAWING NO. | | EDC-163563-00-01 | |
| | | | | PART NO. | | DF22-4DEP-7.92C | |
| | | | | CODE NO. | | CL680-1051-4-00 | |
| | | | | | | | |


HRS HIROSE ELECTRIC CO., LTD.

Jun.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.


⚠️ Precautions

◆ Notification for harness assembly

- 1) When inserting the crimping terminal to the In-line plug, please do not tilt the crimping terminal or twist the cable.
Insertion at tilted angles or twisting the cable may cause deformation of the crimping terminal or In-line plug.
- 2) After inserting the crimping terminal to the In-line plug, please make sure that the lance has been hooked with pulling the cable lightly.
When checking the hook, please avoid bending the cable for preventing terminal drop-off.

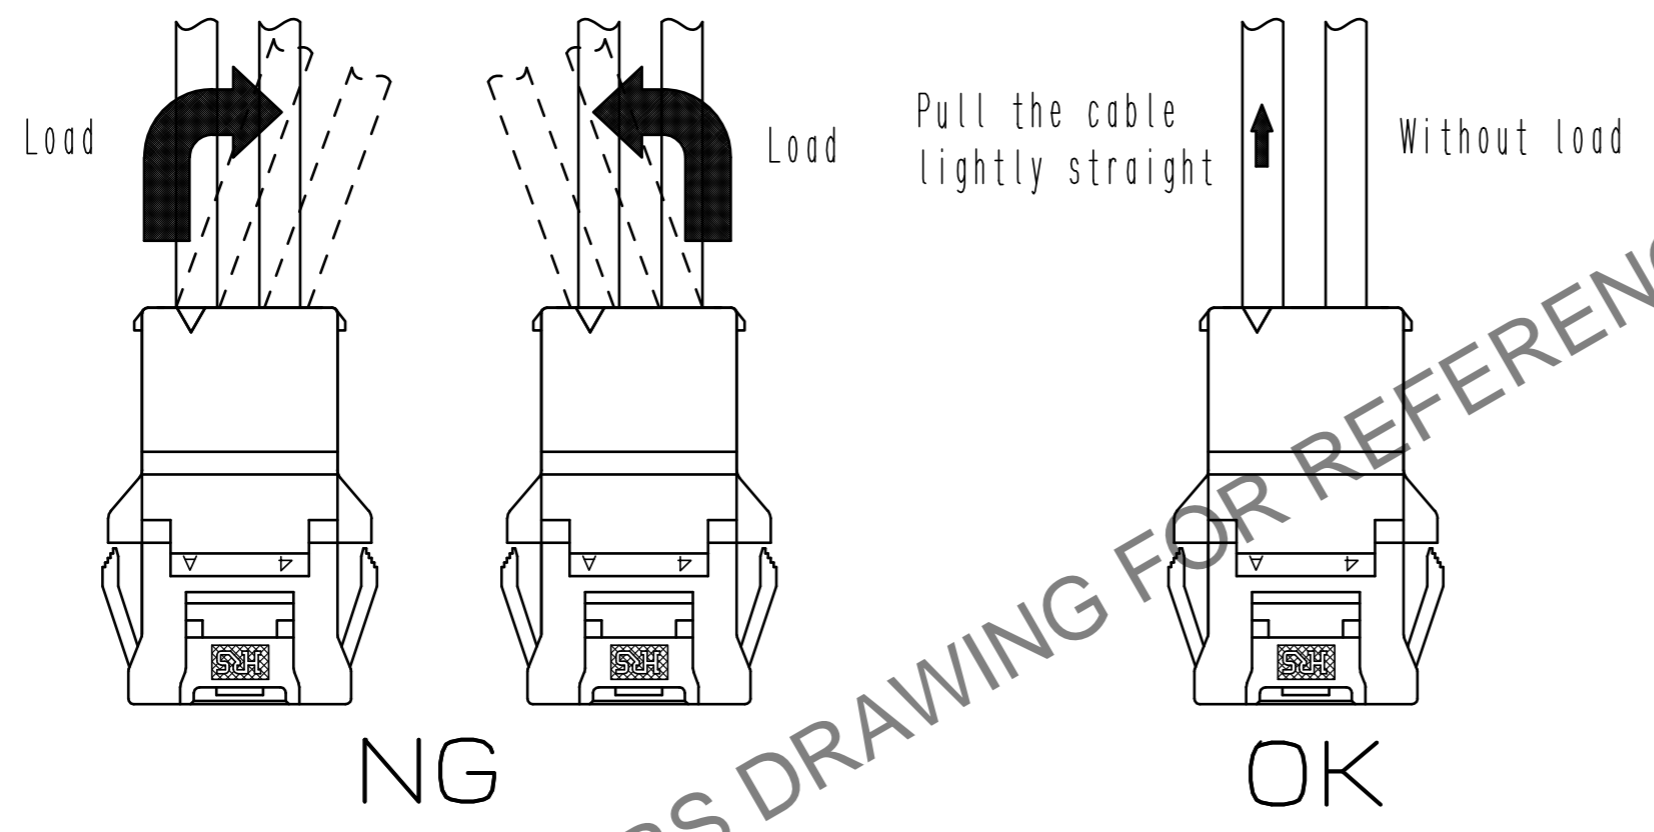

- 3) Bundle cables/Cable Cables
Recommend bundle and strip position of cables are 100 mm or more.
Bundling close to the connectors may cause terminal drop-off, breaking cables and unstable connection.

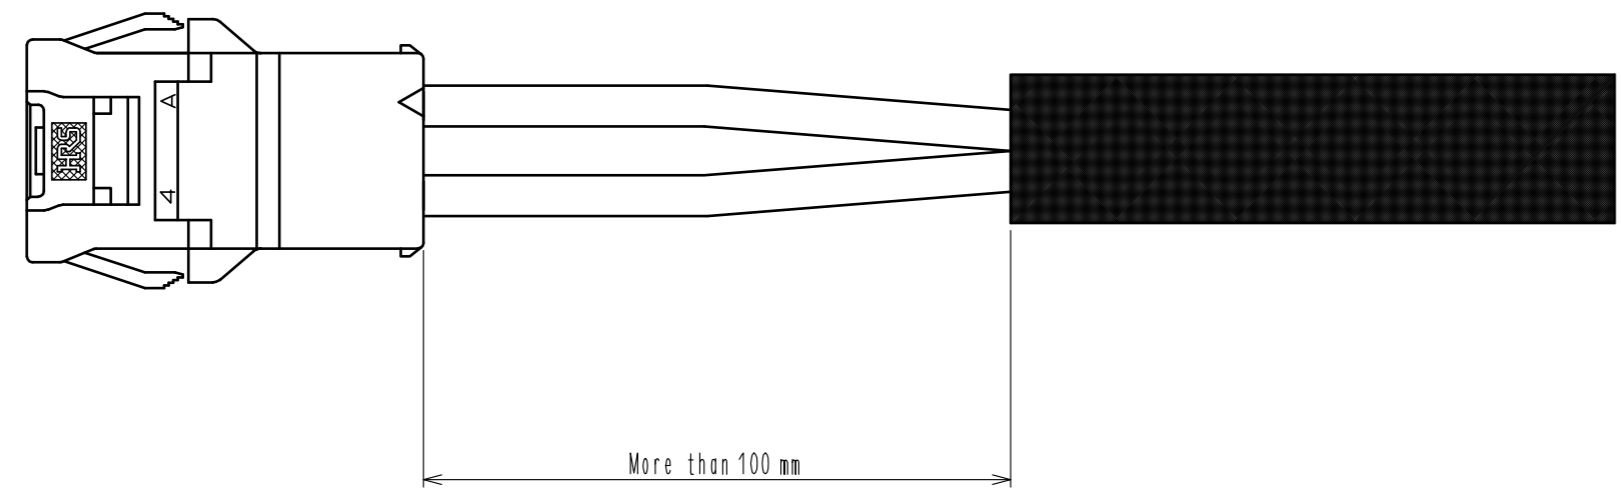

| | | | | |
|-----|-------------|------------------|---|-----|
| HRS | DRAWING NO. | EDC-163563-00-01 | | |
| | PART NO. | DF22-4DEP-7. 92C | | |
| | CODE NO. | CL680-1051-4-00 | 2 | 3/4 |

Jun.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.


⚠️ Precautions

◆ Notification for Insertion Extraction


1) Please insert(extract) the crimping socket straight to the mating connector.
Insertion(extraction) at tilted angles applies load concentration to the connetor end and may cause deformation (at connection area, socket and header case, etc). There is firing risk using this kind of deformed connector.



Insertion(Extraction)

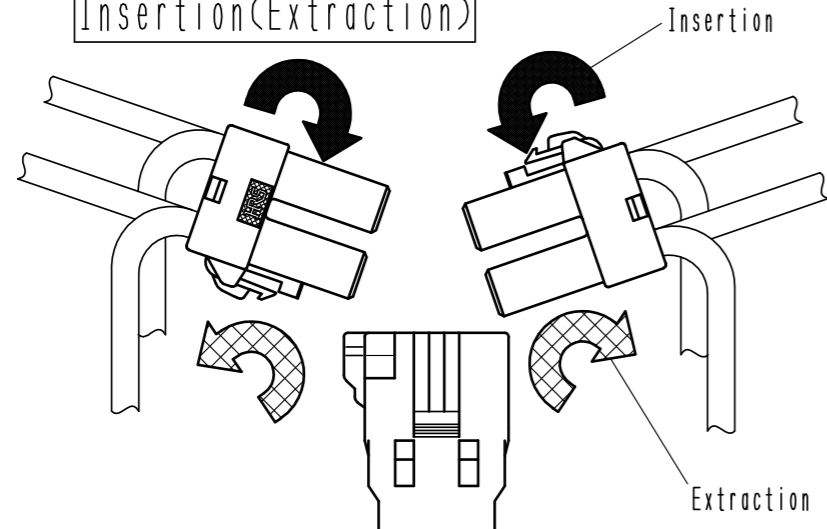


NG

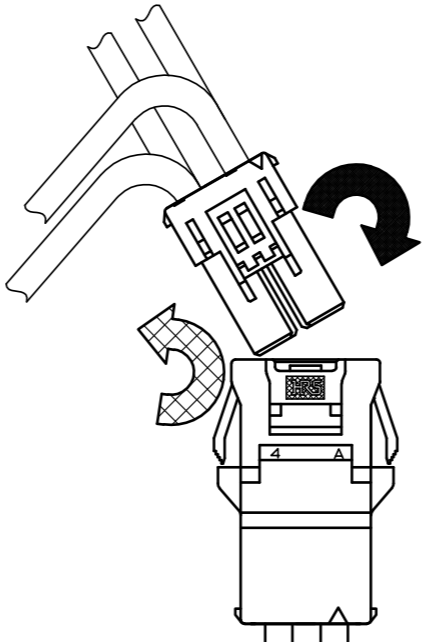

NG

Insert/Extract vertically

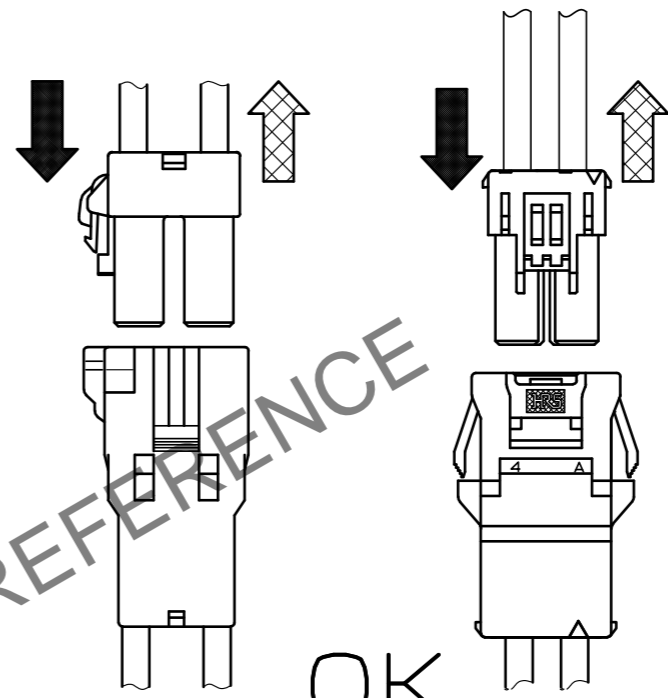


OK

2) When it is hard to extract, please lightly insert the connector beforehand and then pull it with releasing the lock.
Forced extraction has a risk of connector breakage.


◆ Notification of wiring



1) When using a thick cable, short cable length and bending close to the connector end, these load concentration may cause deformation.
Please note that there is firing risk using deformed connector.
When installing, please refrain from stress concentration such as cable bending close to the connector end or cable twisting.

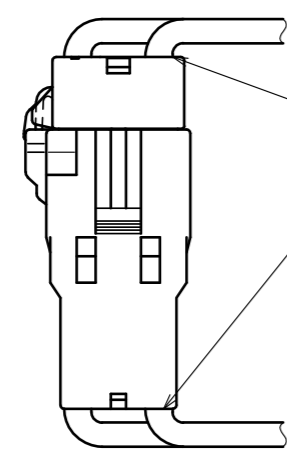

NG

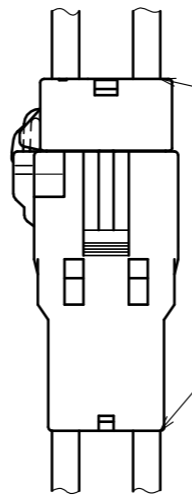

OK



| | |
|-------------|------------------|
| DRAWING NO. | EDC-163563-00-01 |
| PART NO. | DF22-4DEP-7. 92C |
| CODE NO. | CL680-1051-4-00 |