


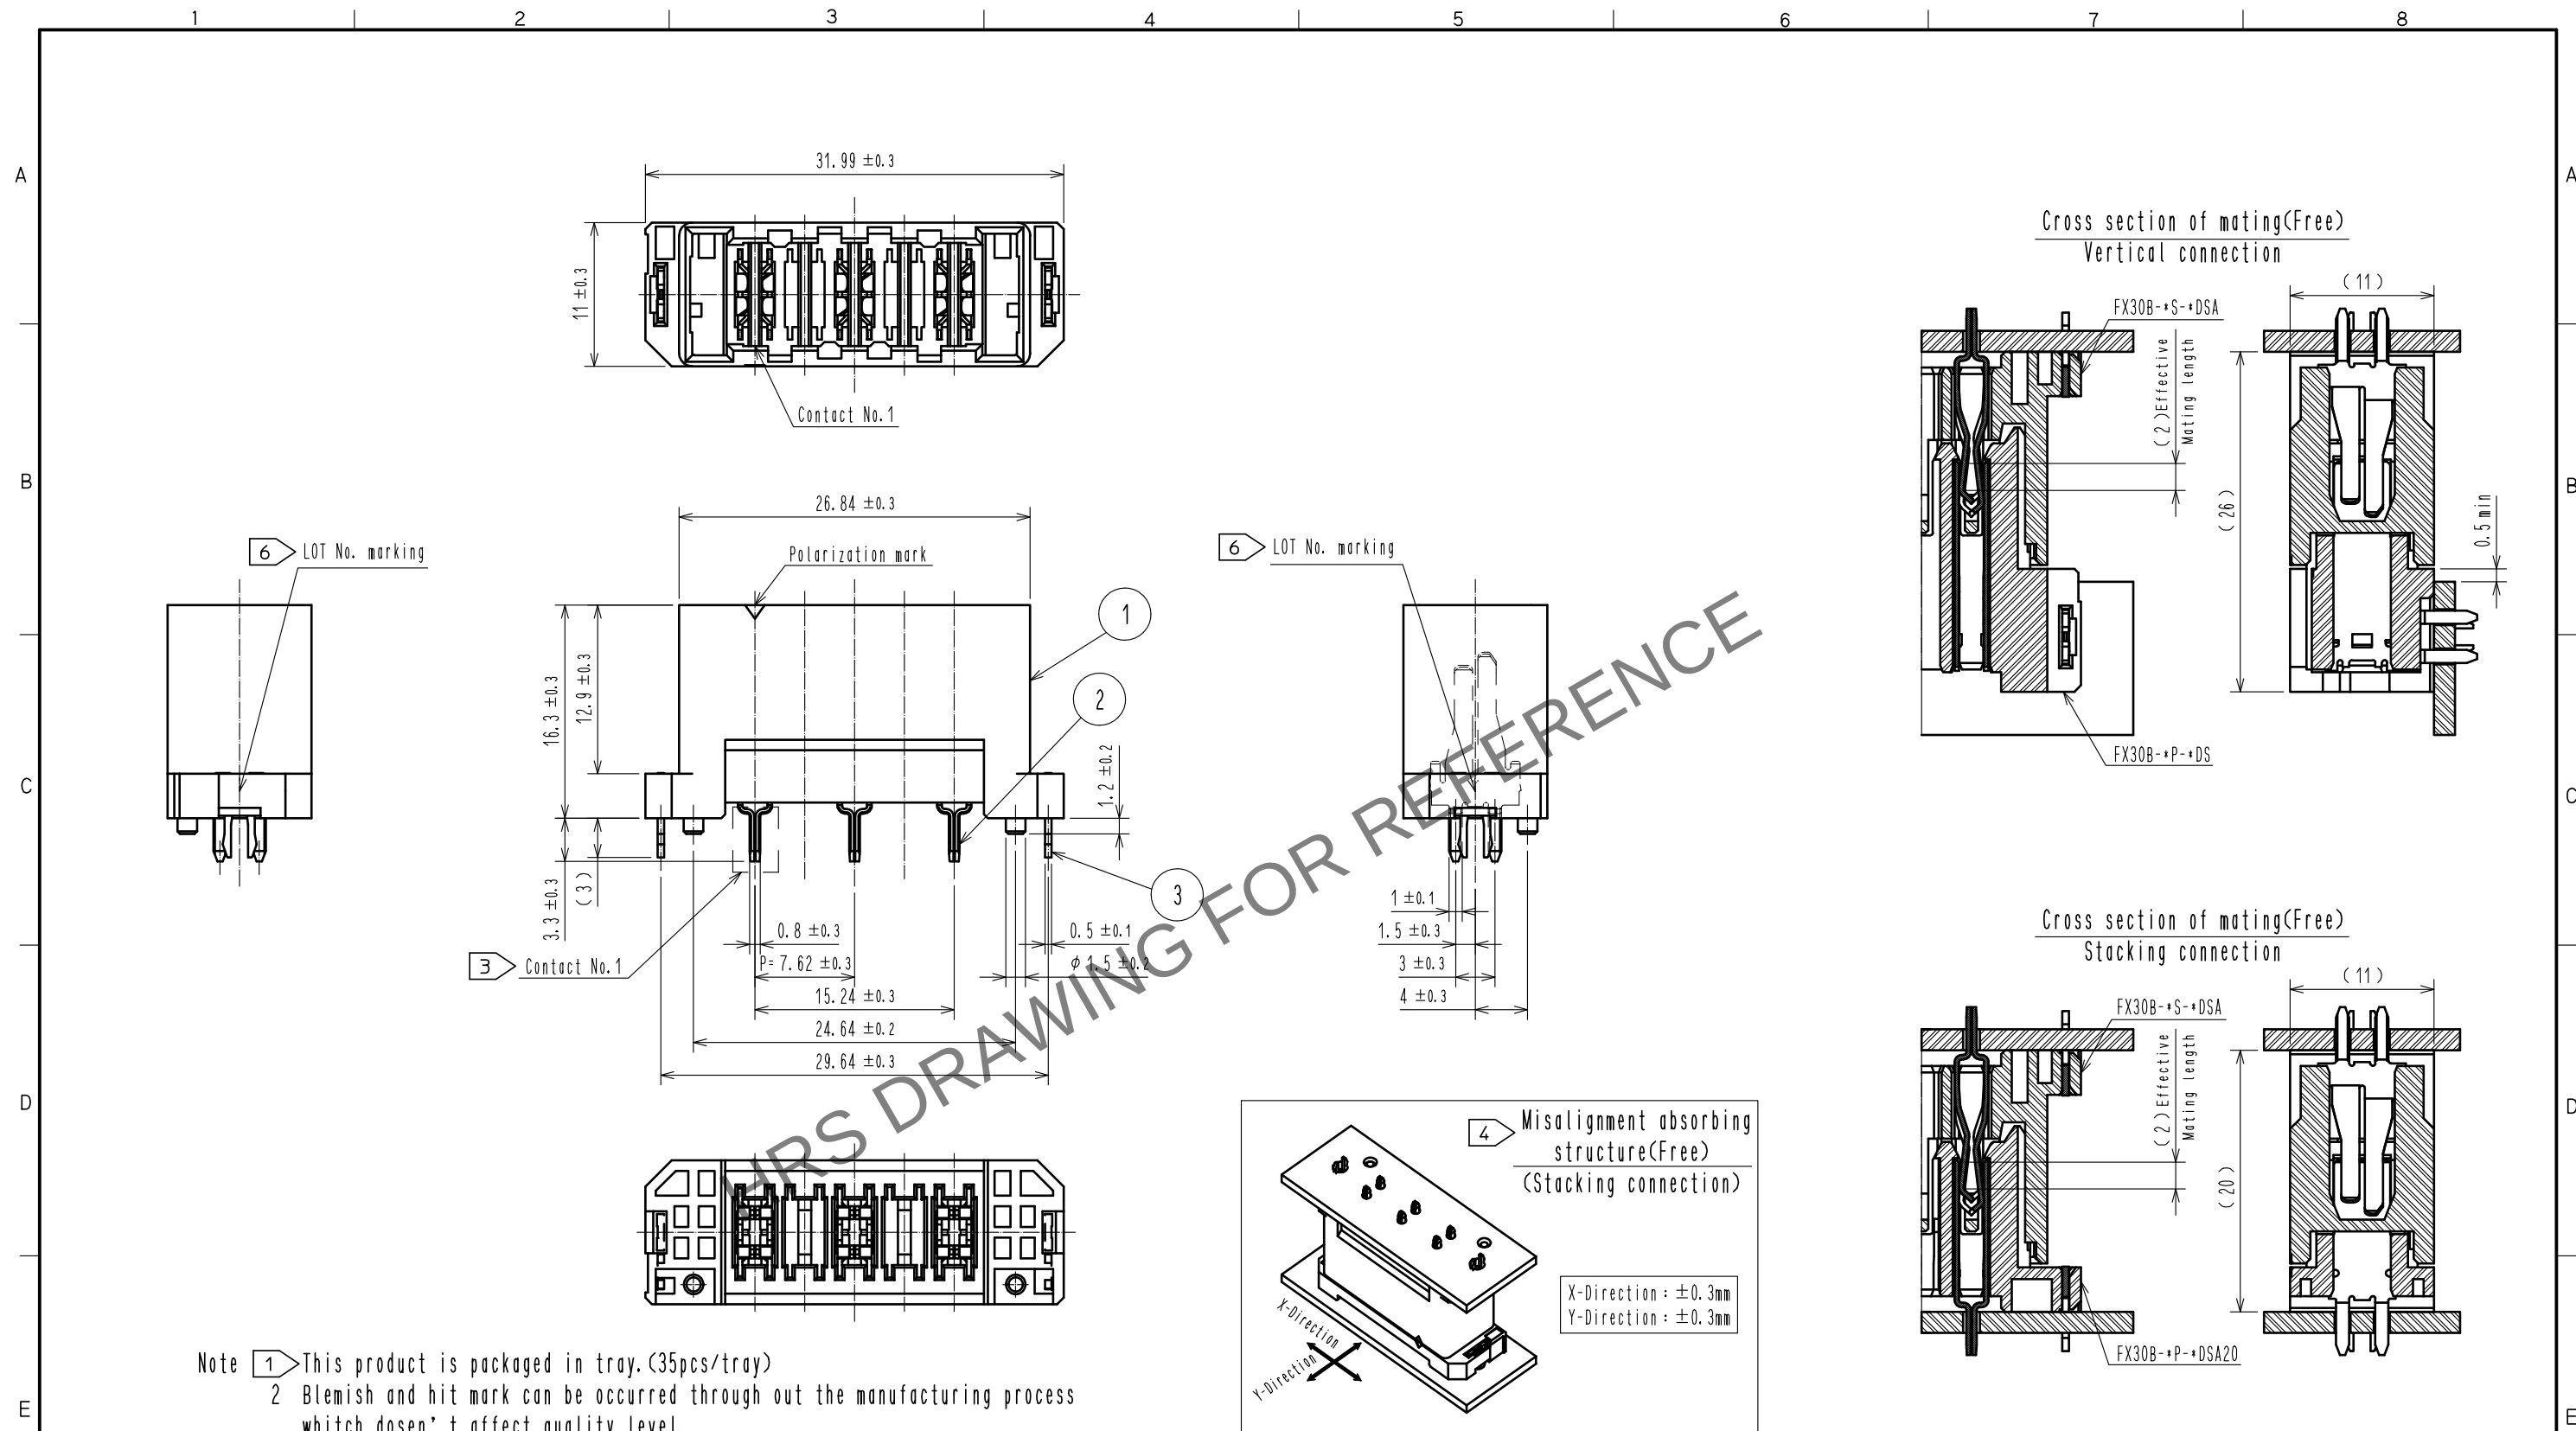


Note

- ① This product is packaged in tray.(35pcs/tray)
- 2 Blemish and hit mark can be occurred through out the manufacturing process
whitch dosen' t affect quality level.
Also, black spot could be observed on the surface of housing.
- ③ For the contact No., adjacent two pairs of leads placed back-to-back (4 leads in total)
Compose one line.
- ④ Misalignment absorbing range:±0.3mm max.
- 5 The dimension in parentheses are for references.
- ⑥ Lot No. is indicated at either one of the position as shown.

① 7 UL(File No.E52653)
C-UL(File No.E52653)

② TUV(Certificate No.R50275872) authorization article.

2	Copper alloy	Contact area:Gold-plating 0.1μm			4	Polystyrene		
		Lead area:Tin-plating 1.0μm						
		Under plating:Nickel 1.0μm						
1	Polyamide	Black UL94V-0			3	Phosphor bronze	Tin-plating 3.0μm	
							Under plating:Nickel 1.0μm	
NO.	MATERIAL	FINISH . REMARKS			NO.	MATERIAL	FINISH . REMARKS	

UNITS mm		SCALE 2 : 1		COUNT 1	DESCRIPTION OF REVISIONS DIS-F-00006019	DESIGNED AK. IWAHORI	CHECKED HT. YAMAGUCHI	DATE 20200406
-------------	---	----------------	---	------------	--	-------------------------	--------------------------	------------------

 HIROSE ELECTRIC CO., LTD.	APPROVED : HS. OKAWA	20140912	DRAWING NO.	EDC3-359166-00	
	CHECED : KN. SHIBUYA	20140912	PART NO.	FX30B-3S-7. 62DSA	
	DESIGNED : DK. AIMOTO	20140912	CODE NO.	CL570-3505-5-00	
	DRAWN : DK. AIMOTO	20140912			
					

