

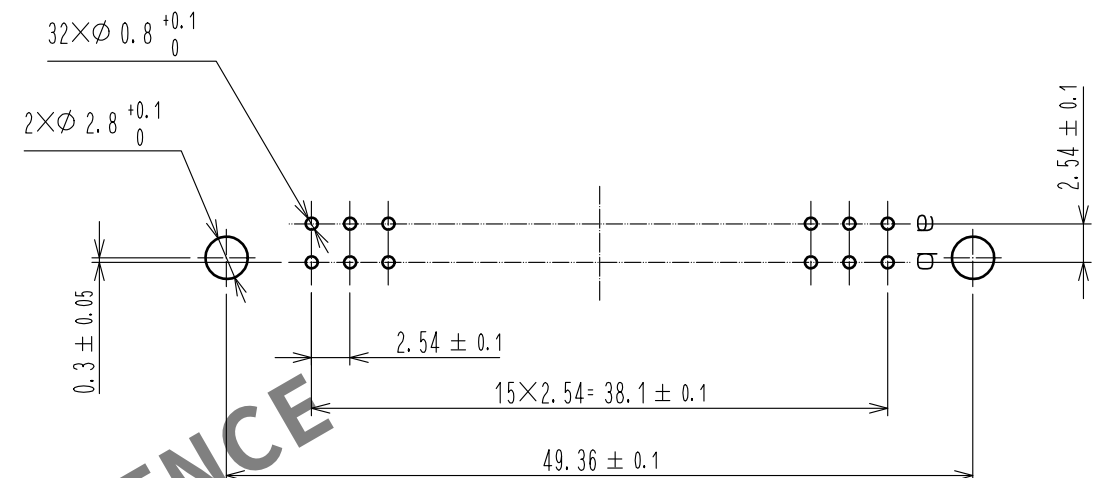
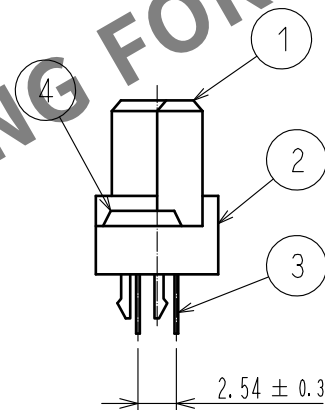
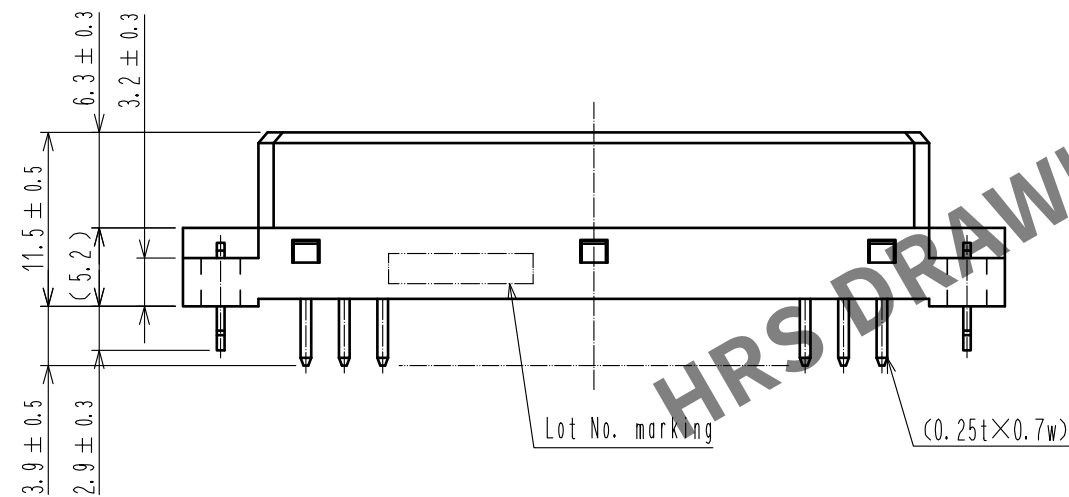



Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

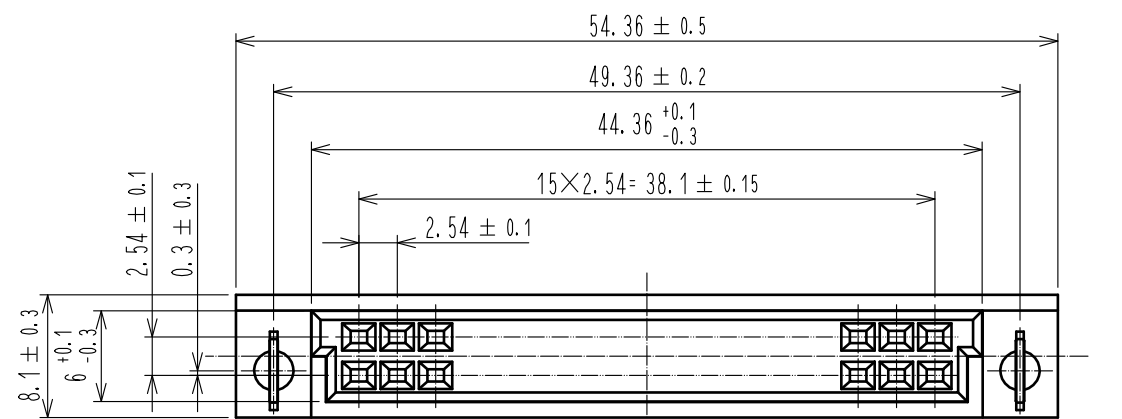

Recommended PC board hole pattern(t=1.6 ± 0.1)

Note 1 ULC(File No. E52653)

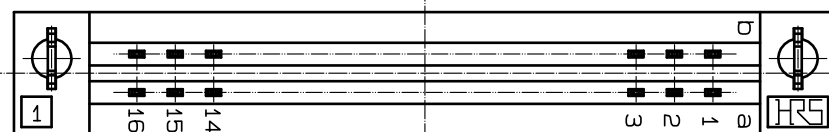

				4	PHOSPHOR BRONZE	Ni1 μm+Sn1 μm					
				3	COPPER ALLOY	CONTACT AREA : Ni1 μm+Au0.1 μm					
						DIP AREA : Ni1 μm+Sn1 μm					
1, 2	PBT		BEIGE, UL94V-0		NO.	MATERIAL	FINISH . REMARKS				
NO.		MATERIAL		FINISH . REMARKS		NO.	MATERIAL	FINISH . REMARKS			
UNITS mm				SCALE 2 : 1		COUNT 1	DESCRIPTION OF REVISIONS DIS-F-00017716		DESIGNED YU. NAKADA	CHECKED HT. YAMAGUCHI	DATE 20230329
 HIROSE ELECTRIC CO., LTD.		APPROVED : HS. OKAWA		20120524		DRAWING NO. EDC-019833-71-01					
		CHECKED : HT. YAMAGUCHI		20120524		PART NO. PCN12E-32S-2. 54DSA(71)					
		DESIGNED : KJ. NISHIWAKI		20120524		CODE NO. CL0583-2067-0-71					
		DRAWN : CR. TAKESHIMA		20120523		 					

HRS HIROSE ELECTRIC CO., LTD.