



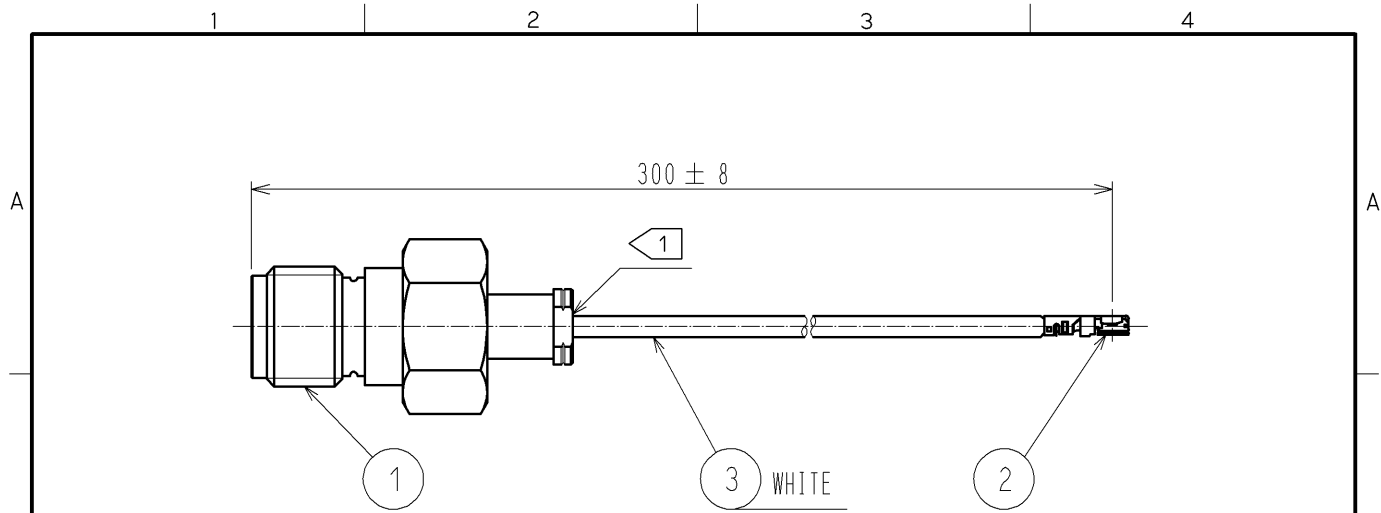


NOTE 1 Do not apply any excessive stress to the cable assembly position.
2 The drawing shows mated connector height only.

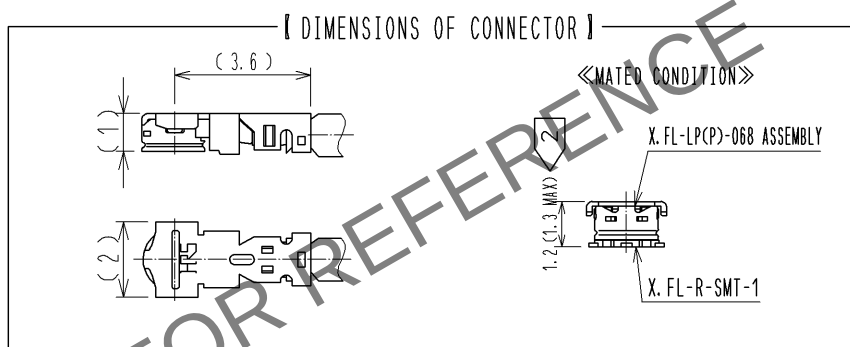

【 PRECAUTIONS FOR HANDLING 】

- ◆ Connector insertion and extraction
 - a. Insert the connector as perpendicularly to the mating surface as possible with aligning the mating axes of both connectors by specialised insertion JIG.
Part No. : W. FL-LP-IN. (CL331-0323-2) or X. FL-LP-IN. OUT1 (CL331-0715-2)
Do not excessively slant the connectors when inserting.
 - b. connector shall be extracted by specialised extraction JIG.
Part No. : X. FL-LP-IN. OUT1 (CL331-0715-2)
Never hold the cable when extracting the cable because it damages the connector.
- ◆ Allowable loads on the cable after the connectors are mated.
The right figures show the maximum allowable loads on the cable.
Do not apply loads exceeding these values to the cable.

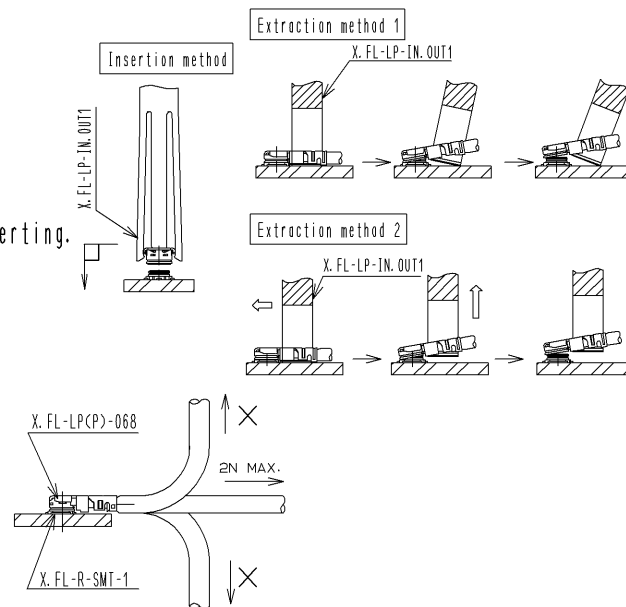

RoHS COMPLIANT

2		X. FL-LP(P)-068		CL331-0714-0-00		RoHS COMPLIANT											
1		HRM-200-066JBN(40)		CL323-0793-1-40		3		FWS5064(WHITE)		KURABE INDUSTRIAL CO.,LTD.							
NO.		PART NO.		CODE NO.		NO.		PART NO.		MANUFACTURER							
UNITS mm				SCALE FREE				COUNT		DESCRIPTION OF REVISIONS		DESIGNED		CHECKED		DATE	
 HIROSE ELECTRIC CO., LTD.				APPROVED : KY. SHIMIZU				14. 11. 17				DRAWING NO. EDC4-361456-02					
				CHECKED : TO. KATAYAMA				14. 11. 17				PART NO. HRMJ-X. FL-068K3TS-A-300RS					
				DESIGNED : YI. FUNADA				14. 11. 14				CODE NO. CL321-6605-0-02					
				DRAWN : YI. FUNADA				14. 11. 14				 1/1					