


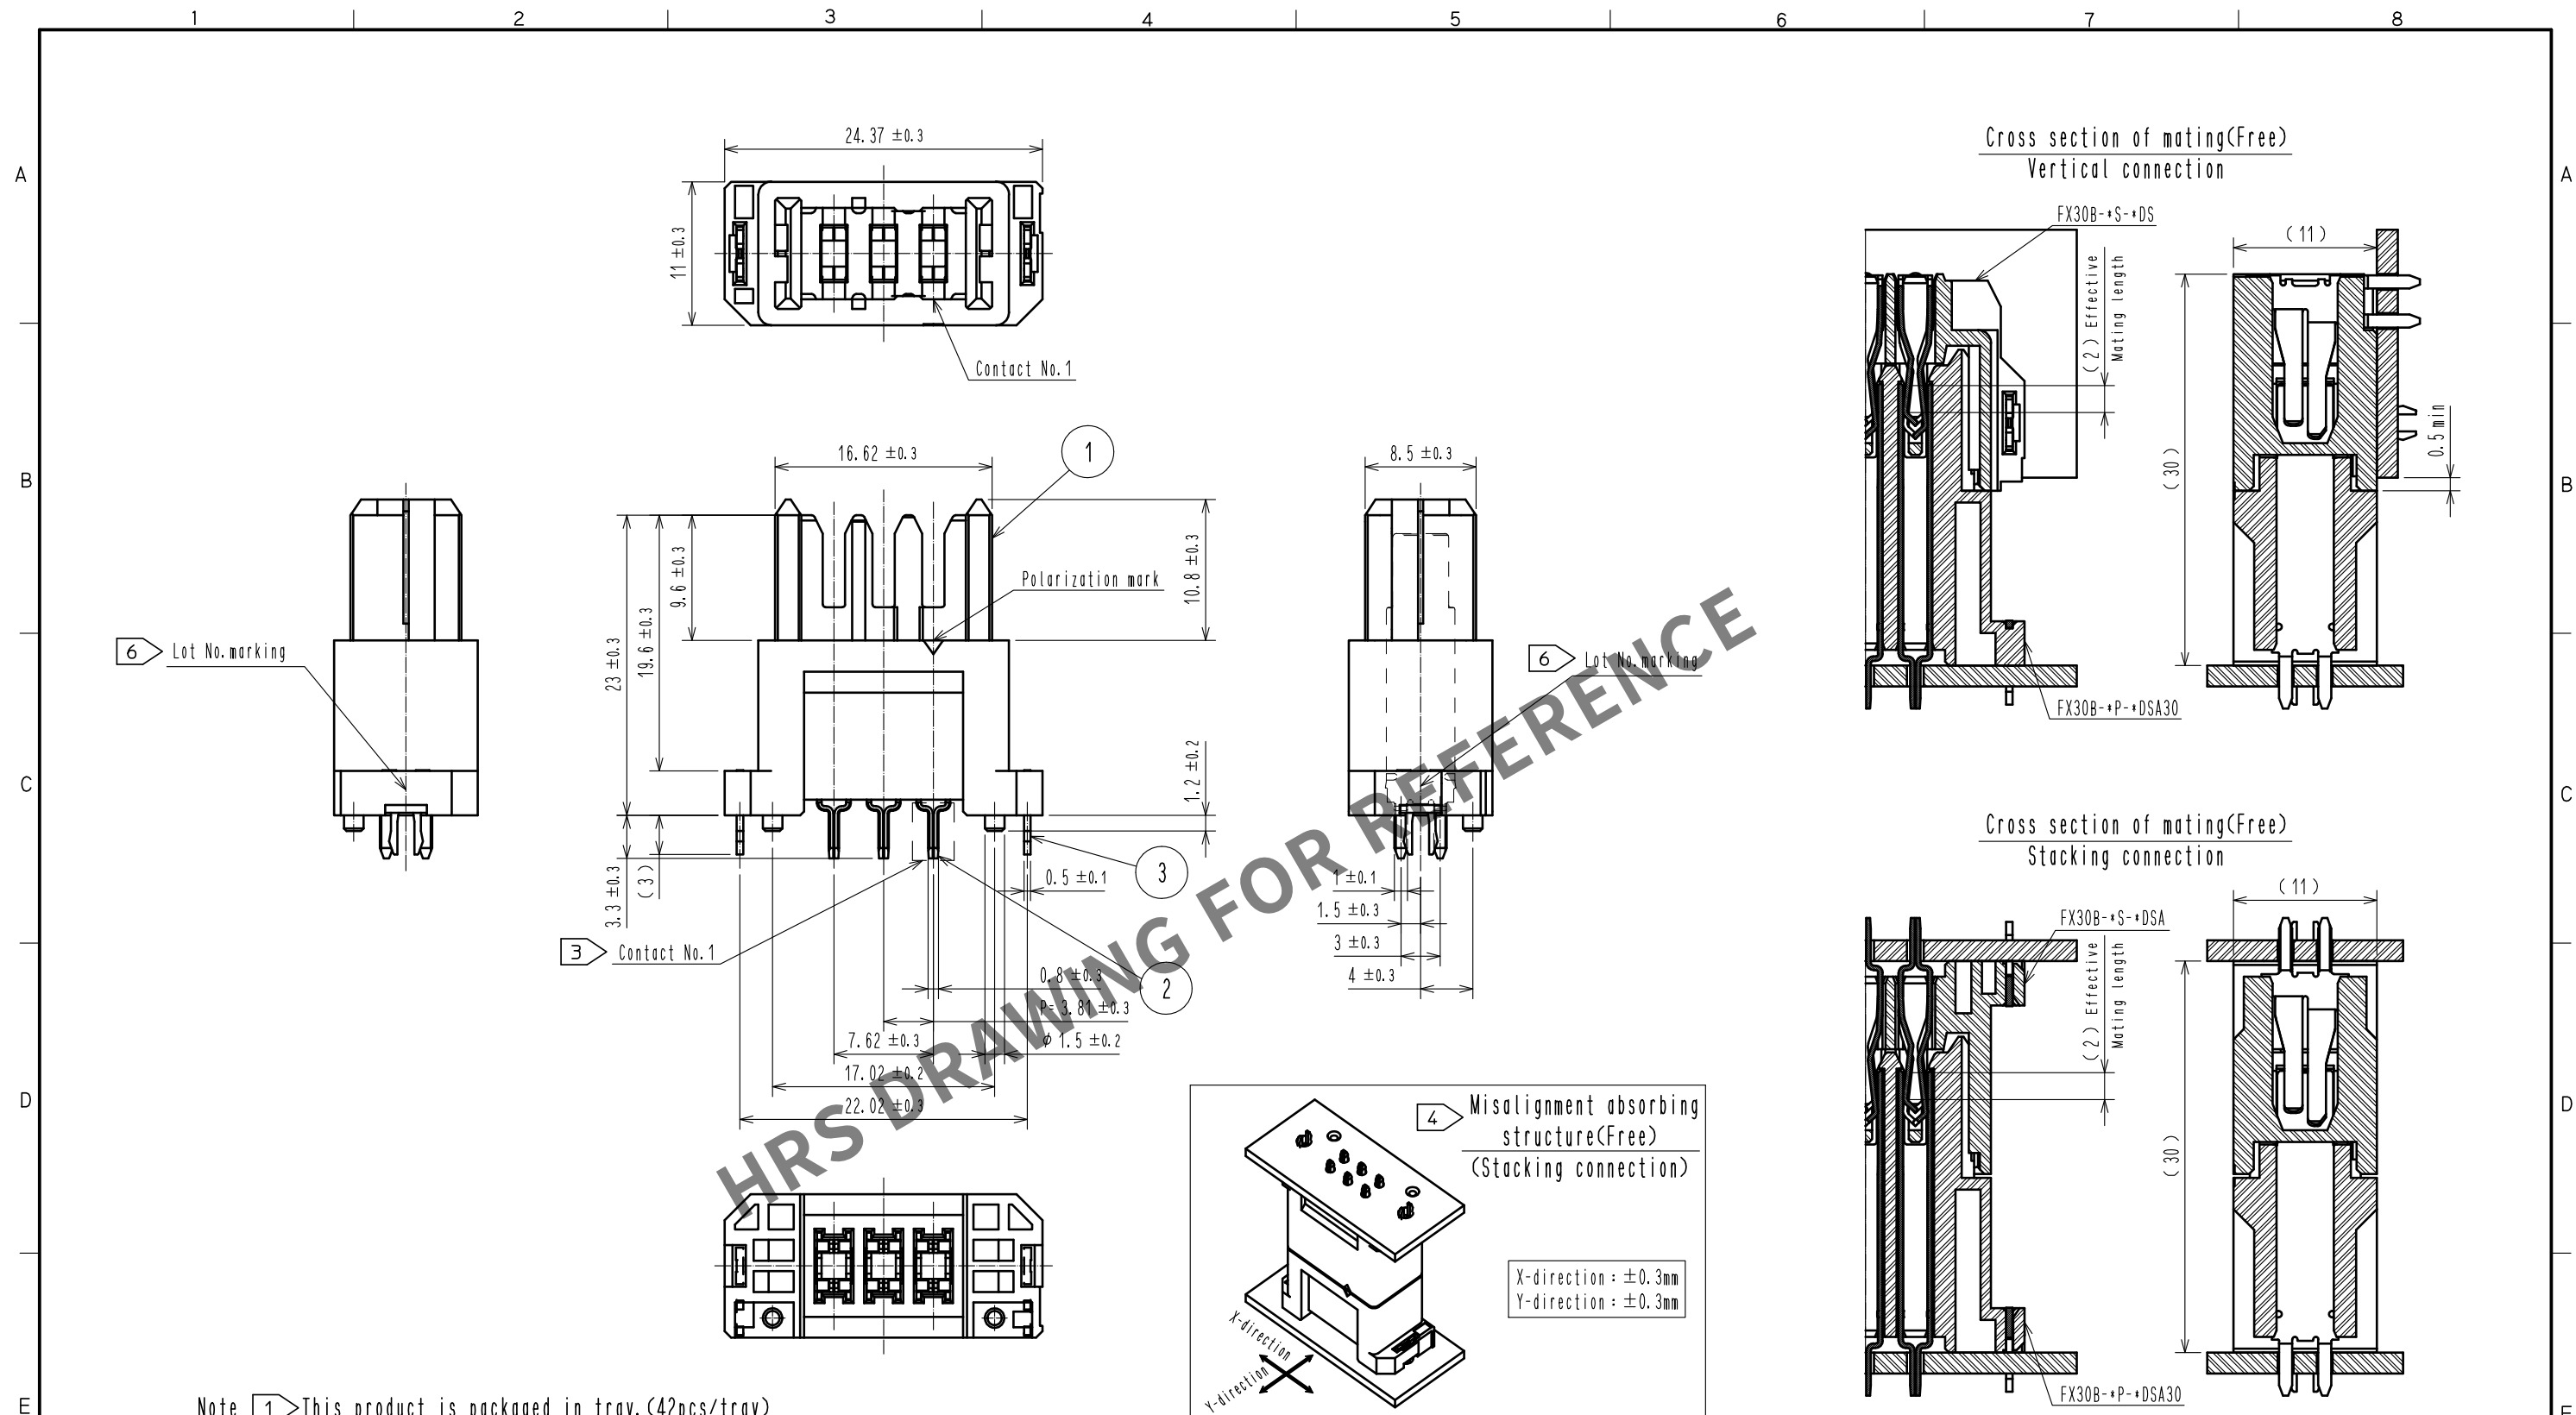

Note

- ① This product is packaged in tray. (42pcs/tray)
- ② Blemish and hit mark can be occurred through out the manufacturing process which doesn't affect quality level.
Also, black spot could be observed on the surface of housing.
- ③ For the contact No., adjacent two pairs of leads placed back-to-back (4 leads in total) compose one line.
- ④ Misalignment absorbing range: $\pm 0.3\text{mm}$ max.
- ⑤ The dimension in parentheses are for references.
- ⑥ Lot No. is indicated at either one of the position as shown.

① 7 UL (File No. E52653)
C-UL (File No. E52653)

② TUV (Certificate No. R50275872) authorization article.

2	COPPER ALLOY	CONTACT AREA:GOLD-PLATING 0.1 μm		4	POLYSTYRENE		
		LEAD AREA:TIN-PLATING 1.0 μm					
1	POLYAMIDE	UNDER PLATING:NICKEL 1.0 μm		3	PHOSPHOR BRONZE	TIN-PLATING 3.0 μm	
		BLACK UL94V-0				UNDER PLATING:NICKEL 1.0 μm	
NO.	MATERIAL	FINISH , REMARKS			NO.	MATERIAL	FINISH , REMARKS

UNITS mm		SCALE 2 : 1		COUNT	DESCRIPTION OF REVISIONS	DESIGNED	CHECKED	DATE
				1	DIS-F-00006019	AK. IWAHORI	HT. YAMAGUCHI	20200406

HIROSE ELECTRIC CO., LTD.	APPROVED	: HS. OKAWA	20130313	DRAWING NO.		EDC3-347265-00	
	CHECED	: KI. HIROKAWA	20130312	PART NO.		FX30B-3P-3. 81DSA30	
	DESIGNED	: DK. AIMOTO	20130311	CODE NO.		CL570-3301-5-00	
	DRAWN	: DK. AIMOTO	20130311				

1/2

