
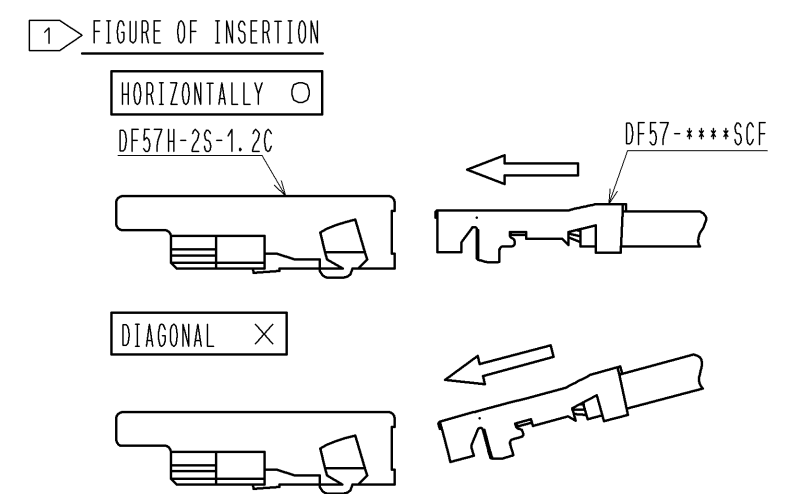
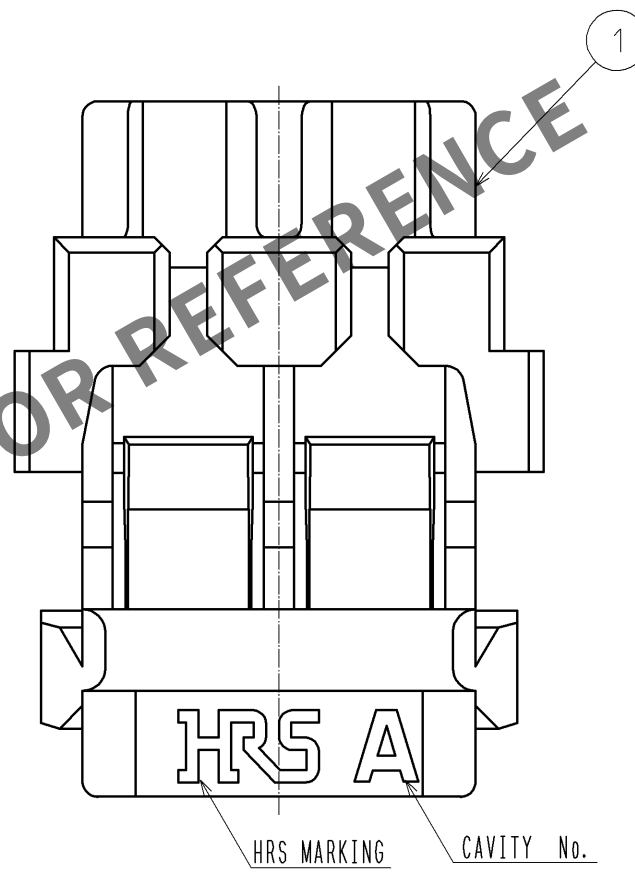
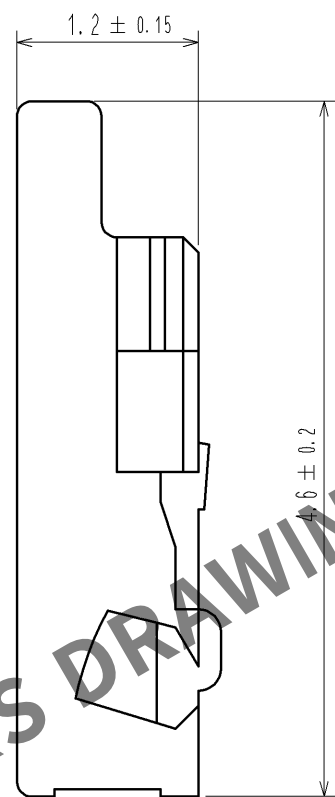
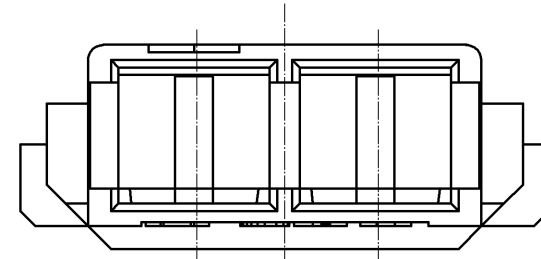
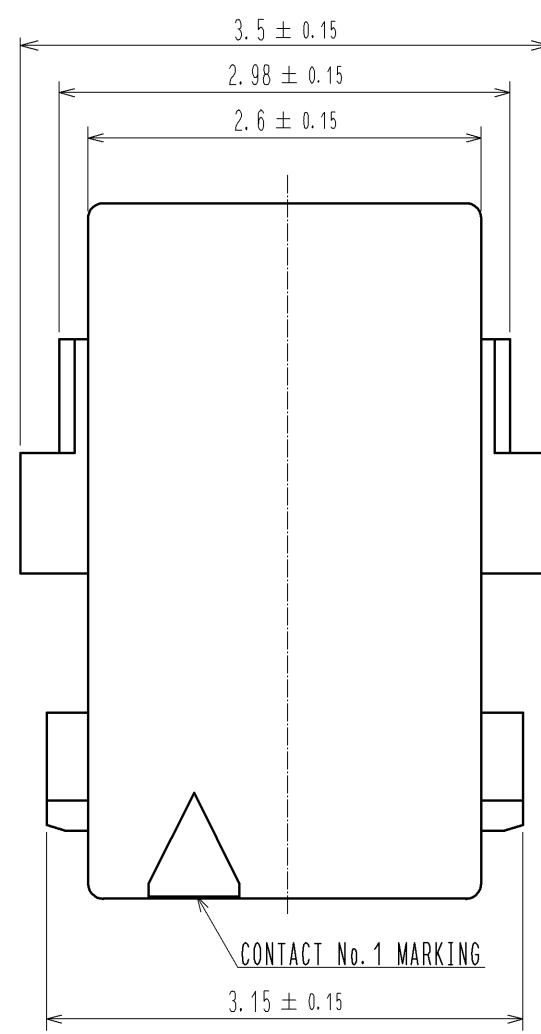


Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

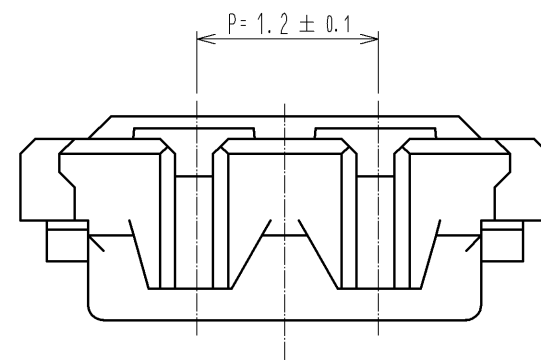

NOTE 1 AVOID ANGLED INSERTION OF CRIMP CONTACT(DF57-***SCF) TO MAINTAIN PERFORMANCE RELIABILITY.


NO.			1			PBT			UL94V-0. NATURAL(WHITE)		
MATERIAL			FINISH . REMARKS			MATERIAL			FINISH . REMARKS		
UNITS mm			SCALE 20 : 1		COUNT	DESCRIPTION OF REVISIONS			DESIGNED	CHECKED	DATE
HIROSE ELECTRIC CO., LTD.		APPROVED : KI. AKIYAMA		12. 03. 19		DRAWING NO.			EDC3-343900-00		
		CHECKED : HK. UMEHARA		12. 03. 19		PART NO.			DF57H-2S-1. 2C		
		DESIGNED : TS. KUMAZAWA		12. 03. 19		CODE NO.			CL666-0100-6-00		
		DRAWN : TS. KUMAZAWA		12. 03. 19							

Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.


DF57 Series Mating / Unmating Operation Instruction

Mating


①By positioning the convexity of the socket sides to the header concavity, align the centers of the socket and the header in pitch direction.

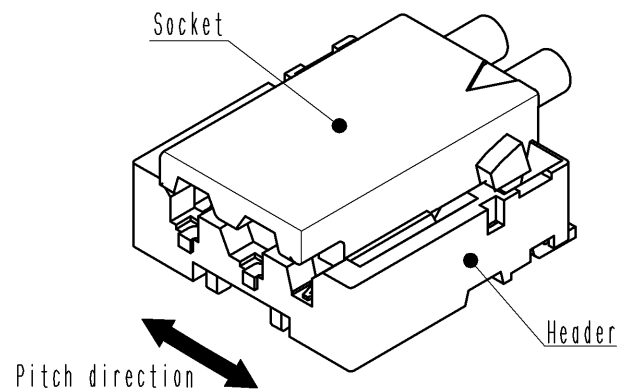

②Slightly press the socket down at cable side to tilted angle.

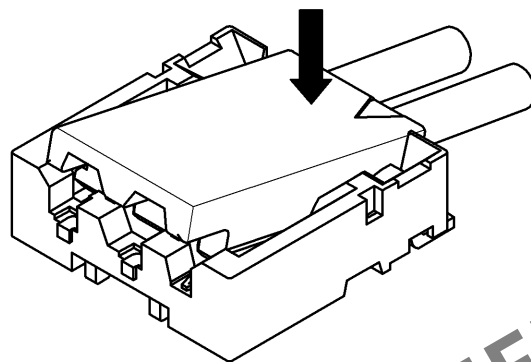


③Press down at the lever side with stabilizing the cable side to insert. Mating completes.

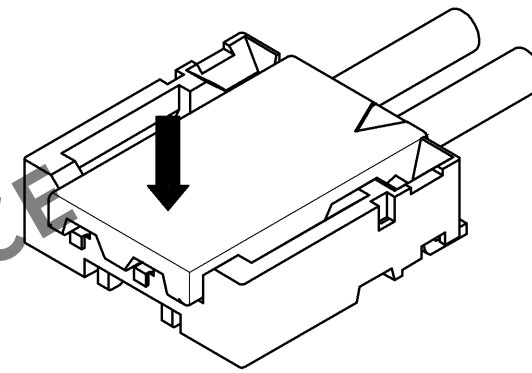


Unmating


①Hook the lever with finger nail.

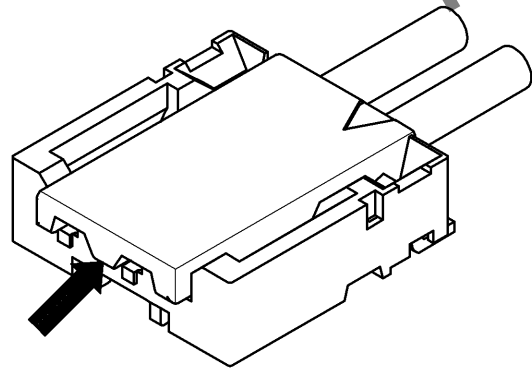

②Lift up to the upper direction and friction lock is released.

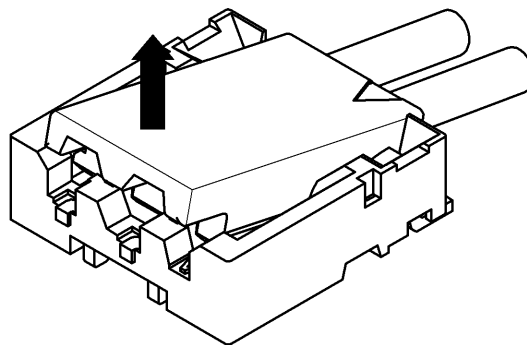

③Lift up to the upper direction and positive lock is released. Removal completes.

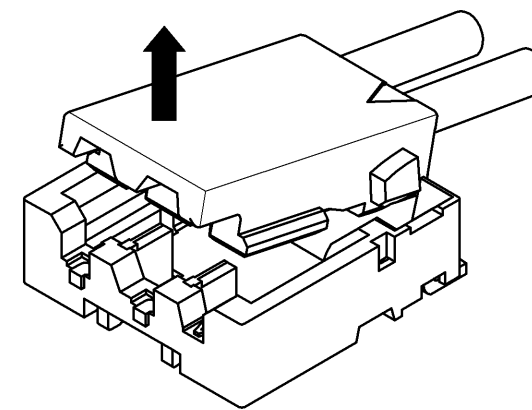

HRS

DRAWING NO.	EDC3-343900-00
PART NO.	DF57H-2S-1.2C
CODE NO.	CL666-0100-6-00

△ 2/2