



Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

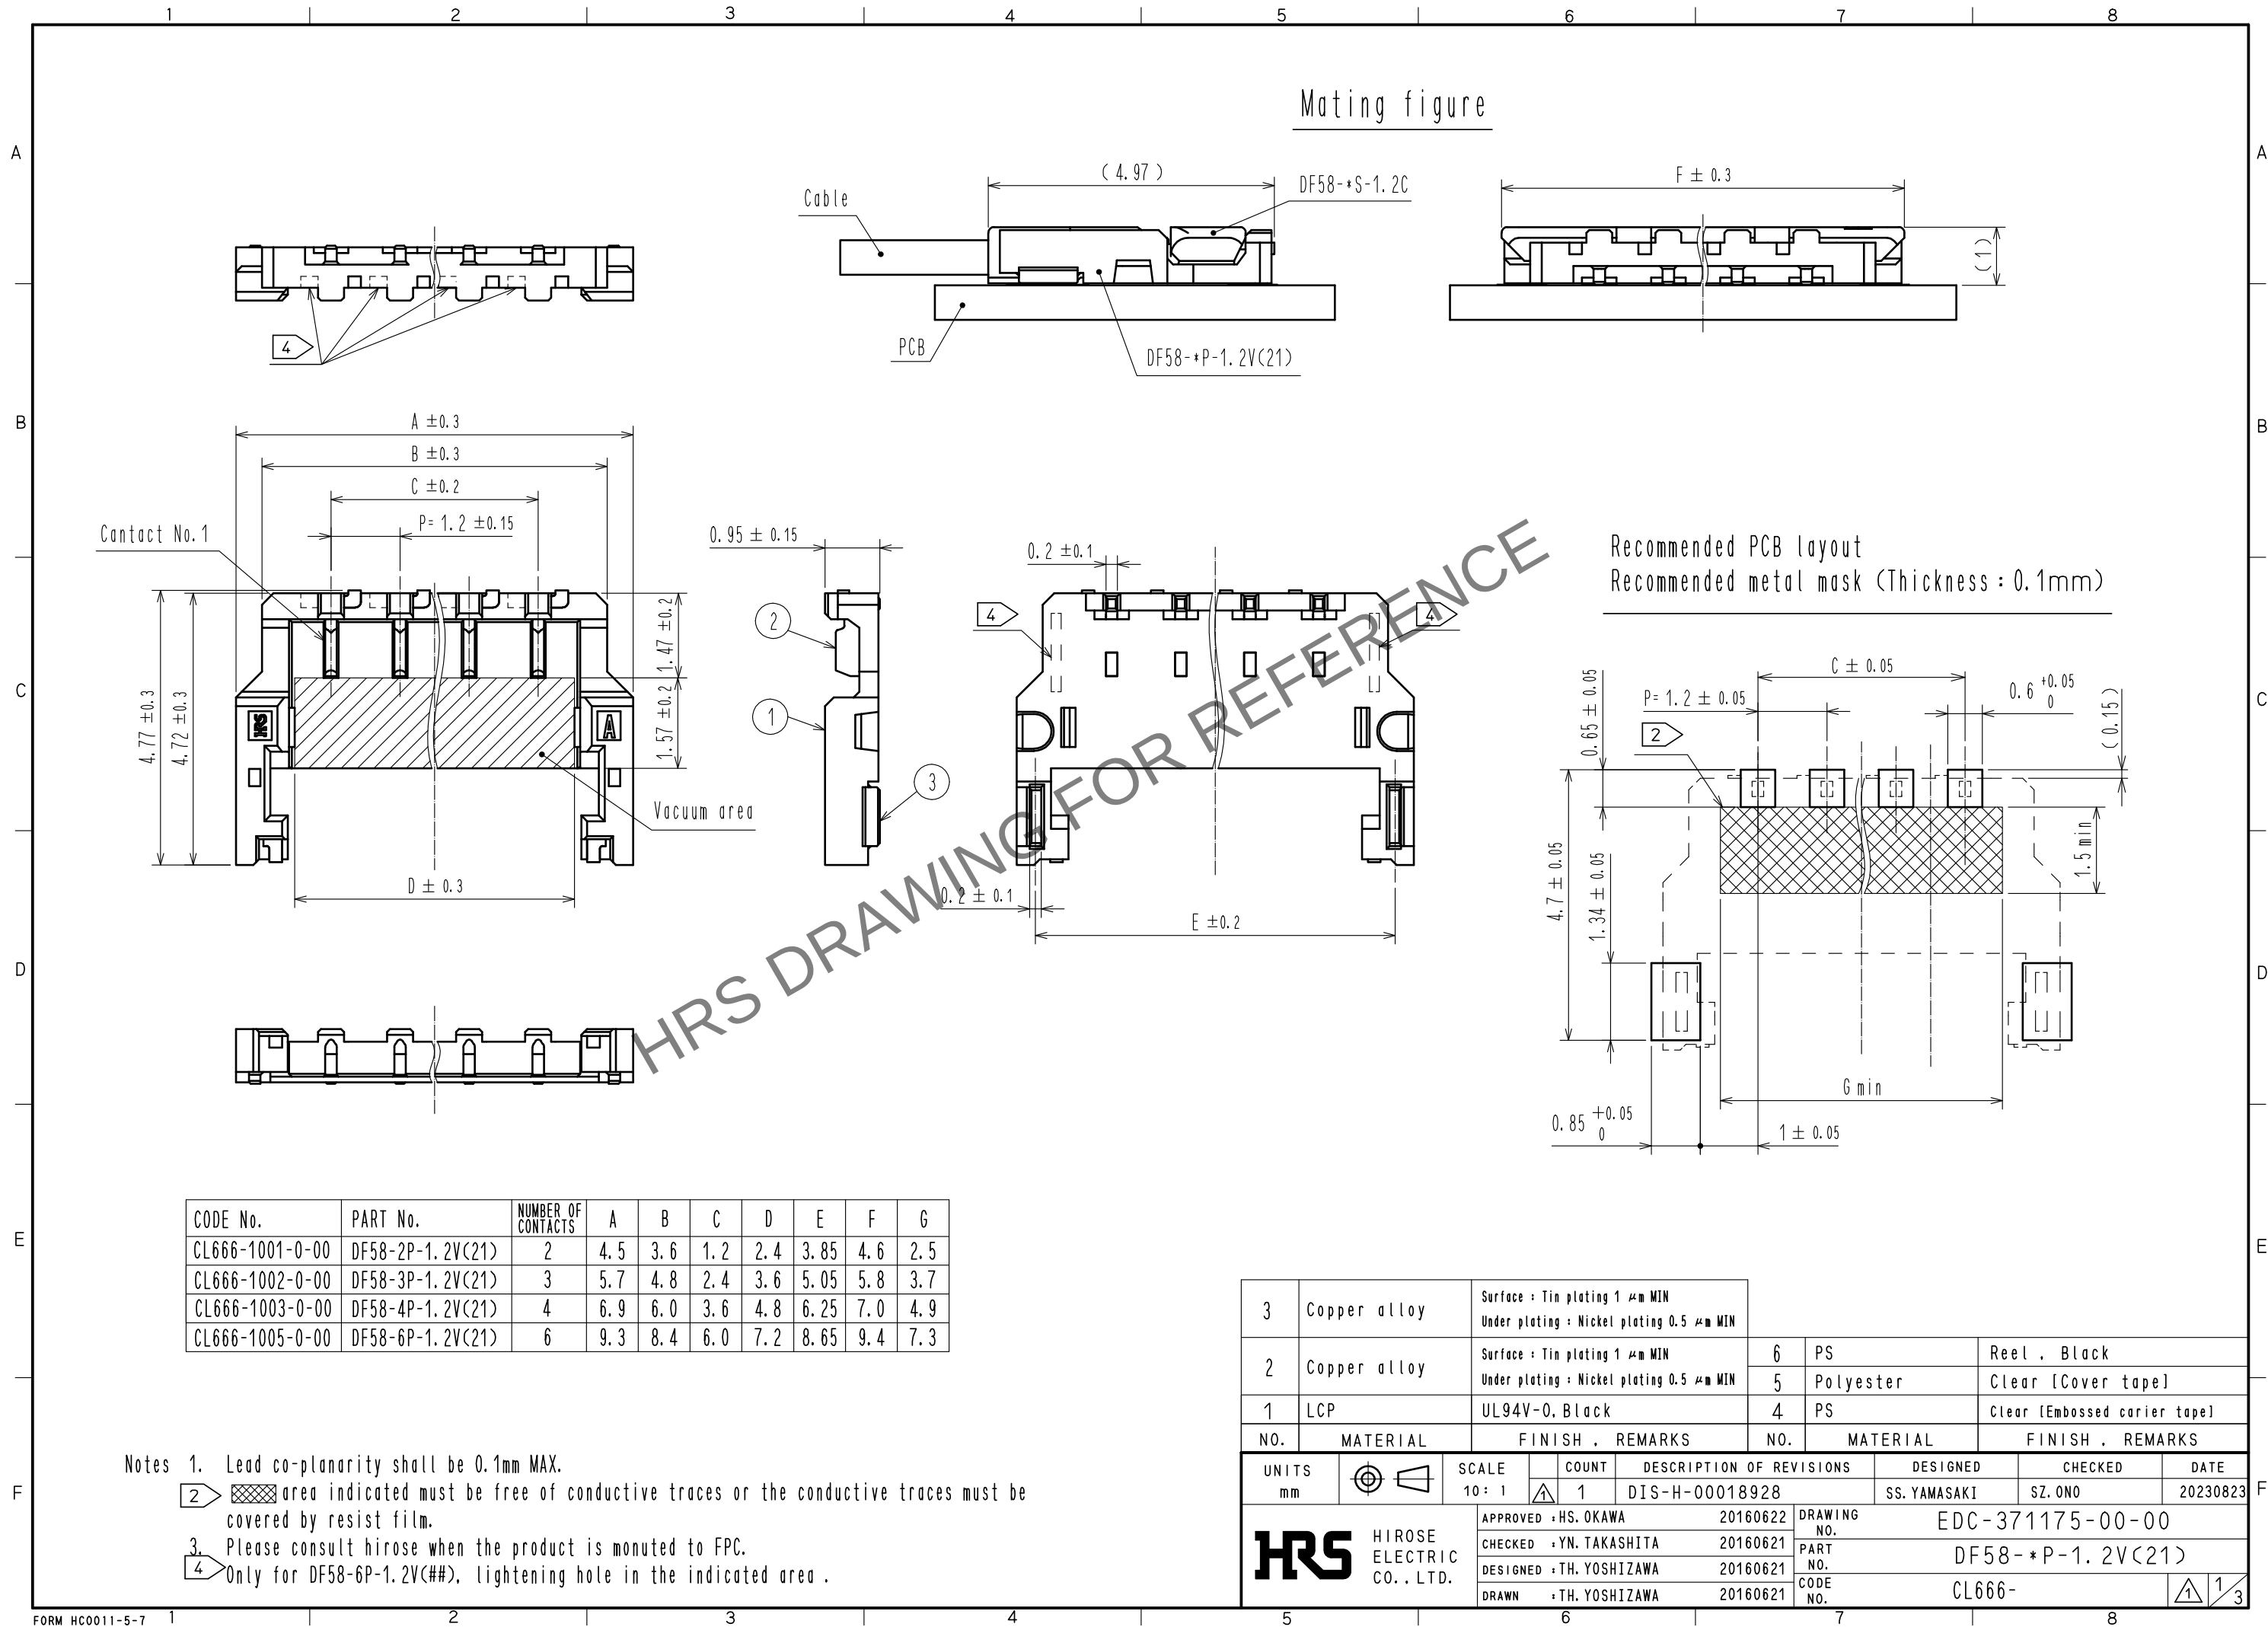


Reflow temperature profile using lead-free solder paste (Reference)

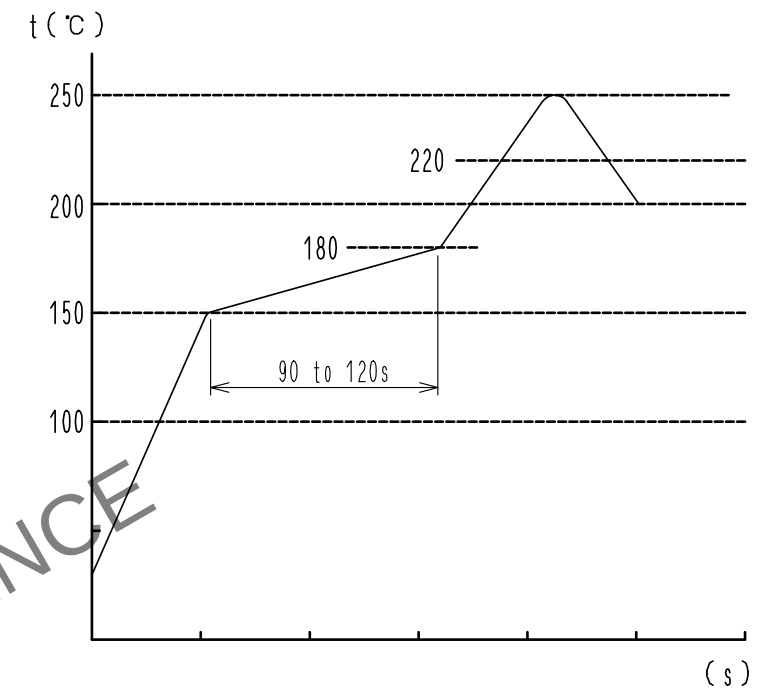

Additional factors, such as solder paste type, PCB size and other mounted components could affect the profile. therefore, a thorough evaluation of mounting condition is required prior to production. Temperature is measured at contact lead.

Style and dimension of reel (Free)

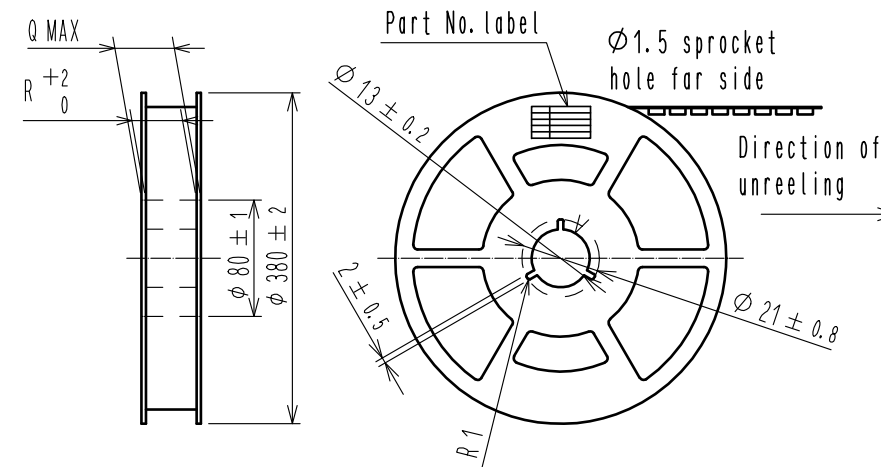

ロットNo.	230728-1-01
☒ 番	CL666-****-21
品 名	DF58-＊P-1.2V(21)
納入数量	6000 K0
納入者	ヒロセ電機(株)

Supplier
Quantity
Part No.
Code No.
(ex.) 230728-1-01
Product Number
Line No.
2023/7/28

CODE No.	PART No.	NUMBER OF CONTACTS	M	N	P	Q	R
CL666-1001-0-00	DF58-2P-1.2V(21)	2	16.0	14.25	7.5	22.4	16.4
CL666-1002-0-00	DF58-3P-1.2V(21)	3	16.0	14.25	7.5	22.4	16.4
CL666-1003-0-00	DF58-4P-1.2V(21)	4	24.0	22.25	11.5	30.4	24.4
CL666-1005-0-00	DF58-6P-1.2V(21)	6	24.0	22.25	11.5	30.4	24.4

NOTES 5 . 1 reel : 6000 connectors
 6 Reel to JIS C 0806. (Packaging of components for automatic handling)
 7 . The dimensions in parentheses are for reference.


HRS	DRAWING NO.	EDC-371175-00-00		
	PART NO.	DF58- * P-1. 2V(21)		
	CODE NO.	CL666-	1	2 3

Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.


DF58 Series Mating / Unmating Operation Instruction

Mating


① By positioning the convexity of the socket sides to the header concavity, align the centers of the socket and the header in pitch direction.

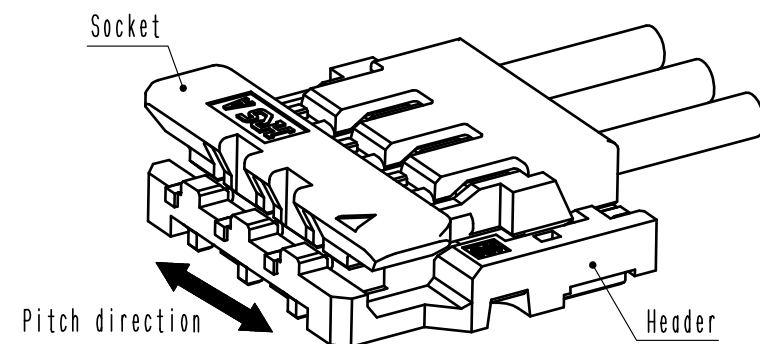

② Slightly press the socket down at the center of the socket.

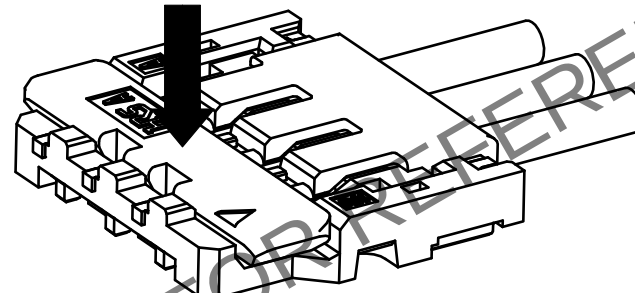


③ Press down at the lever side with stabilizing the cable side to insert. Mating completes.

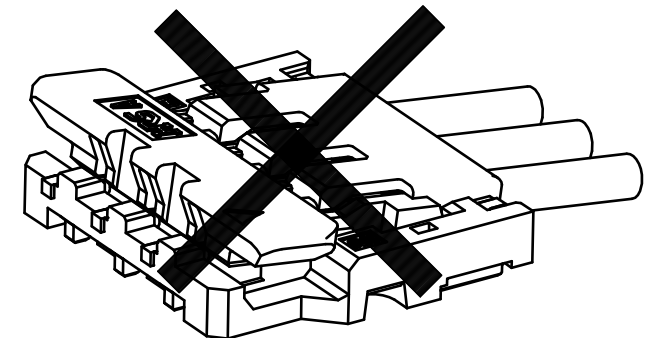


Unmating

① Hook the lever with finger nail. (Possible with one side)

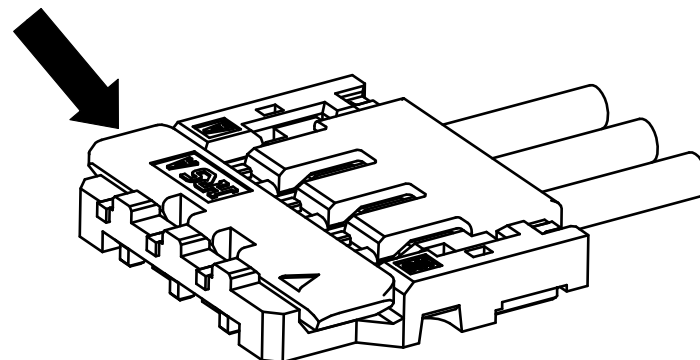

② Lift up to the upper direction and friction lock is released.

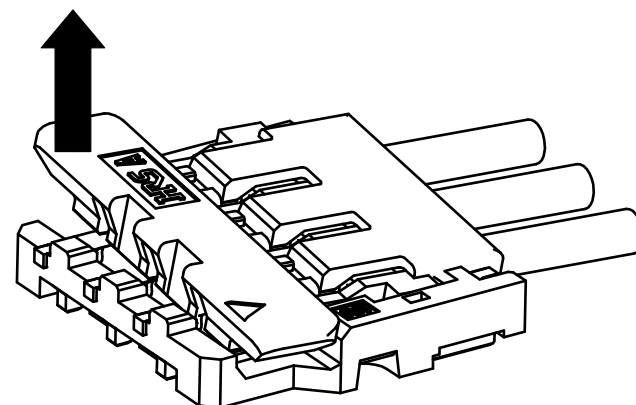

③ Lift it up to the upper direction more. and removal completes.

