
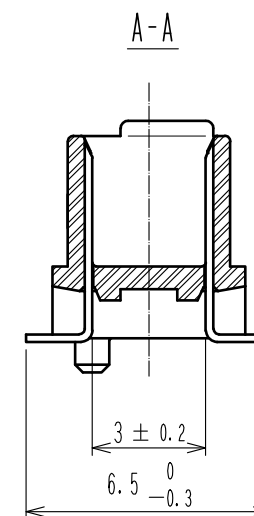
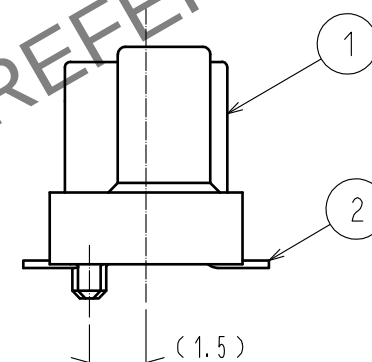
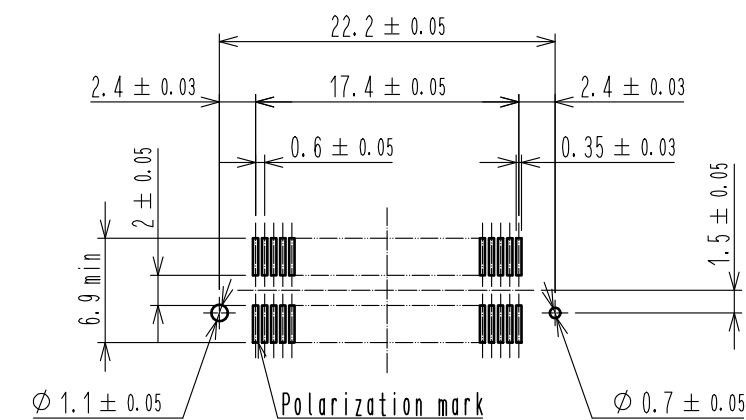


A
—
B
—
C
—
D
—
E
—
F



- Notes
- 1 Lead CO-PLANARITY shall be 0.1mm max.
 - 2 Tube packaging shall be applied for this product.
See next page for details.
 - 3 For modification, etc., preventive hole for sink mark may be added according to circumstances.
 - 4 The dimensions in parentheses are for reference.

2	PHOSPHOR BRONZE	Contact area : Gold 0.1μm min.		4	POLYVINYL CHLORIDE	(Stopper)	
		Lead area : Tin-plating 1μm min.					
		Under plating : Nickel 1μm min.					
1	PPS	Light brown (UL94V-0)		3	POLYVINYL CHLORIDE	(Tube)	
NO.	MATERIAL	FINISH , REMARKS			NO.	MATERIAL	FINISH , REMARKS


UNITS mm		SCALE 5 : 1		COUNT 1	DESCRIPTION OF REVISIONS DIS-F-00006414	DESIGNED KS. NAKAJIMA	CHECKED HT. YAMAGUCHI	DATE 20200803
 HIROSE ELECTRIC CO., LTD.		APPROVED +HS. OKAWA	20051216		EDC-150831-91-21			
		CHECKED +HS. OZAWA	20051216		FX8C-60P-SV1(91)			
		DESIGNED +KY. NAKAMURA	20051216		CL578-0521-6-91			
		DRAWN +SY. KAMIGA	20051108		 1/3			
					DRAWING NO.			
					PART NO.			
					CODE NO.			



**HIROSE
ELECTRIC
CO., LTD.**

△¹ Added precaution

Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

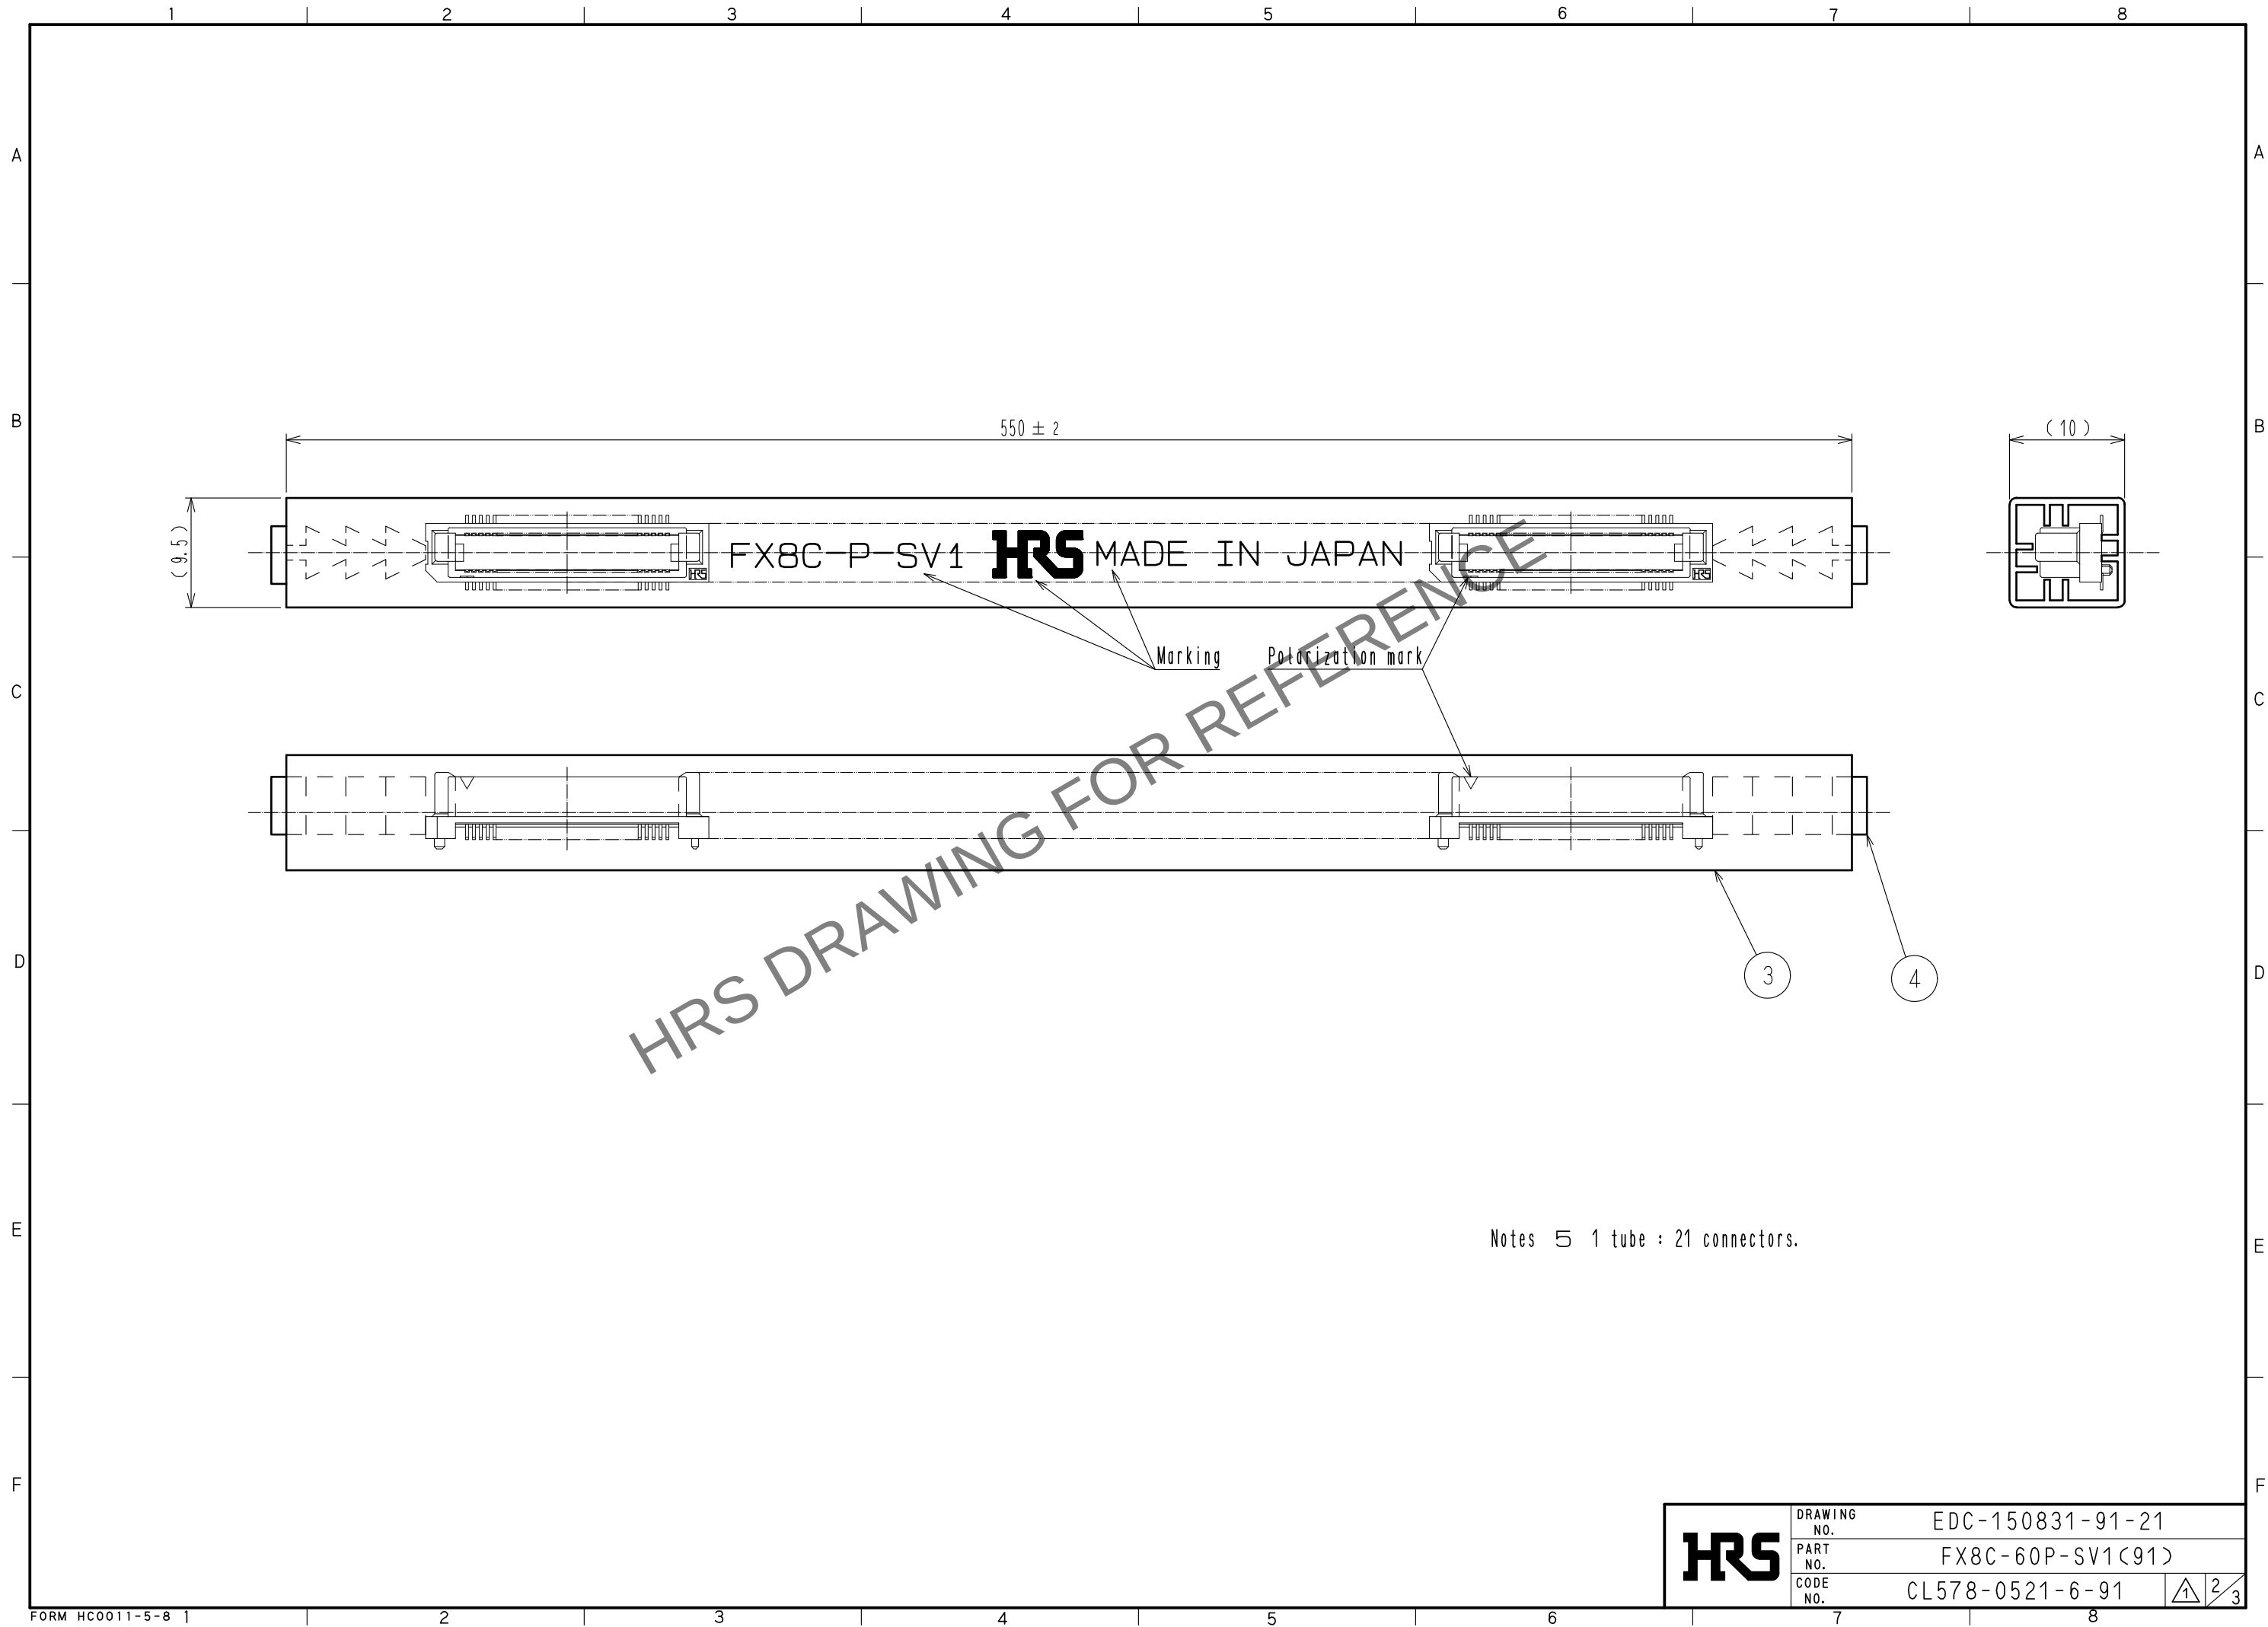

HRS

DRAWING NO.	EDC-150831-91-21
PART NO.	FX8C-60P-SV1(91)
CODE NO.	CL578-0521-6-91

1/2/3



Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

【Precaution】

When a board with multiple connectors mounted is mated, the connector may be damaged or deformed.
Please divide one side of the board so only one connector is mated per board.

OK

NG

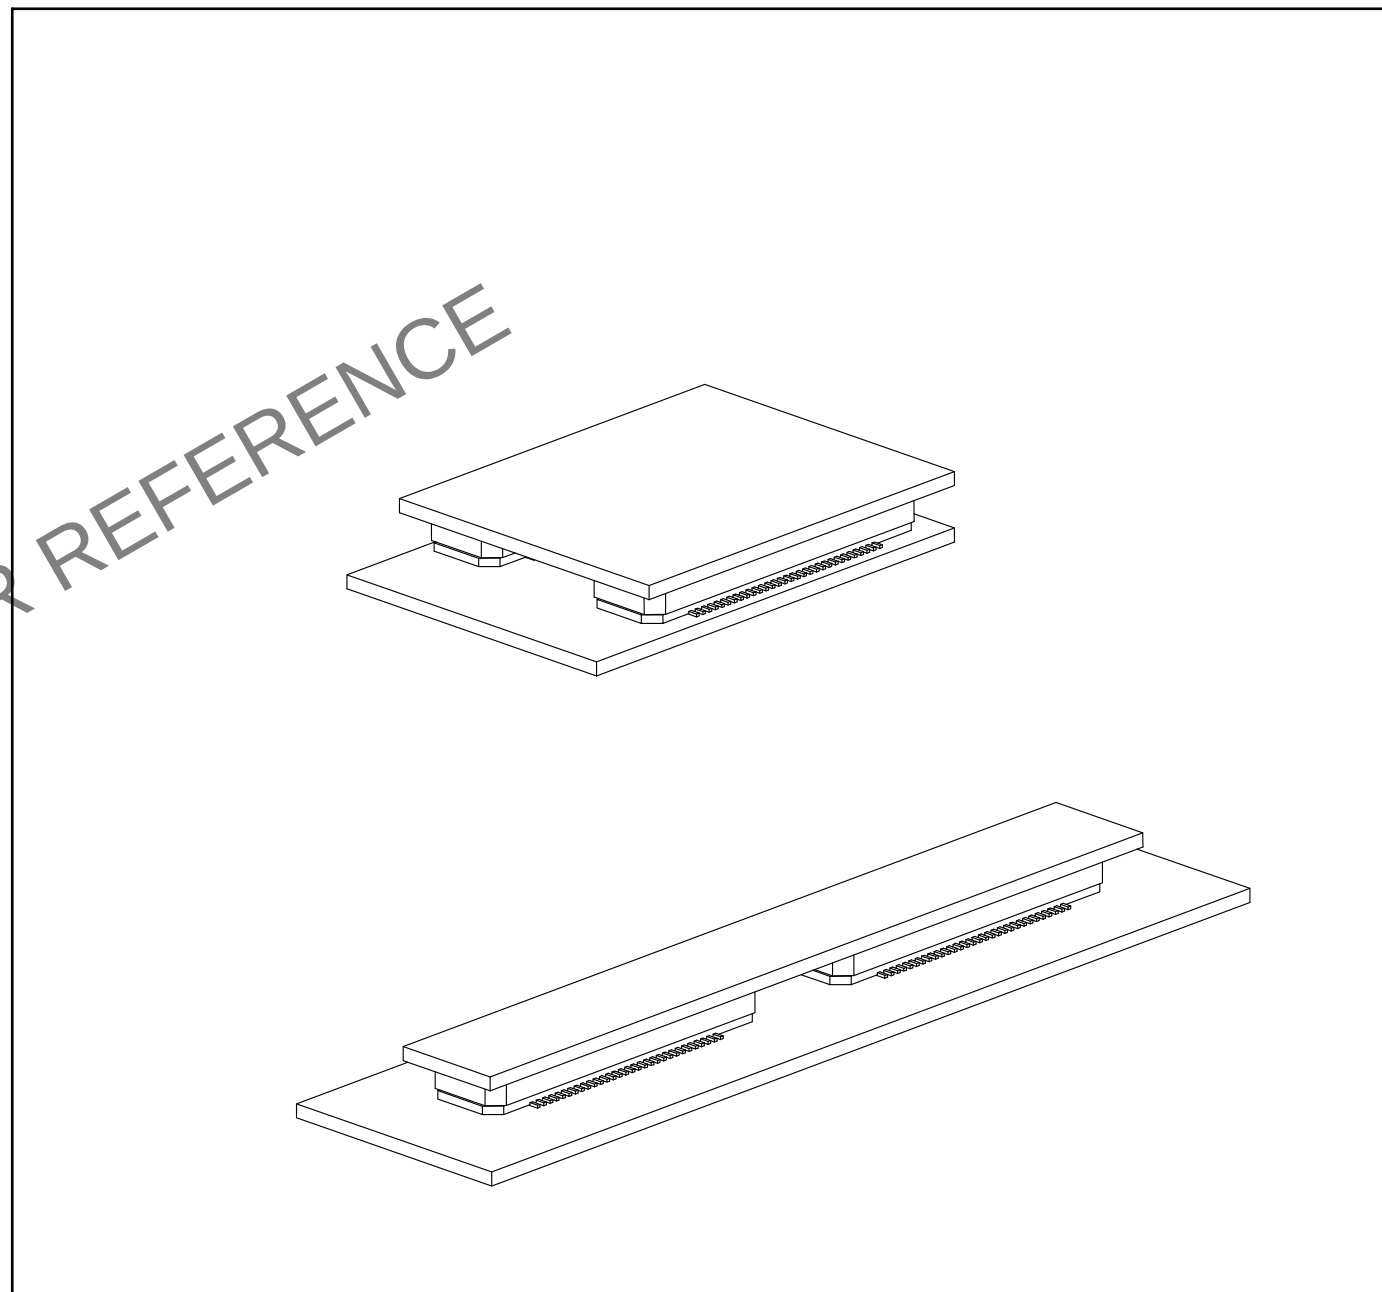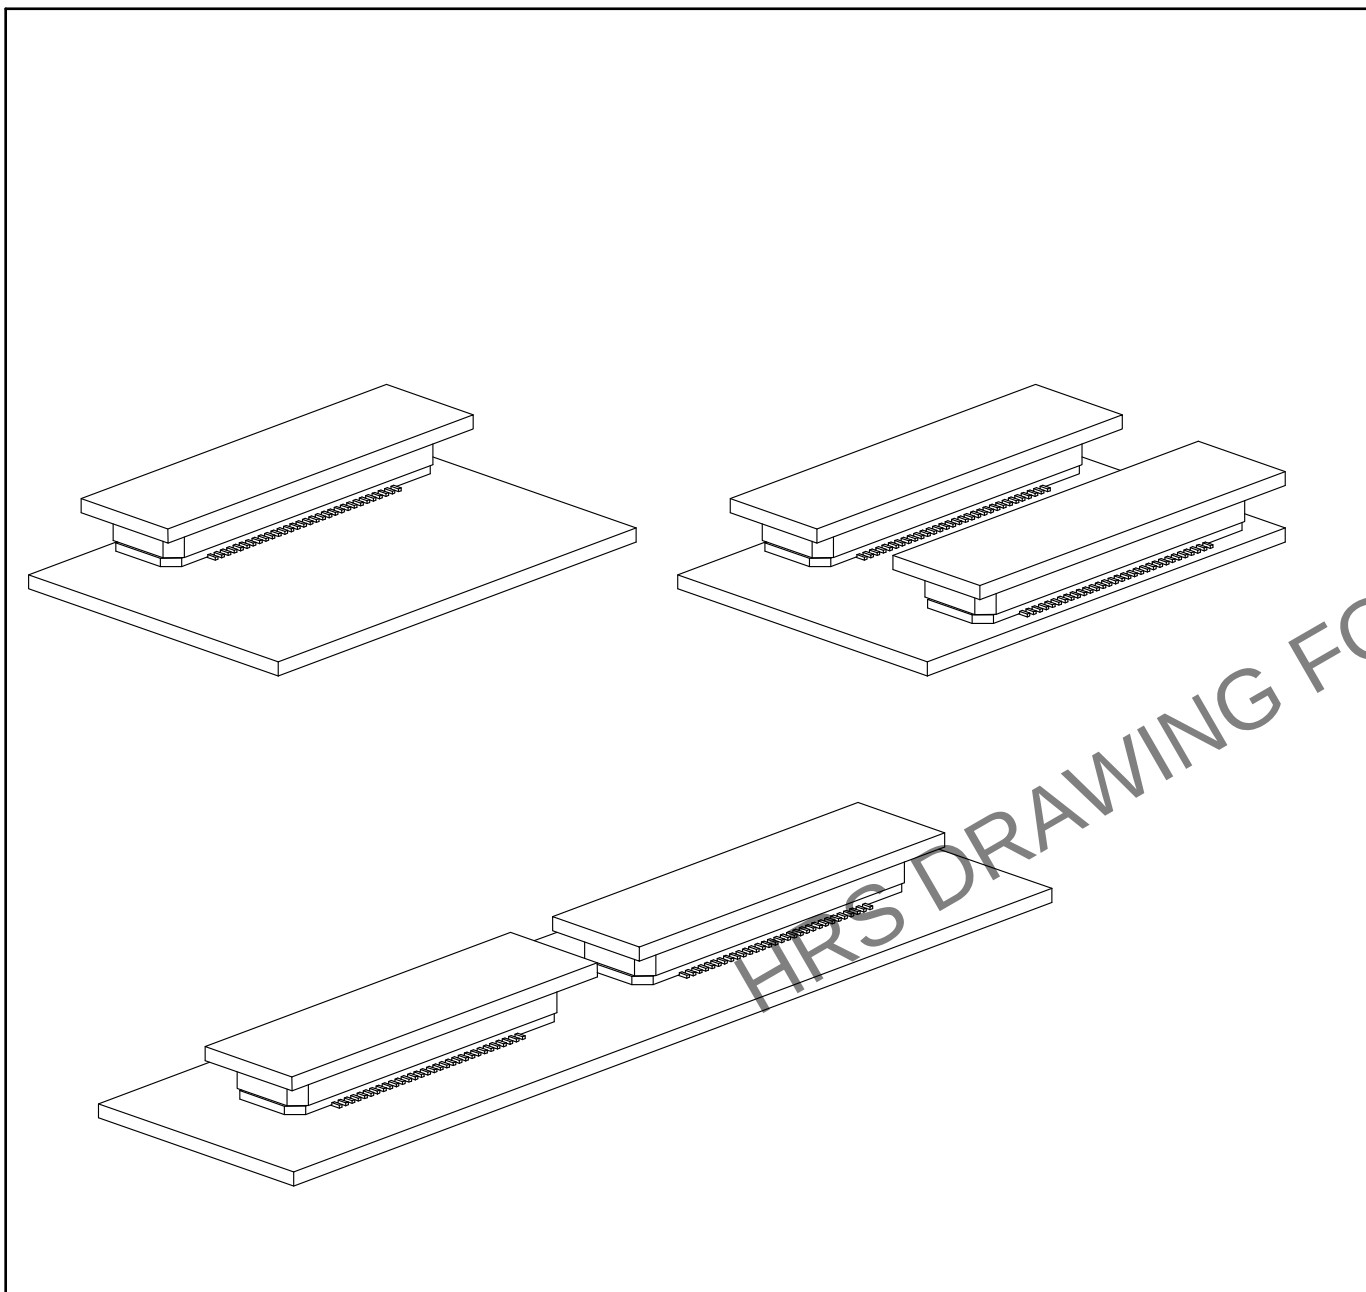

DRAWING NO.	EDC-150831-91-21
PART NO.	FX8C-60P-SV1(91)
CODE NO.	CL578-0521-6-91