

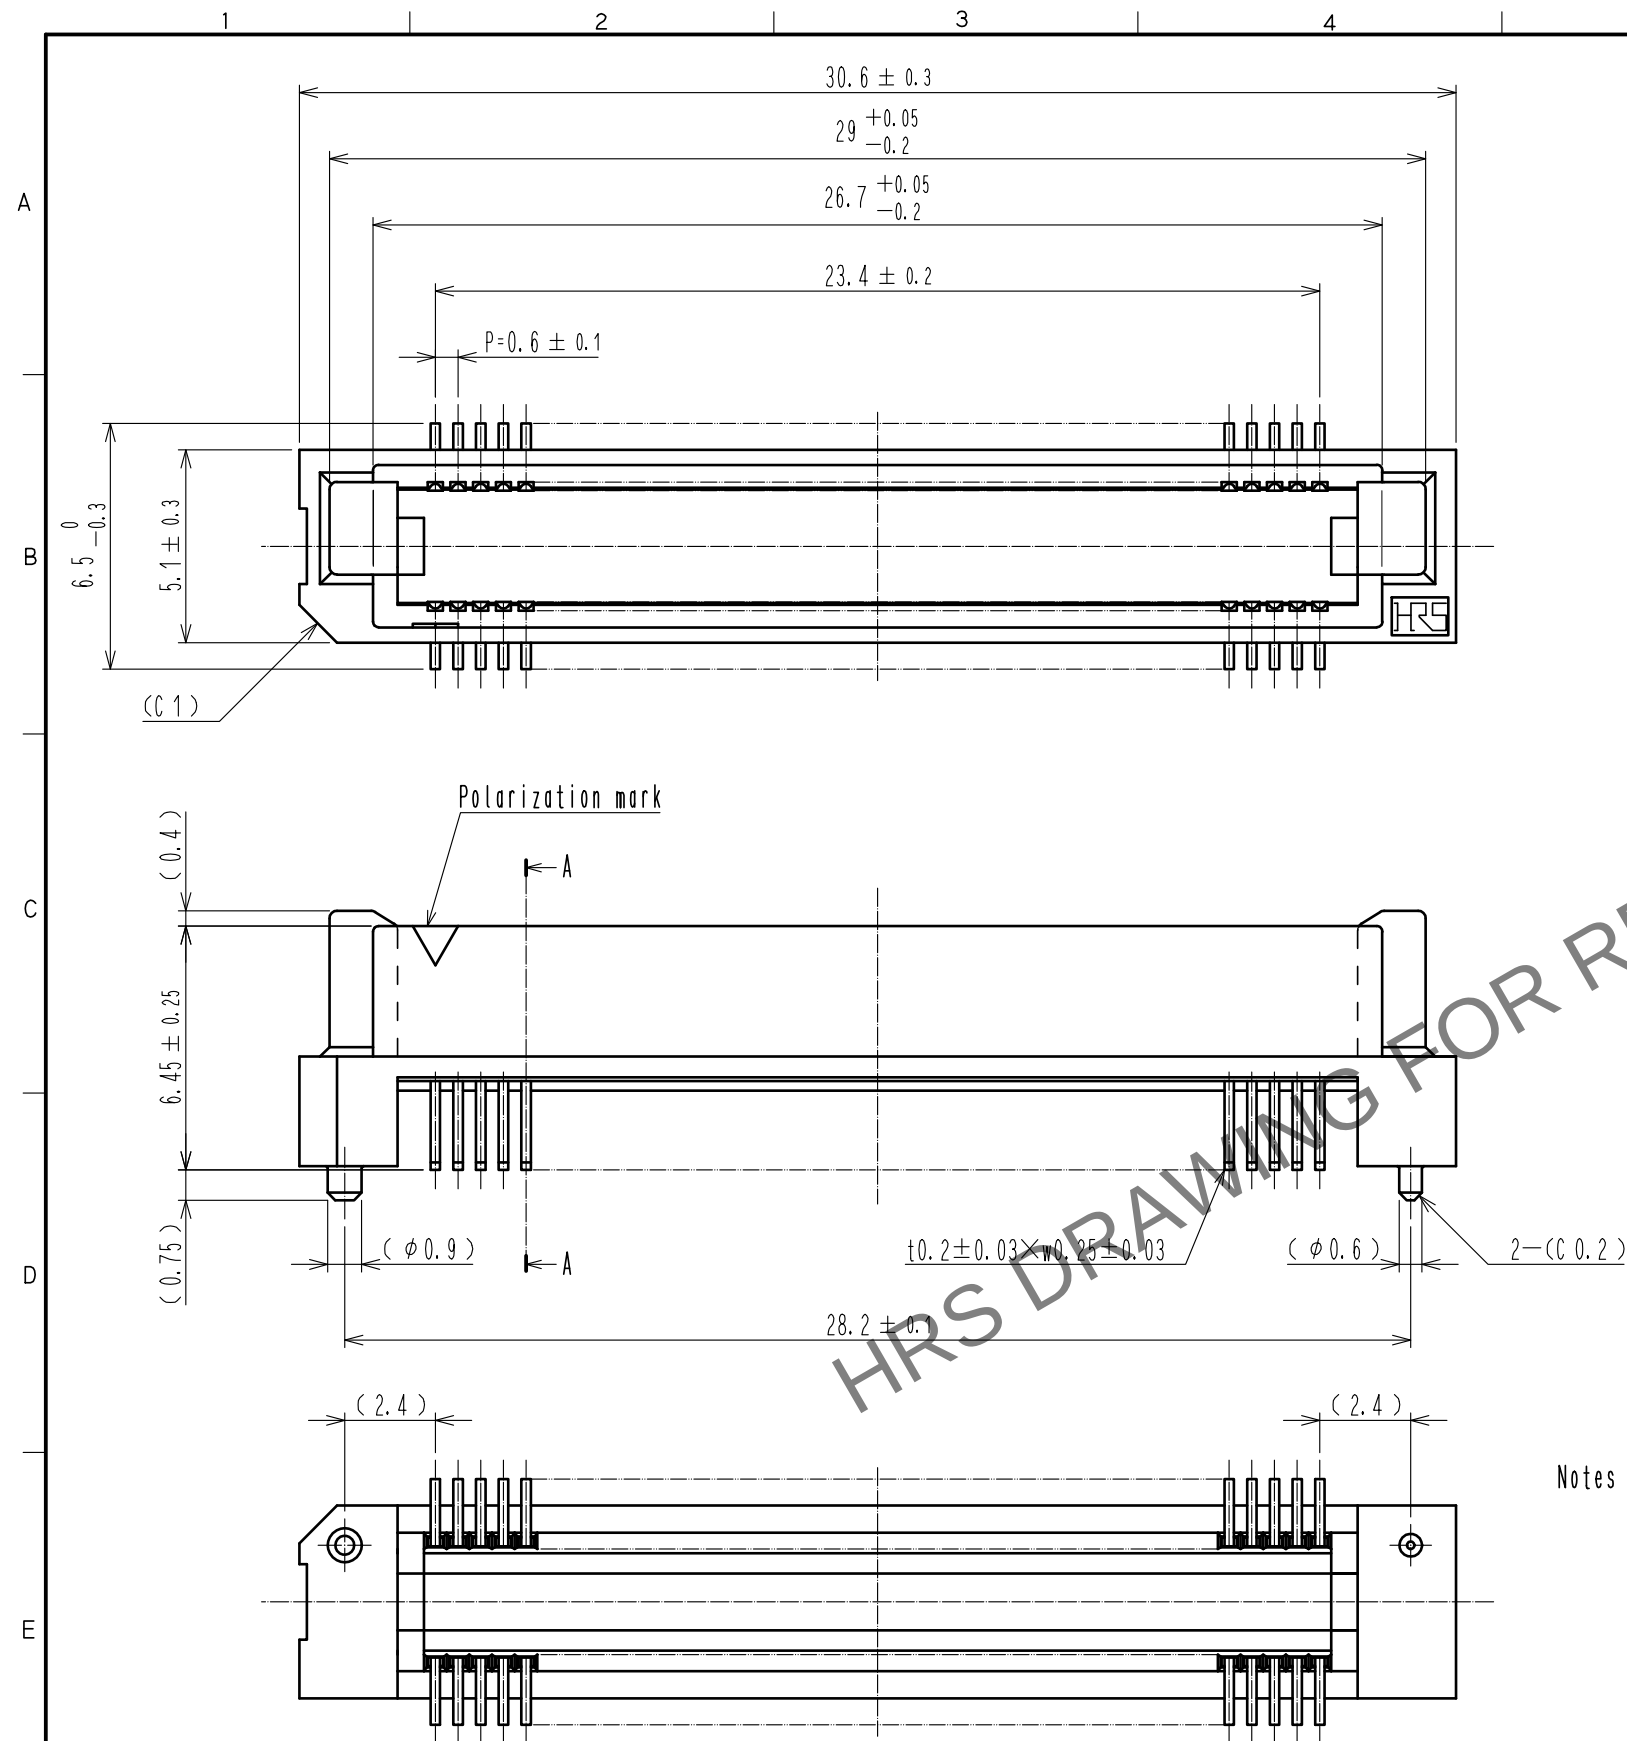
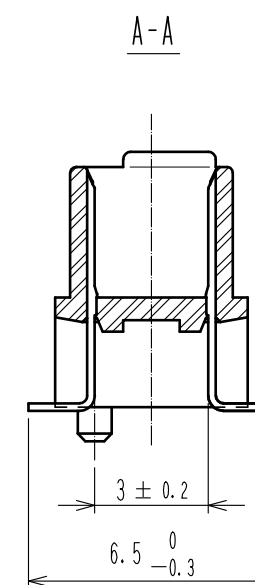



Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

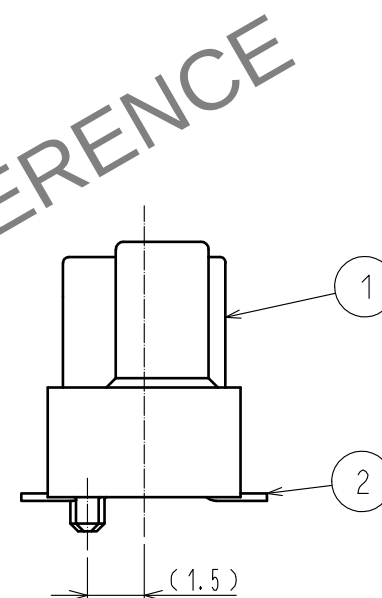

Recommended land pattern dimension of PCB (mounting side) (2:1)

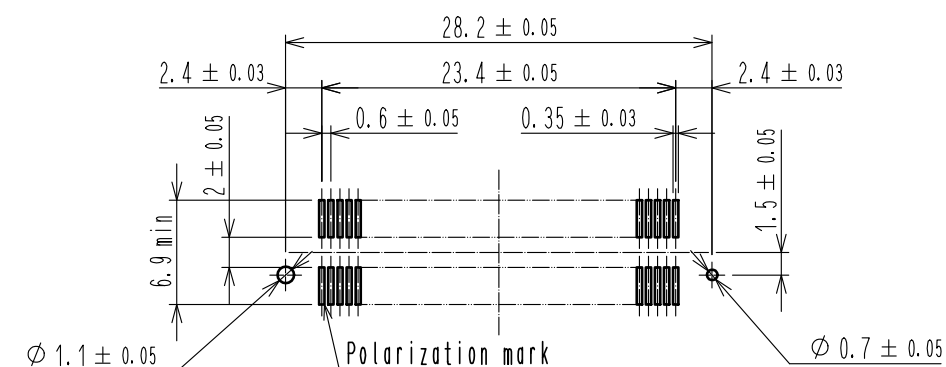


- Notes
- 1 Lead CO-PLANARITY shall be 0.1mm max.
 - 2 Tube packaging shall be applied for this product.
See next page for details.
 - 3 For modification, etc., preventive hole for sink mark may be added according to circumstances.
 - 4 The dimensions in parentheses are for reference.

2	PHOSPHOR BRONZE	Contact area : Gold 0.1μm min.								
		Lead area : Tin-plating 1μm min.								
		Under plating : Nickel 1μm min.								
1	PPS	Light brown (UL94V-0)		4	POLYVINYL CHLORIDE	(Stopper)				
				3	POLYVINYL CHLORIDE	(Tube)				
NO.	MATERIAL	FINISH . REMARKS			NO.	MATERIAL	FINISH . REMARKS			
UNITS mm				SCALE 5 : 1		COUNT 1	DESCRIPTION OF REVISIONS DIS-F-00006415	DESIGNED KS. NAKAJIMA	CHECKED HT. YAMAGUCHI	DATE 20200803
 HIROSE ELECTRIC CO., LTD.		APPROVED : HS. OKAWA		20051212		DRAWING NO. EDC-150842-91-21				
		CHECKED : HS. OZAWA		20051212		PART NO. FX8C-80P-SV2(C91)				
		DESIGNED : KY. NAKAMURA		20051212		CODE NO. CL578-0543-9-91				
		DRAWN : KY. NAKAMURA		20051212		 				

1 Added precaution

Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

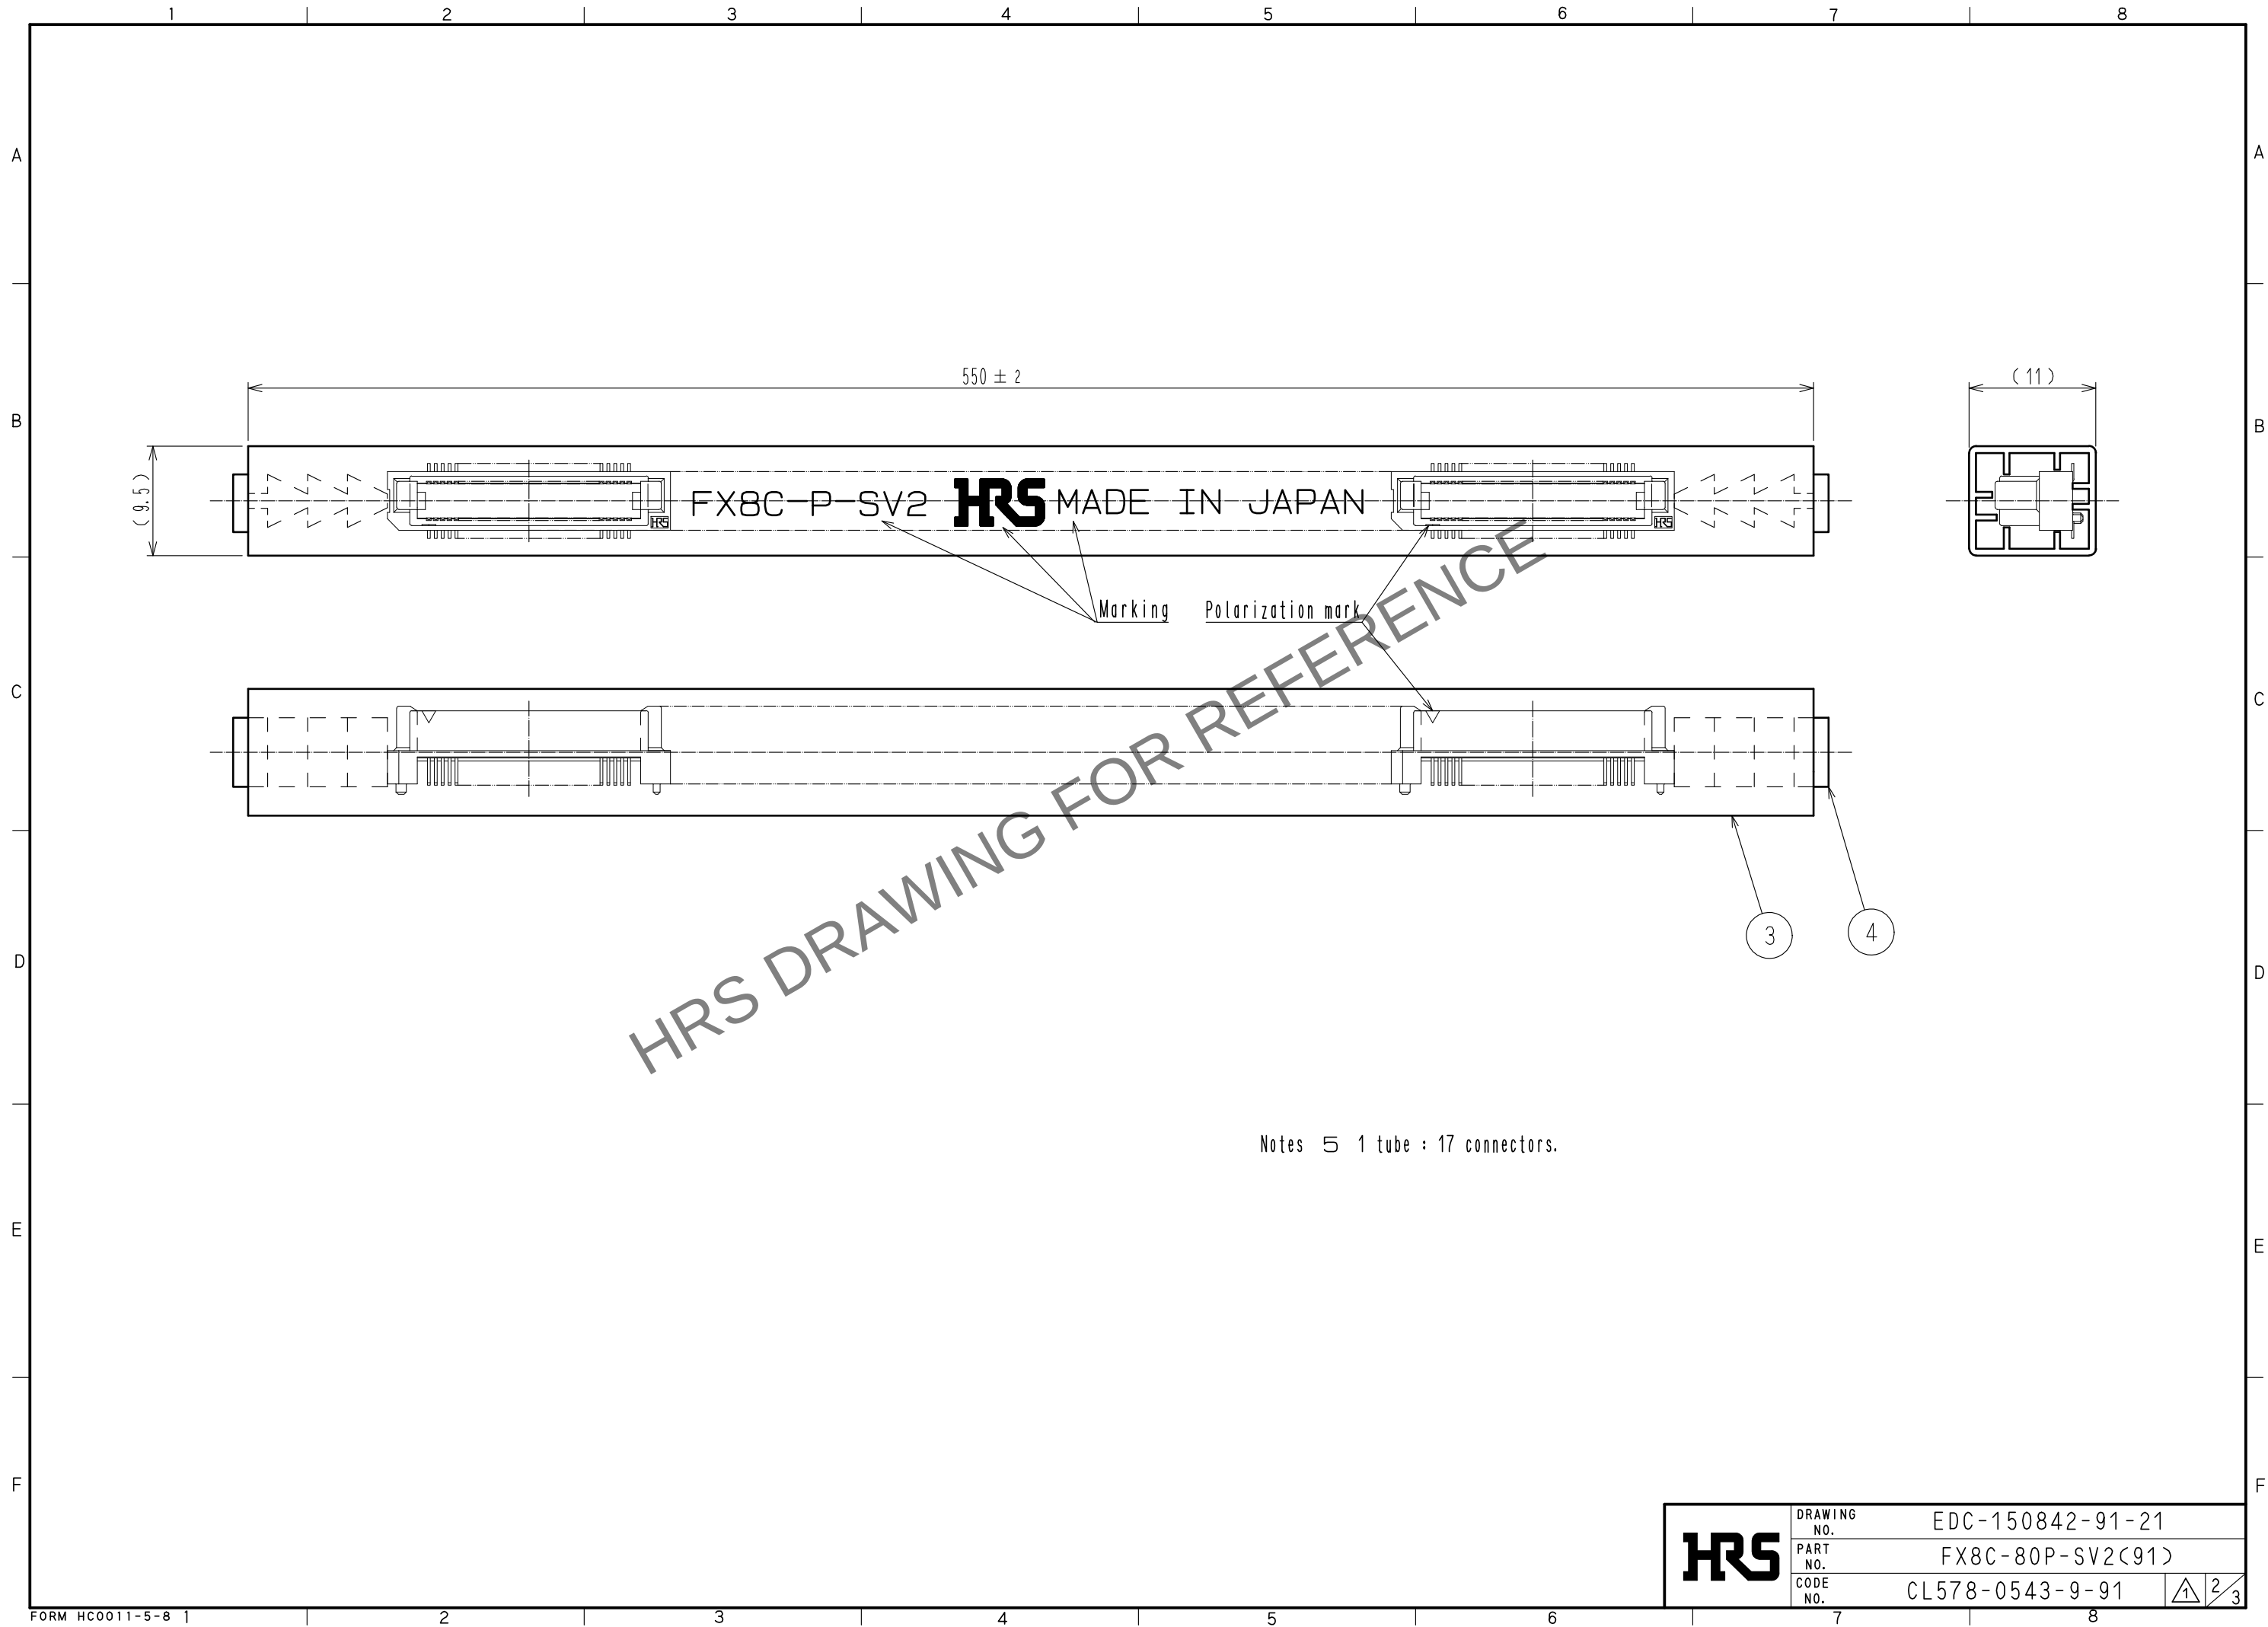

HRS

DRAWING NO.	EDC-150842-91-21
PART NO.	FX8C-80P-SV2(91)
CODE NO.	CL578-0543-9-91



Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

【Precaution】

When a board with multiple connectors mounted is mated, the connector may be damaged or deformed.
Please divide one side of the board so only one connector is mated per board.

OK

NG

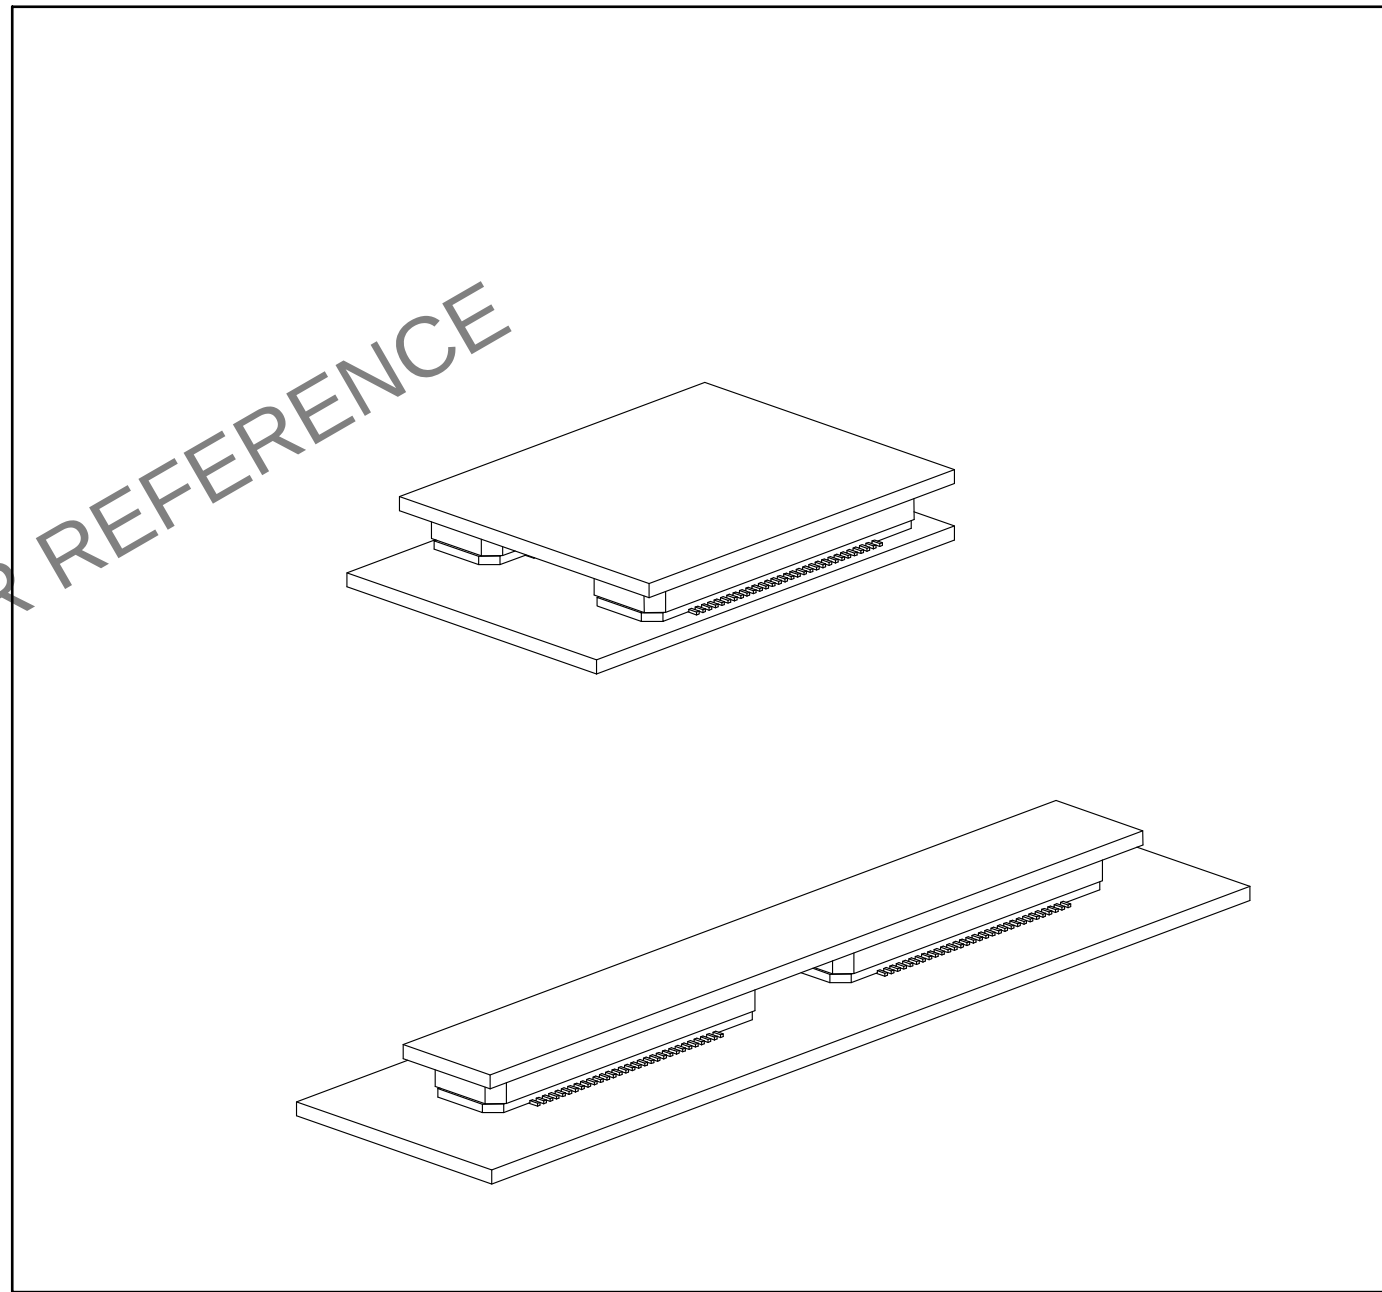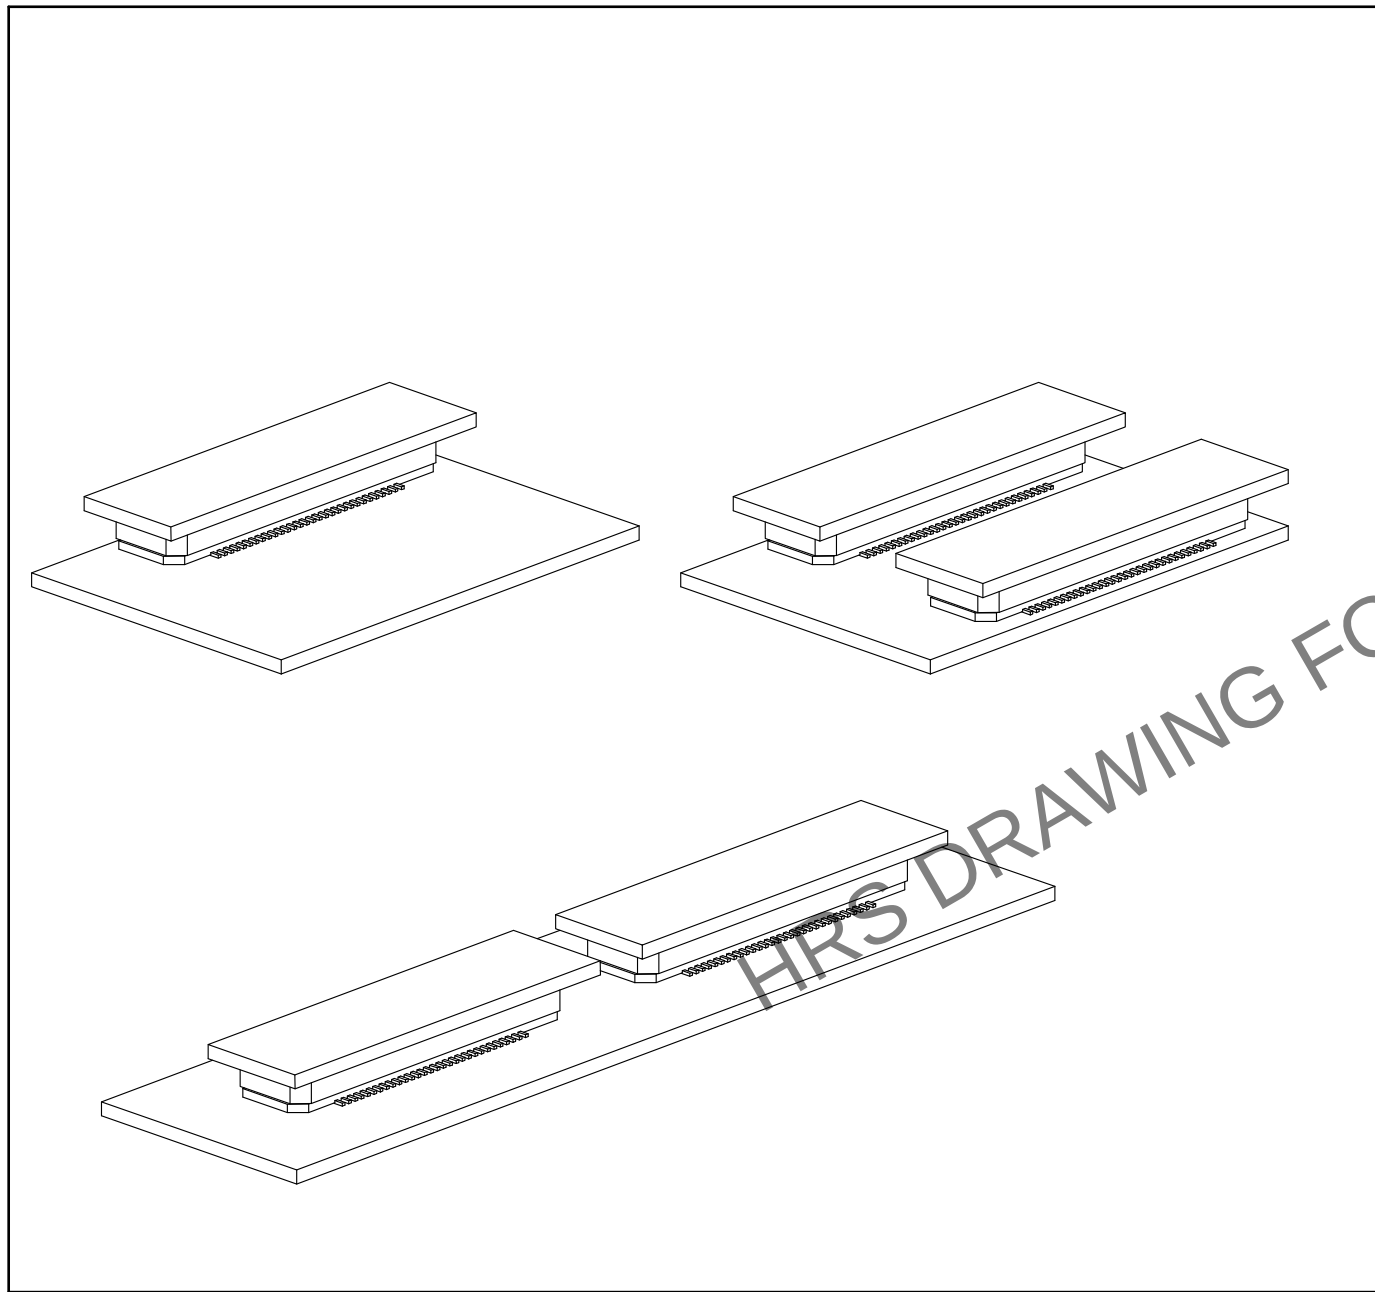

HRS

DRAWING NO.	EDC-150842-91-21
PART NO.	FX8C-80P-SV2(91)
CODE NO.	CL578-0543-9-91