
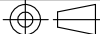


3	TITANIUM COPPER	GOLD PLATING					
1	COPPER	GOLD PLATING	2	LCP	(COLOR : BLACK)		
NO.	MATERIAL	FINISH . REMARKS	NO.	MATERIAL	FINISH . REMARKS		
CODE NO. (OLD)			DRAWN	DESIGNED	CHECKED	APPROVED	RELEASED
			D.G KIM 19.06.19	D.G KIM 19.06.19	H.S KIM 19.06.19	H.S KIM 19.06.19	<div>ENG 19.06.19 DEPT</div>
		DRAWING NO.		PART NO.			
SCALE 10:1		EDC3-632852		POK15-R-SMT(895)			
UNITS mm		HRS HIROSE KOREA CO.,LTD.		CODE NO.			
				CL 6341-0009-5-895			
				<div>1 / 2</div>			

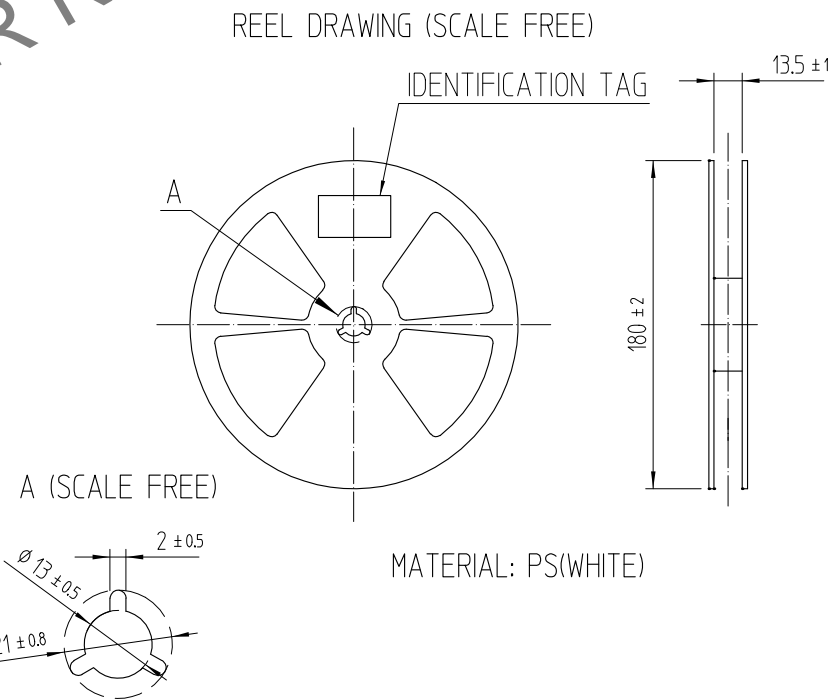

TEMPERATURE : -10°C TO +50°C
HUMIDITY : 15 TO 85% RH.

RECOMMENDED METAL MASK
DRAWING(5:1)

5.1 ± 0.03
2.5 ± 0.03
4.66 ± 0.03
Ø 0.9 ± 0.03
3.9


(RECOMMENDED METAL MASK
THICKNESS $t = 0.12\text{mm}$)

REEL DRAWING (SCALE)

IDENTIF
A


May.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

[Caution]

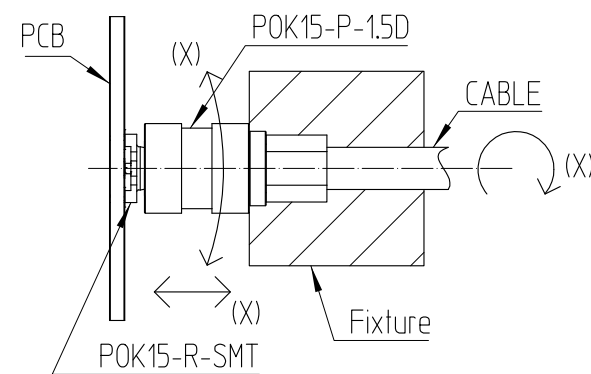


- * This product should be fixed with fixture so that it does not rotate vertically and horizontally when it is combined with mating material.
- The product must be assembled with counterpart and fixed by it's tool to prevent it from rotating (If it is not fixed by the tool, it might cause disfunction in usage)



[Example of incident (when there is no tool for fixation)]

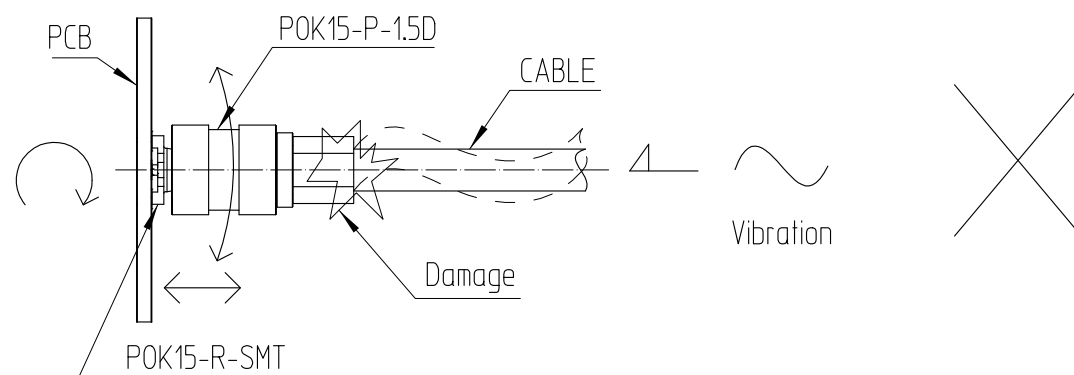

- * If you use this product without the fixing structure, it may cause loss of function of the product, disconnection of the connection part, peeling of the counterpart due to rotation of up and down and left and right.
- If the product is used without fixation, it might(rotation) cause disfunction, disconnection of wire, PCB peeling off.

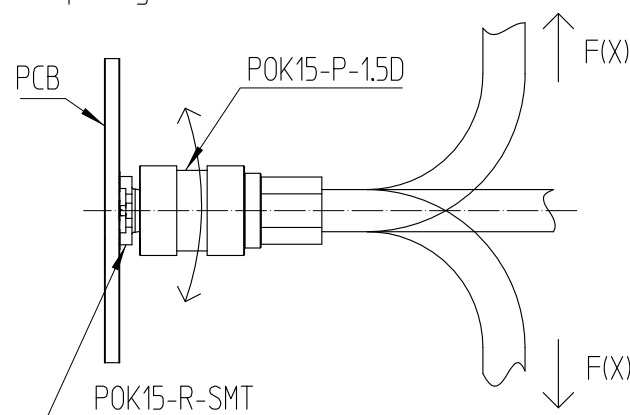

- * If you use this product without the fixing structure, If the force acts in the direction differently from the center of the product, it may cause the loss of function due to eccentricity of the product.
- If the product is used without fixation and force is applied in different direction from the center of the product, it may cause disfunction due to eccentricity of the product.

	DRAWING NO.	PART NO.	 HIROSE KOREA CO.,LTD.	CL 6341-0009-5-895
SCALE 10:1	EDC3-632852	POK15-R-SMT(895)		
UNITS mm		CODE NO.		