

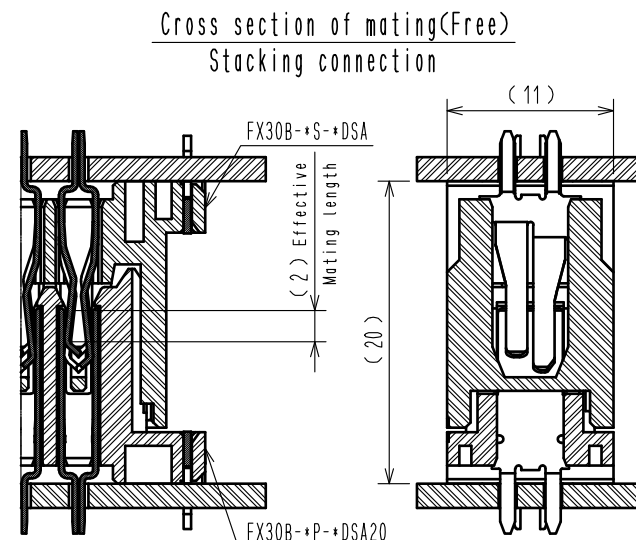
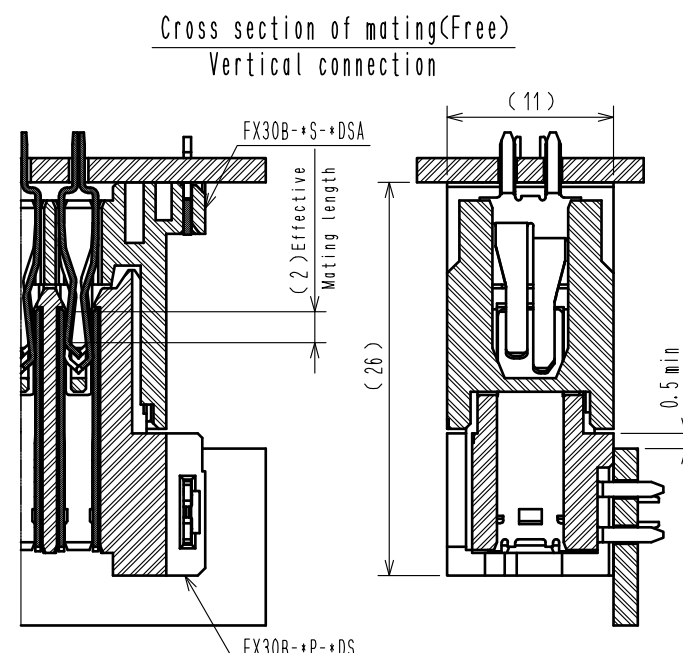
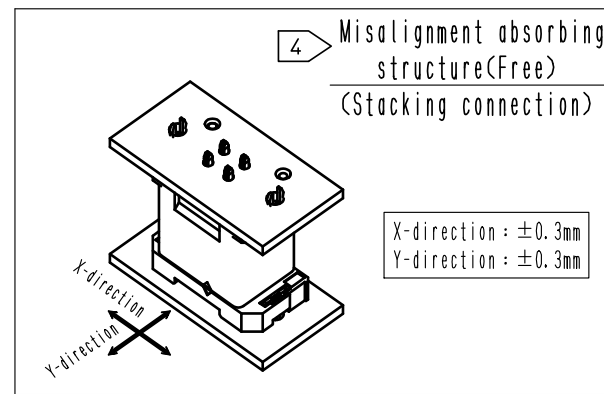
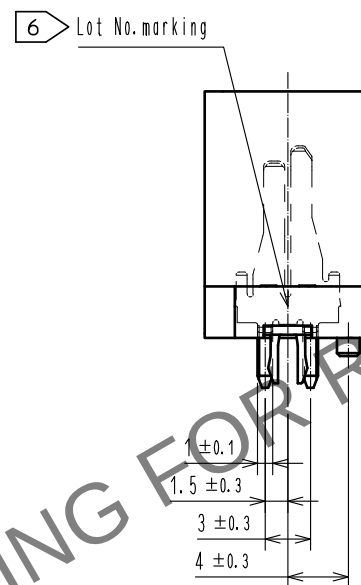
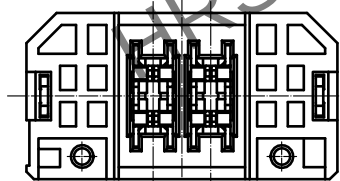


May.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

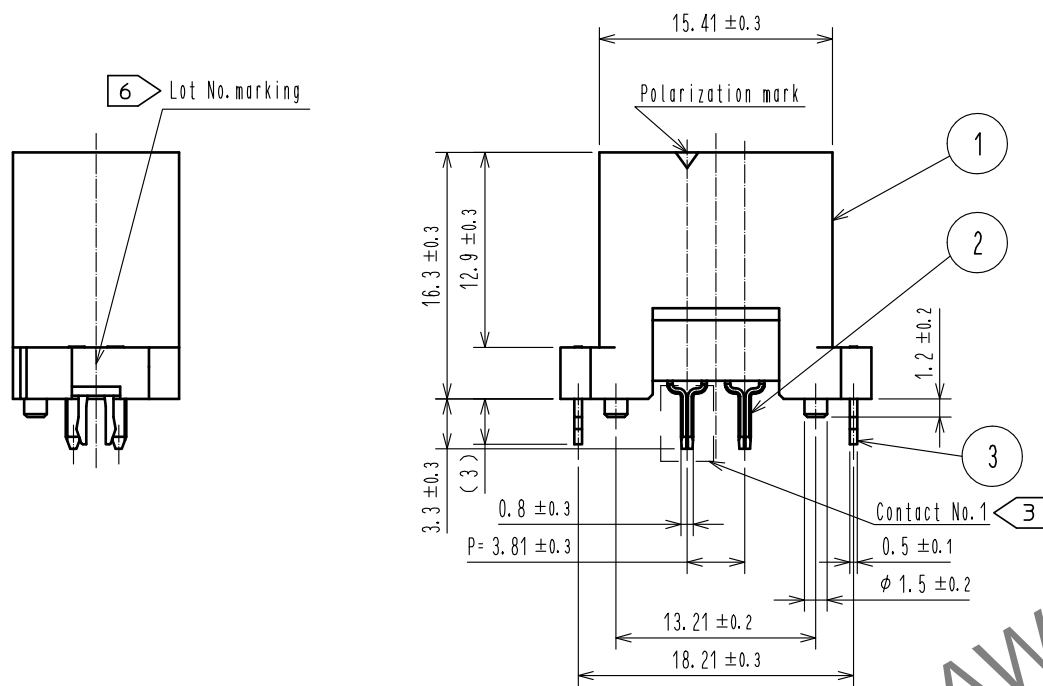

- Note
- 1 This product is packaged in tray. (49pcs/tray)
 - 2 Blemish and hit mark can be occurred through out the manufacturing process which doesn't affect quality level. Also, black spot could be observed on the surface of housing.
 - 3 For the contact No., adjacent two pairs of leads placed back-to-back (4 leads in total) compose one line.
 - 4 Misalignment absorbing range: $\pm 0.3\text{mm}$ max.
 - 5 The dimension in parentheses are for references.
 - 6 Lot No. is indicated at either one of the position as shown.
 - 7 UL (File No. E52653)
C-UL (File No. E52653)
TUV (Certificate No. R50275872) authorization article.

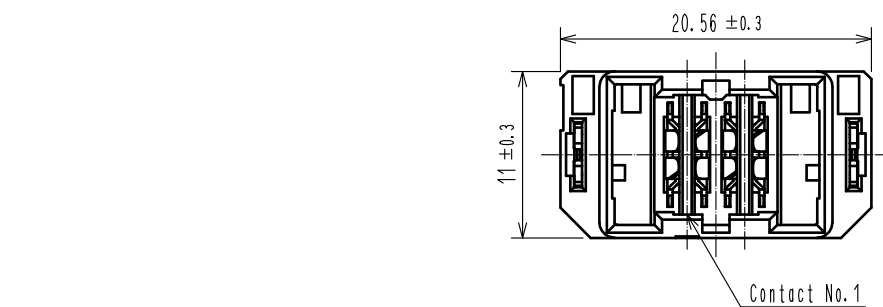

2	COPPER ALLOY	CONTACT AREA: GOLD-PLATING $0.1\mu\text{m}$	4	POLYSTYRENE	
		LEAD AREA: TIN-PLATING $1.0\mu\text{m}$			
		UNDER PLATING: NICKEL $1.0\mu\text{m}$			
1	POLYAMIDE	BLACK UL94V-0	3	PHOSPHOR BRONZE	TIN-PLATING $3.0\mu\text{m}$
NO.		FINISH . REMARKS	NO.		FINISH . REMARKS
UNITS mm		SCALE 2 : 1	COUNT 1		DESCRIPTION OF REVISIONS DIS-F-00006019
APPROVED : HS. OKAWA		20130307	DESIGNED AK. IWAHORI		20200406
CHECKED : KI. HIROKAWA		20130307	DRAWING NO. EDC3-347272-00		
DESIGNED : DK. AIMOTO		20130307	PART NO. FX30B-2S-3.81DSA		
DRAWN : DK. AIMOTO		20130307	CODE NO. CL570-3500-1-00		

