


Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.



NOTE 1 This product is packaged in tray.(30pcs/tray)
2 Blemish and hit mark can be occurred through out the manufacturing process
whitch dosen' t affect quality level.
Also, black spot could be observed on the surface of housing.
3 For the contact NO., adjacent two pairs of leads placed back-to-back (4 leads in total)
Compose one line.
4 Misalignment absorbing range:±0.3mm max.
5 The dimension in parentheses are for references.
6 Lot NO. is indicated at either one of the position as shown.
7 Possible short shot and/or burr at the indicated area does not affect the product quality.
8 UL(File No.E52653)
C-UL(File No.E52653)
TUV(Certificate No.R50275872) authorization article.

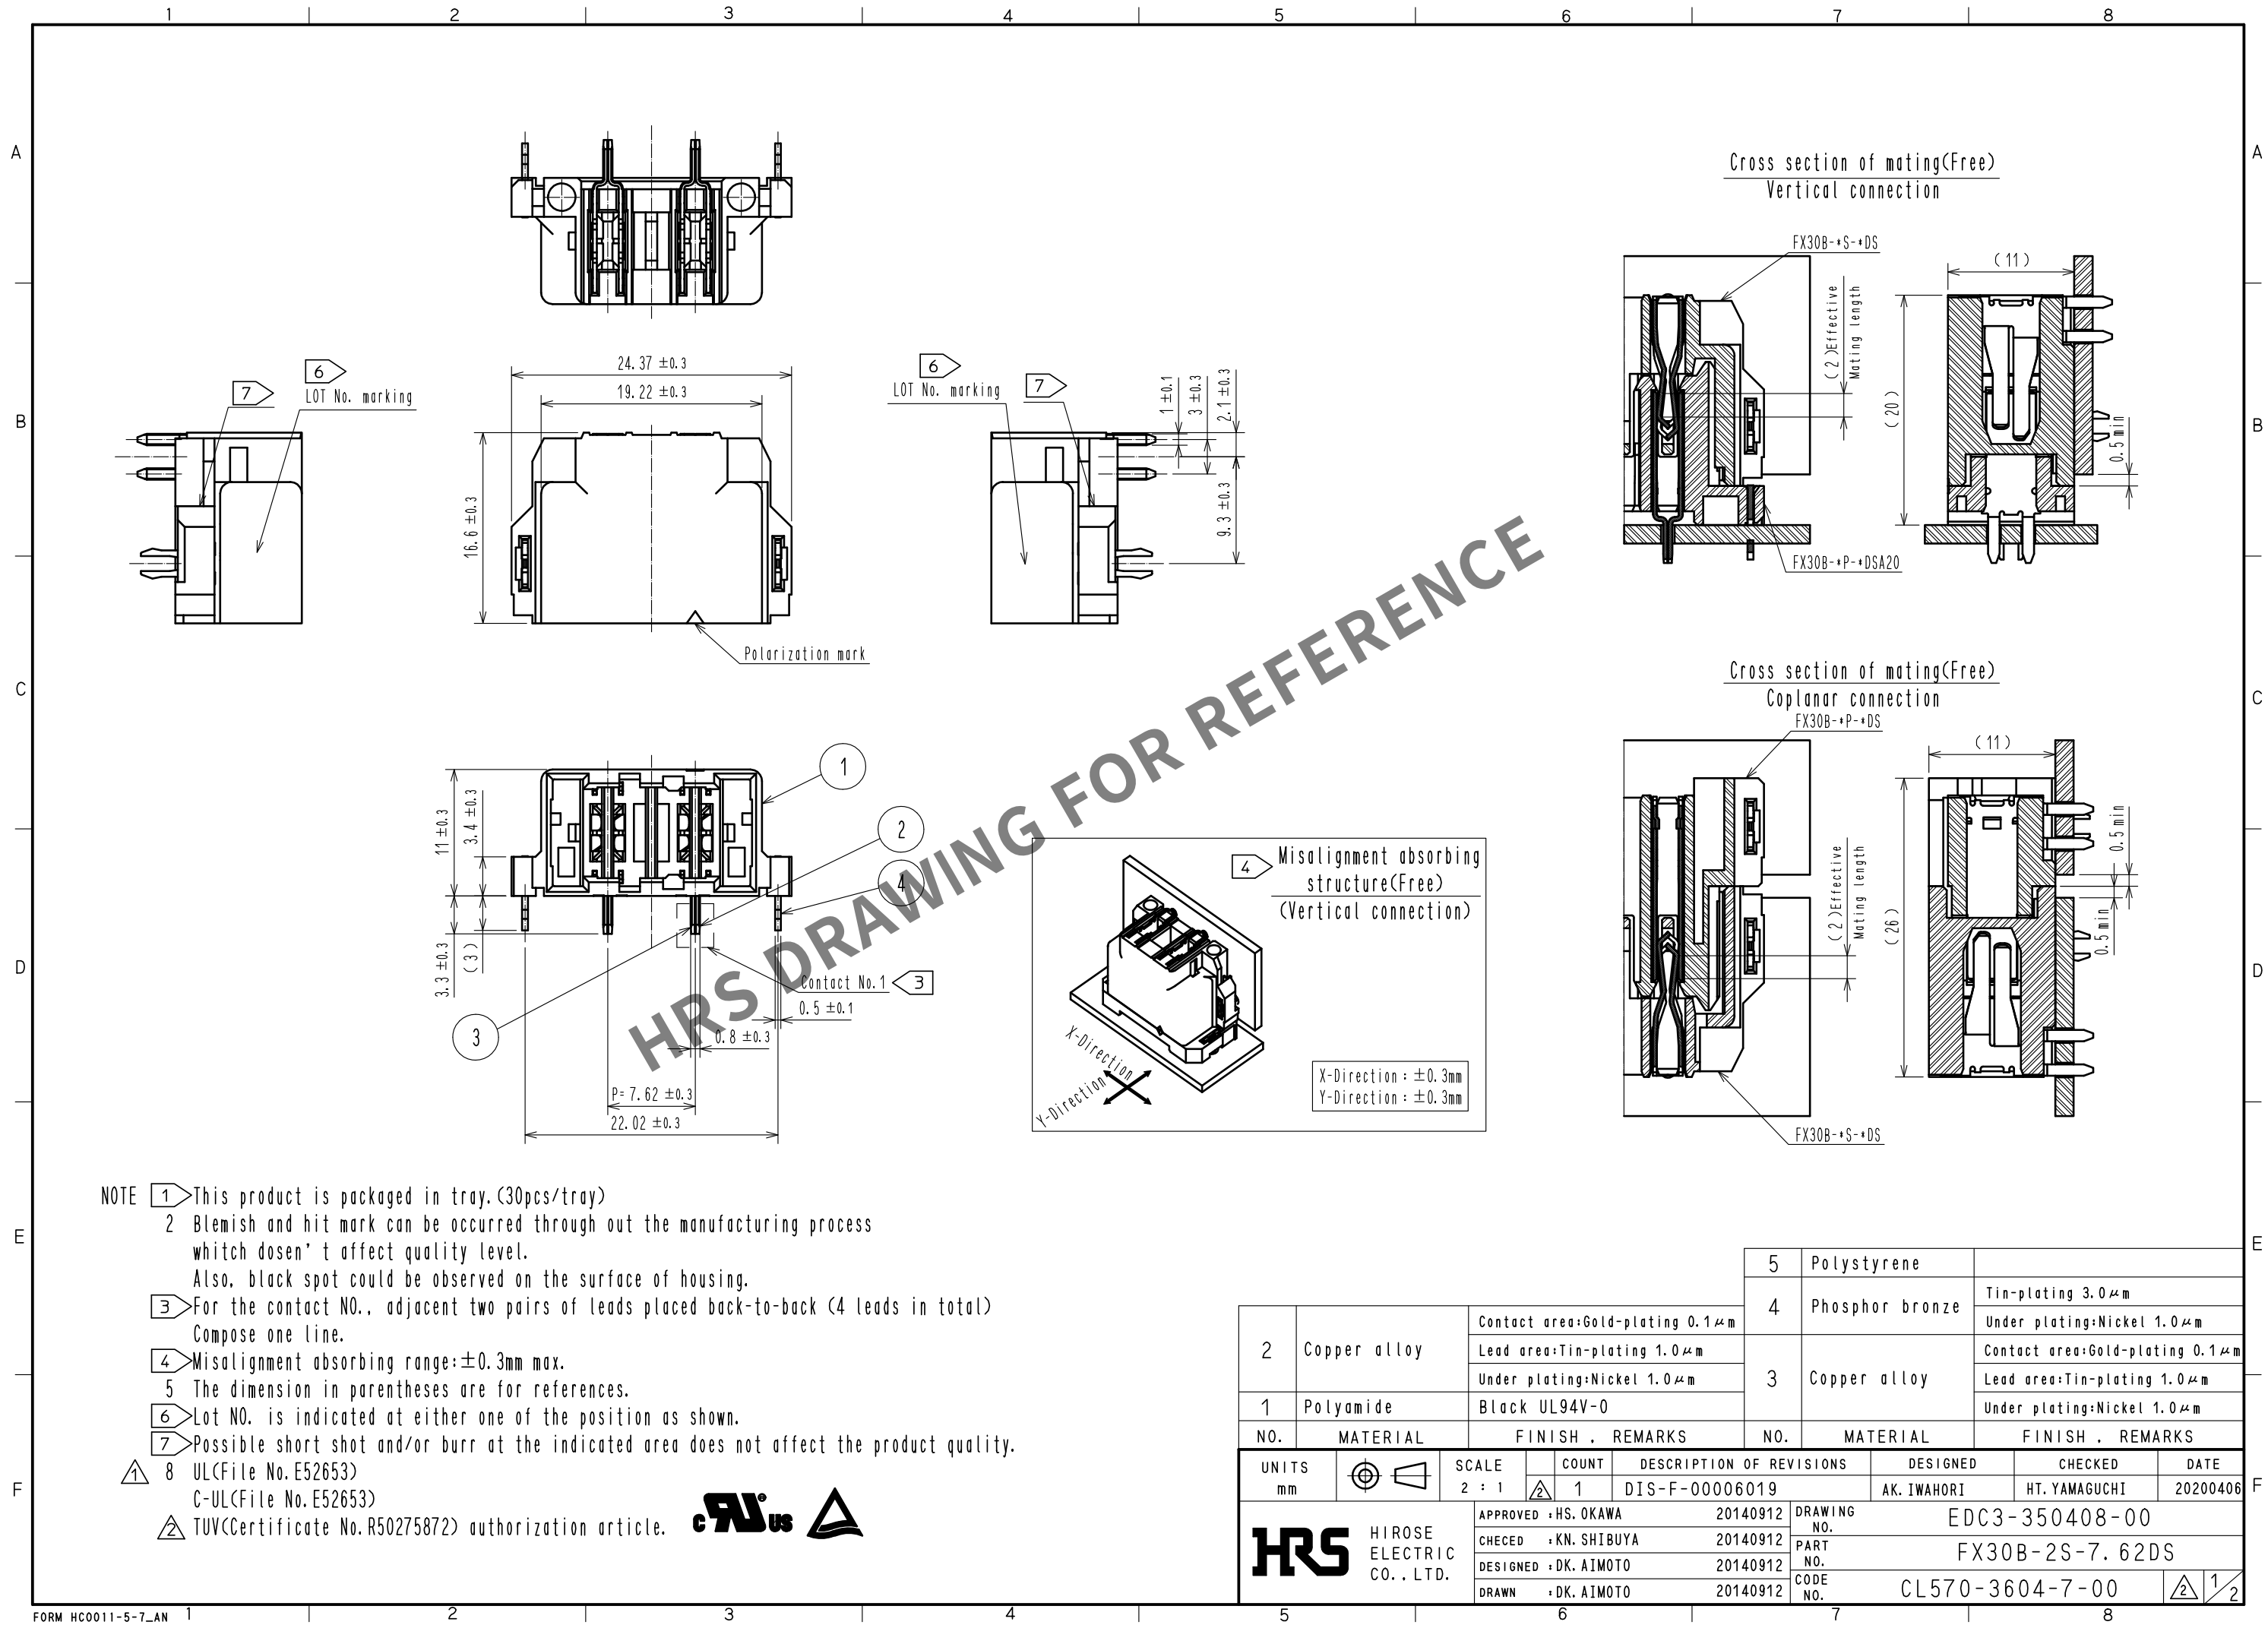

			5	Polystyrene	
2	Copper alloy	Contact area:Gold-plating 0.1μm	4	Phosphor bronze	Tin-plating 3.0μm
		Lead area:Tin-plating 1.0μm			Under plating:Nickel 1.0μm
		Under plating:Nickel 1.0μm	3	Copper alloy	Contact area:Gold-plating 0.1μm
1	Polyamide	Black UL94V-0			Lead area:Tin-plating 1.0μm
					Under plating:Nickel 1.0μm
NO.	MATERIAL	FINISH . REMARKS	NO.	MATERIAL	FINISH . REMARKS
UNITS mm			SCALE 2 : 1		
			COUNT 1		
			DESCRIPTION OF REVISIONS DIS-F-00006019		
			DESIGNED AK. IWAHORI		
			CHECKED HT. YAMAGUCHI		
			DATE 20200406		
HRS HIROSE ELECTRIC CO., LTD.			APPROVED : HS. OKAWA 20140912		
			CHECED : KN. SHIBUYA 20140912		
			DESIGNED : DK. AIMOTO 20140912		
			DRAWN : DK. AIMOTO 20140912		
			DRAWING NO. EDC3-350408-00		
			PART NO. FX30B-2S-7. 62DS		
			CODE NO. CL570-3604-7-00		
			1/2		

