



May.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

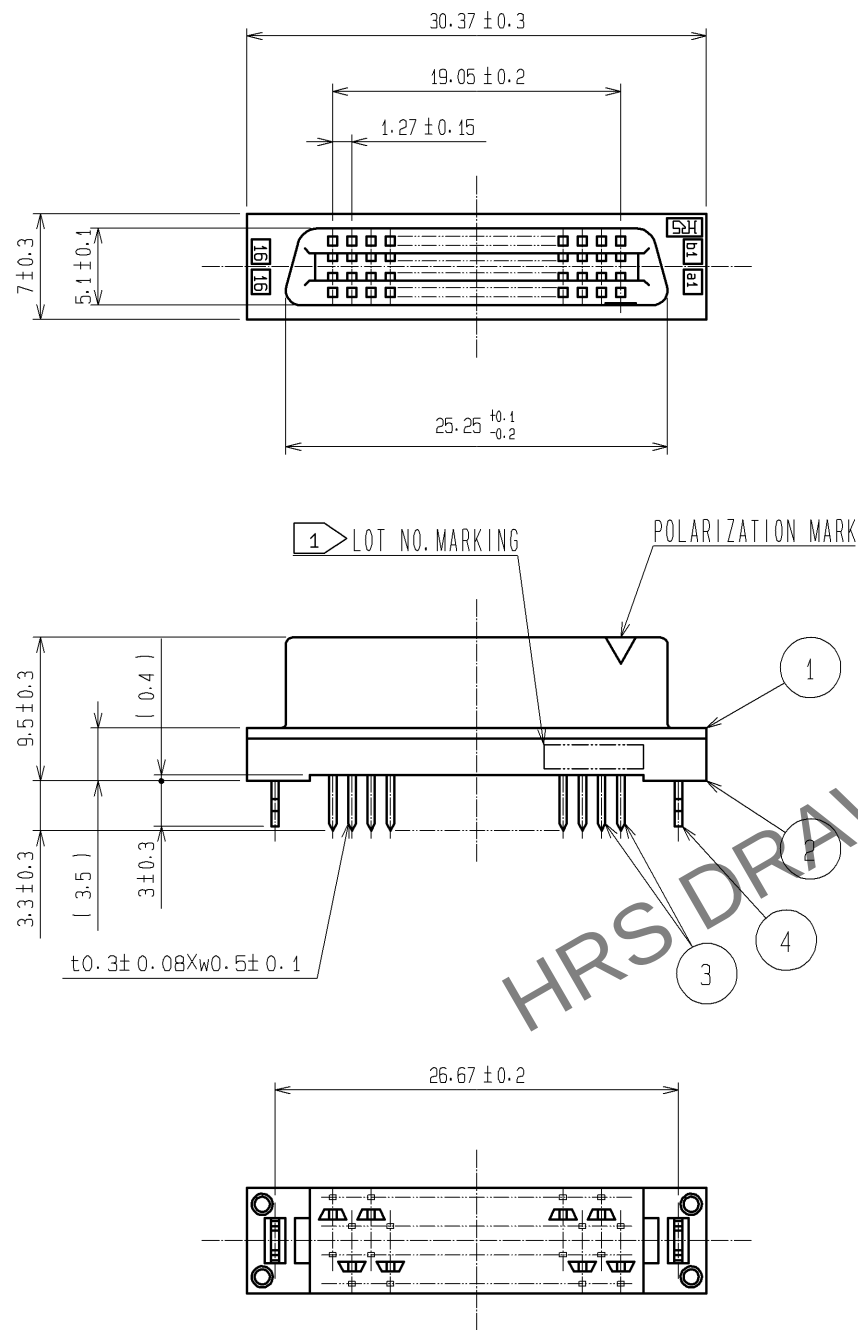

RECOMMENDED PC BOARD HOLE PATTERN (MOUNTING SIDE) $t=1.6$

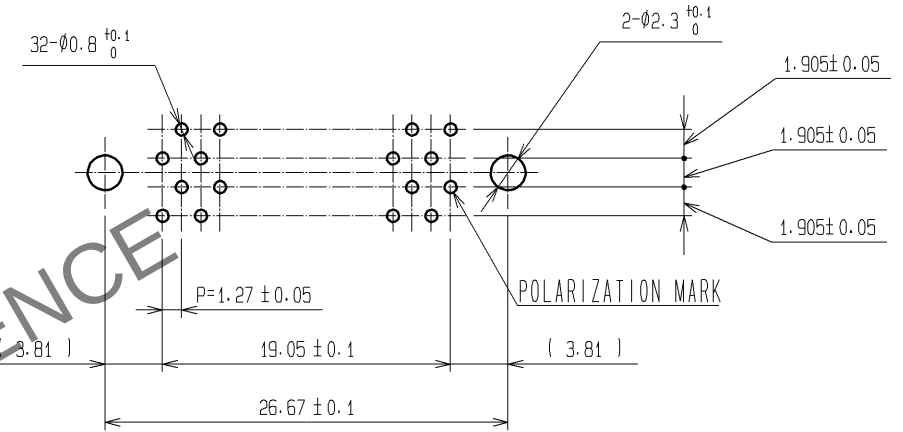

- NOTES
- LOT NO. MARKING SIDE SHALL BE OPTIONAL.
 - THE DIMENSIONS IN PARENTHESES ARE FOR REFERENCE.

4	PHOSPHOR BRONZE	TIN-PLATING	3	PHOSPHOR BRONZE	CONTACT AREA : GOLD $0.2 \mu\text{m}$ min.		
					DIP AREA : TIN-PLATING $2 \mu\text{m}$ min.		
					UNDER PLATING : NICKEL $2 \mu\text{m}$ min.		
NO.	MATERIAL	FINISH , REMARKS	NO.	MATERIAL	FINISH , REMARKS		
UNITS mm	SCALE 2 : 1		COUNT	DESCRIPTION OF REVISIONS		DESIGNED	CHECKED
HRS	APPROVED : HS. OKAWA		07.08.10	DRAWING NO.		EDC3-083188-21	
	CHECKED : HS. OZAWA		07.08.10	PART NO.		FX2C-32S-1.27DSAL (71)	
	DESIGNED : KY. NAKAMURA		07.08.10	CODE NO.		CL572-2452-8-71	
	DRAWN : TP. MATSUMOTO		07.08.09				