



L-L (Crimp-Contact cross-section image)
: where the jacket is removed.

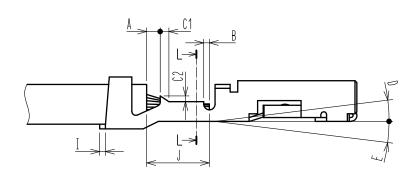



Check point		Measure (mm)	Remarks			
Cover location. A		0.2 to 1.1				
Location of tip of the core.	В	0.2 to 1.0				
Bell-mouth.	C 1	0.2 to 0.5				
	C2	0.1 to 0.3				
Bent-up.	D	З°МАХ				
Bent-down. E		З°МАХ				
Twist. F		± 3°MAX				
Rolling. G		±5°MAX				
Wide of Lance H		2.6 to 3.1				
cut-off tab. I		0.2MAX				
Strip length.		3.0 to 4.0	Strip length prior to crimping.			
Height of metal cut−out teeth. K		0.1MAX				

NOTE 1 To adjust applicator, please check the crimp condition (crimp height and configuration) by using cable.

COUNT	DESCRIPTION OF REVISIONS	DESIGNED		CHECKED			DATE			
\triangle										
TITLE HIROSE ELECTRIC CO. LT.										
				HIROSE ELECTRIC COLTD.						
DF5(A)-***\$C**(%%) Crimp Quality Standard			APPR	OVED	HS. OKAWA		18. 09. 10			
			CHEC	KED	SZ. ONO		18. 09. 10			
			CHAR	GED	TS. MIYAKI		18. 09. 10			
			WRIT	TEN	TS. MIYAKI		18. 09. 10			
TECHNICA	L SPECIFICATION		ETA	4 D - H O S	948-00	\triangle	1 1			