

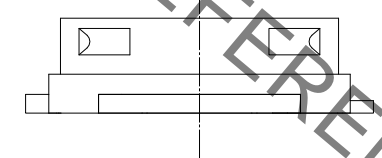
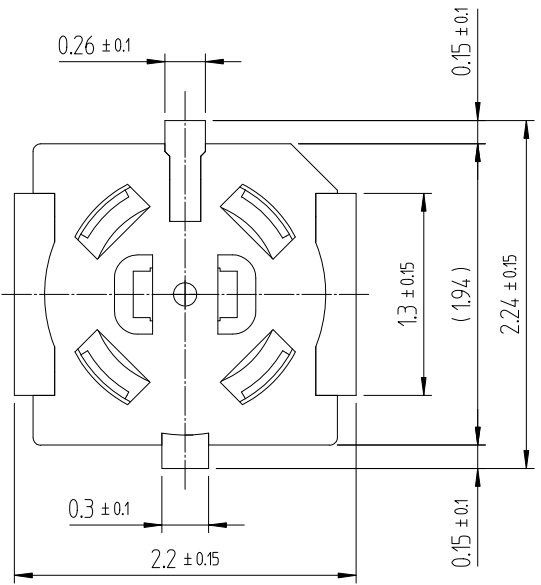
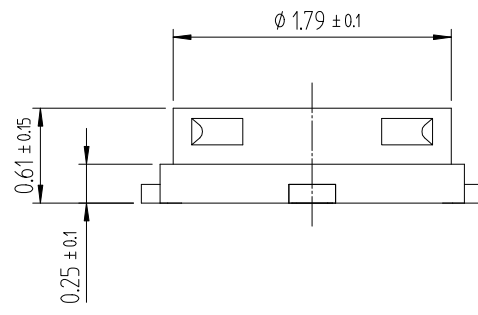


May.1.2022 Copyright 2022 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window

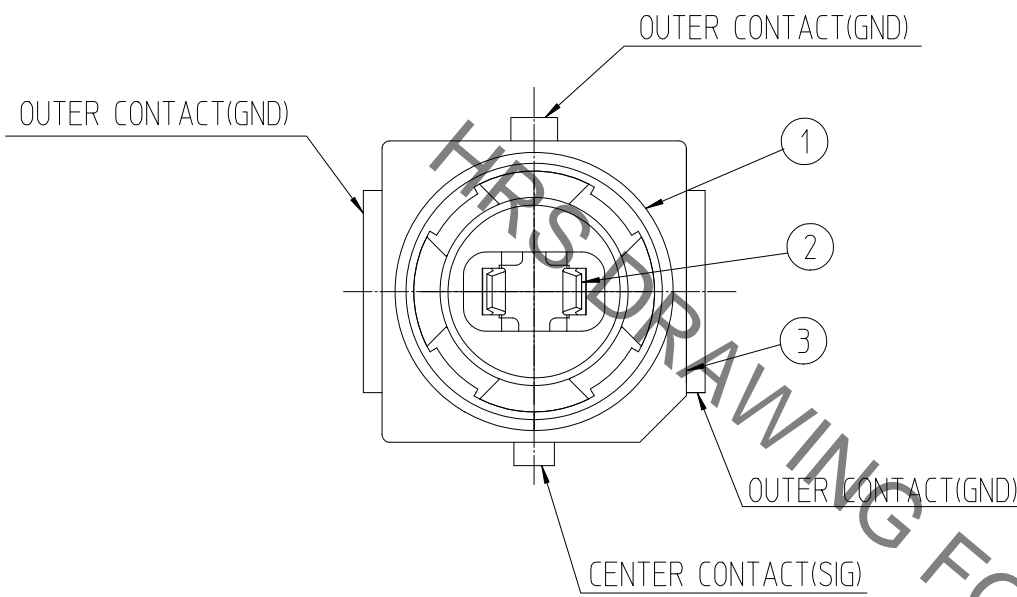


RECOMMENDED PCB/METAL MASK PATTERN DRAWING(5:1)

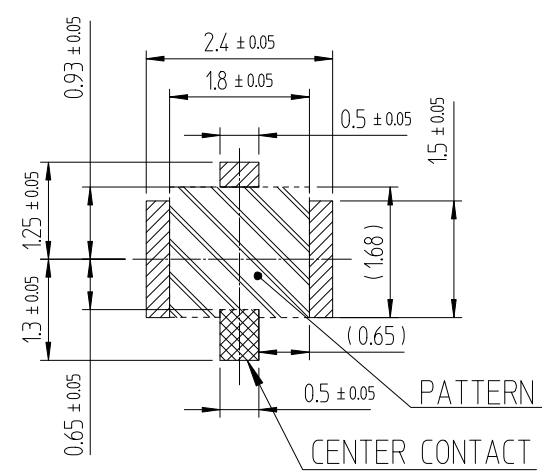


| △數 COUNT | 訂正事項 DESCRIPTION OF REVISIONS | 擔當 B | 檢圖 CHKD | 年月日 DATE | △數 COUNT | 訂正事項 DESCRIPTION OF REVISIONS | 擔當 B | 檢圖 CHKD | 年月日 DATE |
|-------------|----------------------------------|---------|------------|-------------|-------------|----------------------------------|---------|------------|-------------|
| △ | | | | .. | △ | | | | .. |
| △ | | | | .. | △ | | | | .. |
| △ | | | | .. | △ | | | | .. |


EMBOSSED TAPING DRAWING(4:1)
DIRECTION OF UNREELING

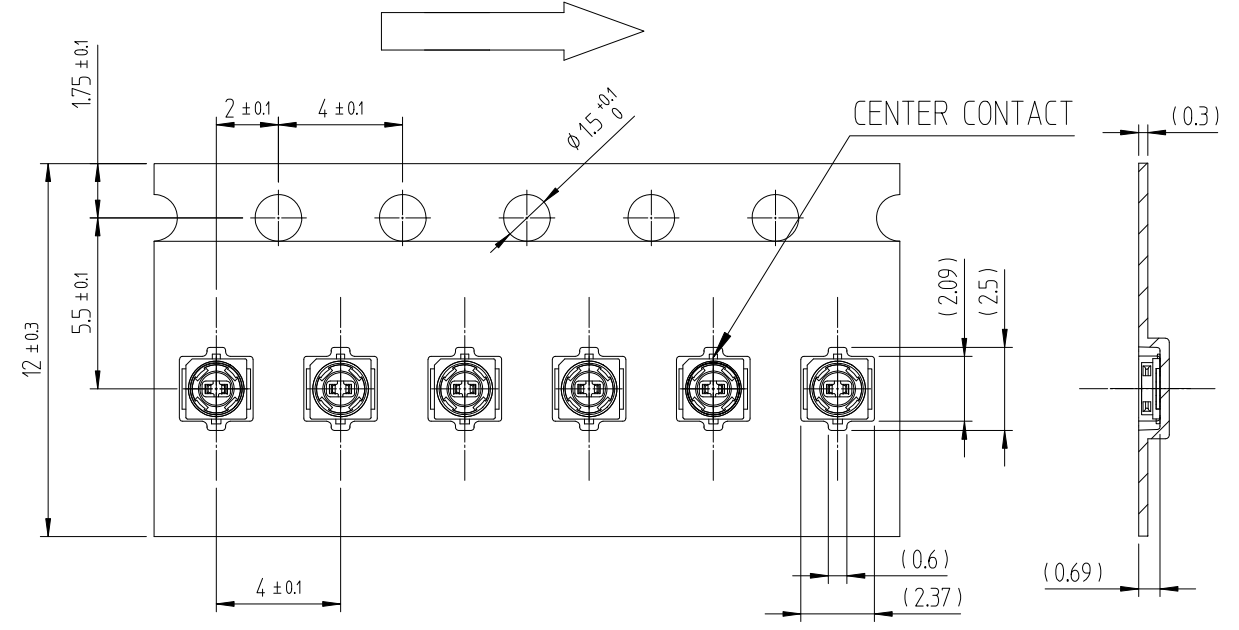


REEL DRAWING (SCALE FREE)

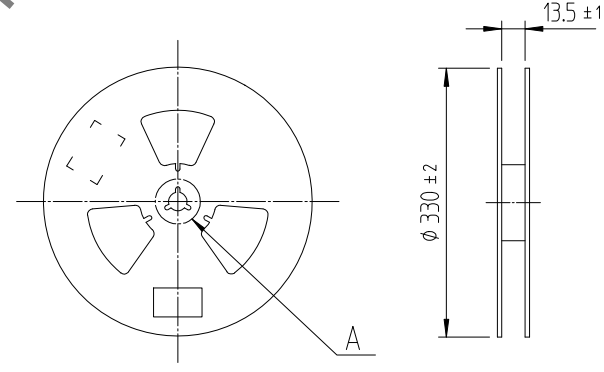

A(SCALE FREE)

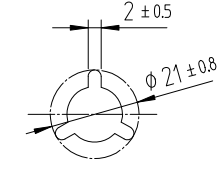

RECOMMENDED REFLOW TEMPERATURE PROFILE

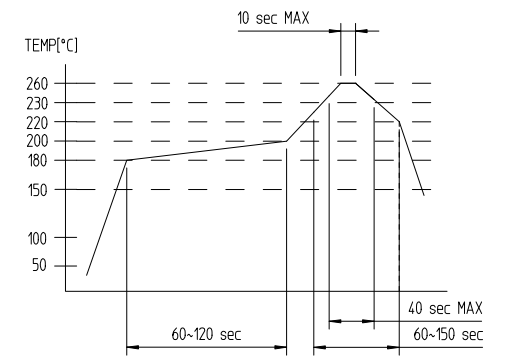

NOTE
MOUNTING TEMPERATURE PROFILE VARIES ACCORDING TO BOARD SIZE, SOLDER TYPE APPLIED AND SOLDER THICKNESS
- METAL MASK THICKNESS : 0.1mm

RoHS COMPLIANT, Halogen Free

NOTES :

- The quantity of K.FL2-PR-SMT09 is 10000 connectors per reel.
 - Lead co-planarity shall be 0.1max.
 - For the possibility of breakage or deformation do not mate this connector with partner, K.FL2-R-SMT-1 before mounting on pc board.
- 4 Please contact us in case you will make different settings from our recommendation.

| | | | | | | | | | | | | | |
|-------------------------------|--|-----------------|---|----------------------------------|--|---------------------|---|---------------------|--|---------------------|--|----------|--|
| 1 | | PHOSPHOR BRONZE | UNDER PLATING: NICKEL OVER PLATING: GOLD | 3 | | LCP | <BLACK>, UL94V-0 | | | | | | |
| 2 | | PHOSPHOR BRONZE | UNDER PLATING: NICKEL OVER PLATING: GOLD | 4 | | PHOSPHOR BRONZE | UNDER PLATING: NICKEL OVER PLATING: GOLD | | | | | | |
| CODE NO. (OLD) | | | | DRAWN | | DESIGNED | | CHECKED | | APPROVED | | RELEASED | |
| | | | | W.Y.AHN 19.01.25 | | W.Y.AHN 19.01.25 | | H.S.KIM 19.01.25 | | H.S.KIM 19.01.25 | | | |
| DRAWING NO. EDC3-632121-80 | | | | PART NO. K.FL2-PR-SMT09 (800) | | | | | | | | | |
| SCALE 20:1 | | | | CODE NO CL6345-0056-0-800 | | | | 1/2 | | | | | |
| UNITS mm | | | | HIROSE KOREA CO.,LTD. | | | | | | | | | |



□ MOUNTING PRECAUTIONS

a. FPC MOUNTING

FPC must have suitable stiffener to prevent peeling of the solder joints during mating/unmating.
We recommend the FPC to be supported with the reinforcement.

b. MULTI-CONNECTOR PLACEMENT

When mounting on a solid PCB on both sides do not place more than one connector on each side.
When mounting one side on a rigid PCB and other on the flexible printed circuit several connectors can be mounted on the rigid side. The FPC must have slats between each of the connectors to allow alignment with each corresponding connector.

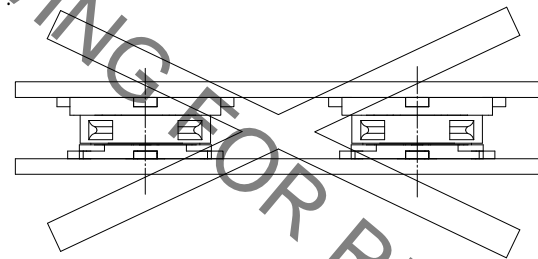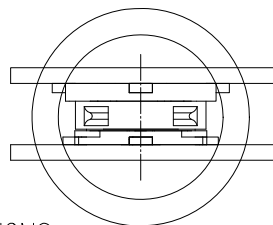


□ MATING PRECAUTIONS


Connectors must be mated by hand only. Application of excessive forces may damage the connectors.

● MATING PROCEDURES


1) Align mount plug (K.FL2-PR-SMT09) and receptacle (K.FL2-R-SMT-1) by slight touch as shown on fig. 1.

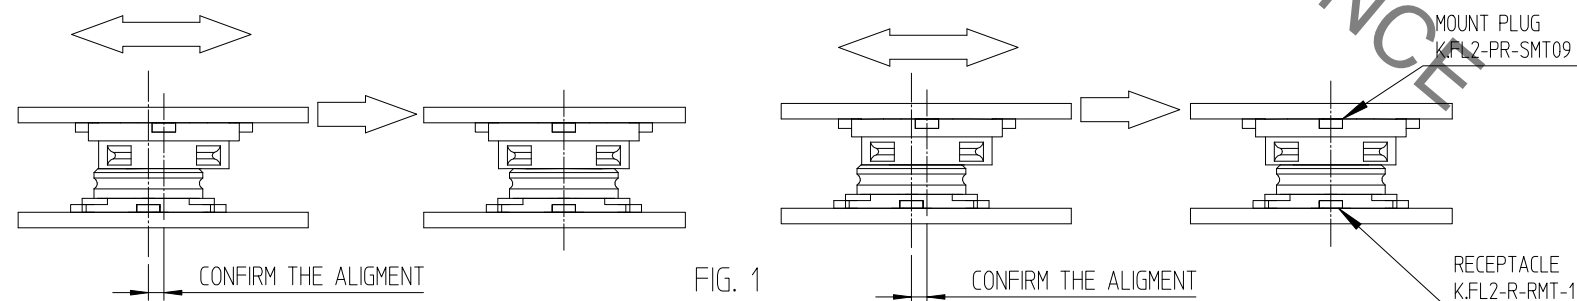


2) Confirm the alignment by applying slight even pressure to the mount plug (K.FL2-PR-SMT09) partially inserting it in the mount receptacle (K.FL2-R-SMT-1), as shown in fig. 2. The plug should not move sideways or be slanted.

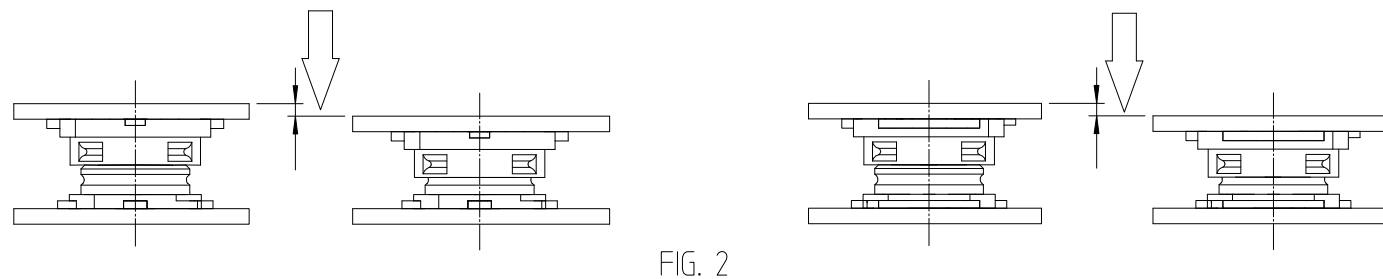

3) Push-down on the mount plug (K.FL2-PR-SMT09) until it is fully inserted, confirming it with a tactile 'CLICK'

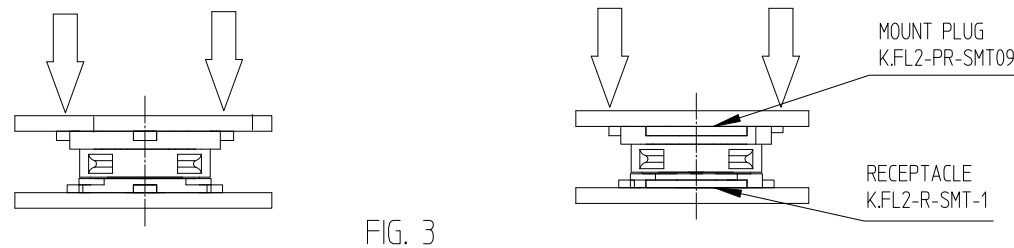


4) When mating was not possible. Please use it after confirming that a plug receptacle female contact by the transformation or the mold part does not have transformation before just using a plug receptacle.

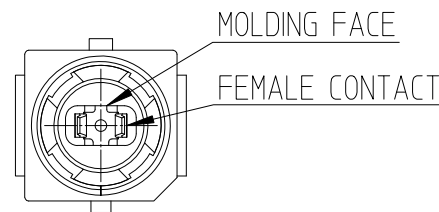


□ UNMATING PRECAUTIONS

Unmate by applying even vertical force to the mount plug (K.FL2-PR-SMT09) as shown on fig. 4.
Do not rock or lift by one side only. FPC must have suitable stiffener.

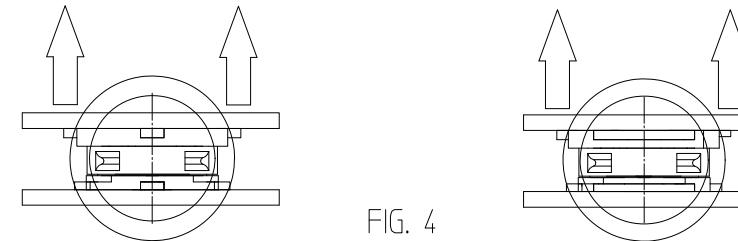

If encountering some resistance during the unmatting start lifting from side as shown on fig. 5.
Do not attempt unmatting by lifting it from any of the other side.

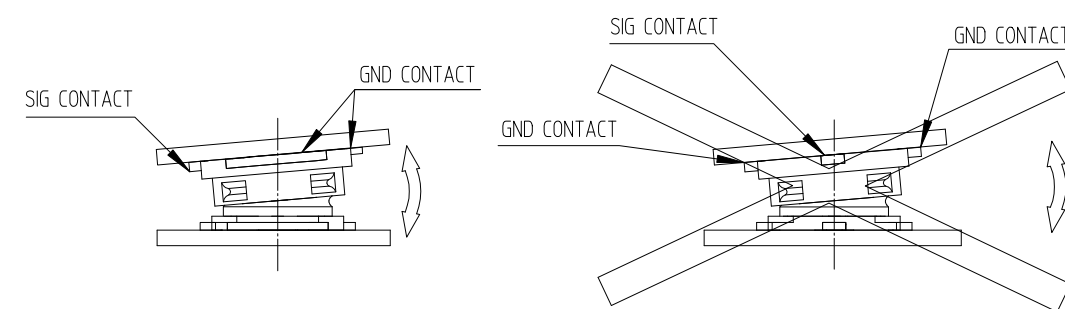

□ SUGGESTIONS TO PREVENT ACCIDENTAL UNMATING

In environments where the connectors may encounter severe shock, vibration or FPC's bend spring-back it is advisable to provide additional support when connectors are fully mated.
E.G. : device chassis or compressive cushion.

| | | | | |
|----------------------------------|-----------------------|----------------|----------|---------------------|
| SCALE 10:1 UNITS mm | DRAWING NO. | EDC3-632121-80 | PART NO. | K.FL2-PR-SMT09(800) |
| | HIROSE KOREA CO.,LTD. | | CODE NO. | CL6345-0056-0-800 |
| | | | | 2/2 |