

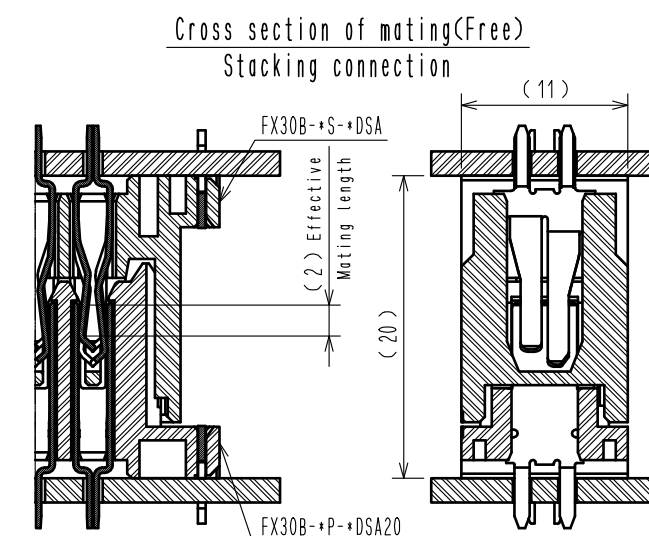
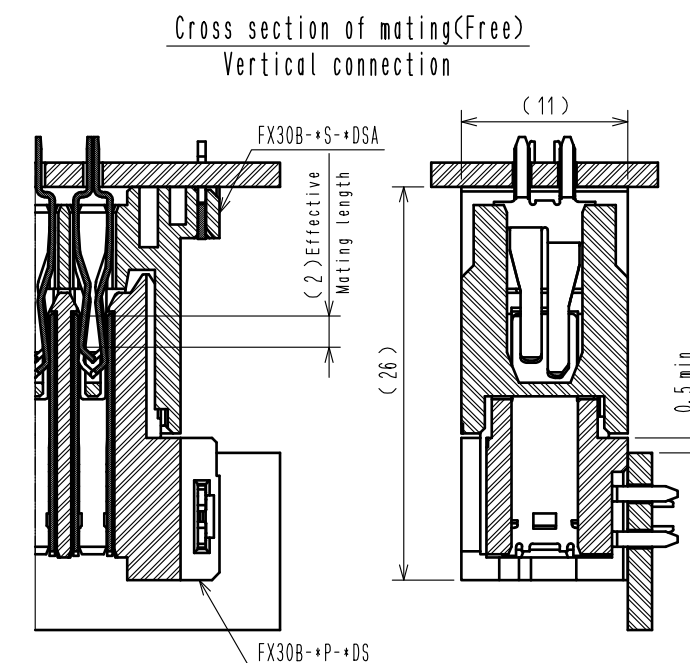
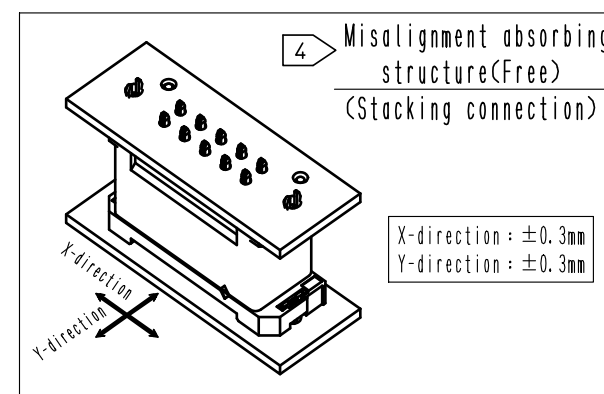
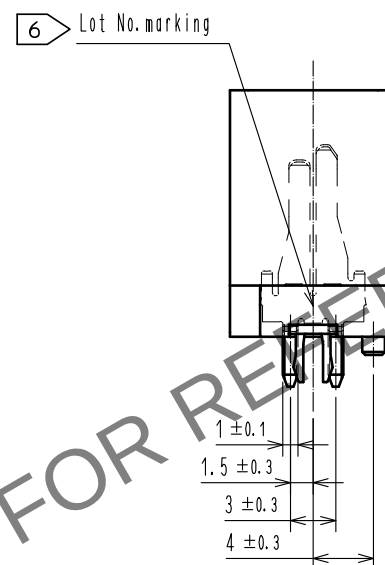
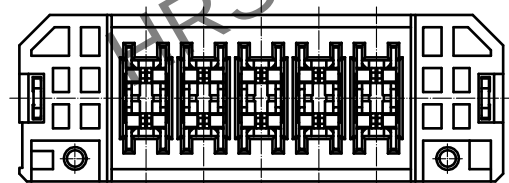


Apr.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

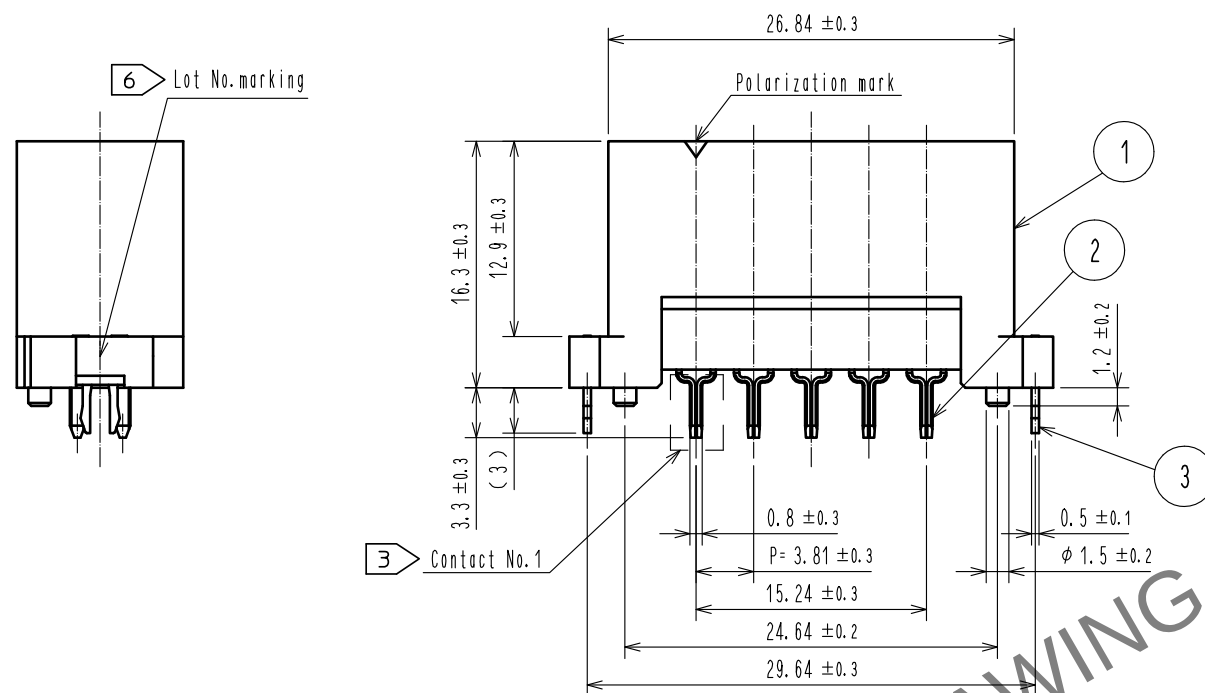

- Note
- 1 This product is packaged in tray. (35pcs/tray)
 - 2 Blemish and hit mark can be occurred through out the manufacturing process which doesn't affect quality level. Also, black spot could be observed on the surface of housing.
 - 3 For the contact No., adjacent two pairs of leads placed back-to-back (4 leads in total) compose one line.
 - 4 Misalignment absorbing range: ±0.3mm max.
 - 5 The dimension in parentheses are for references.
 - 6 Lot No. is indicated at either one of the position as shown.
 - 7 UL (File No. E52653)
C-UL (File No. E52653)
TUV (Certificate No. R50275872) authorization article.

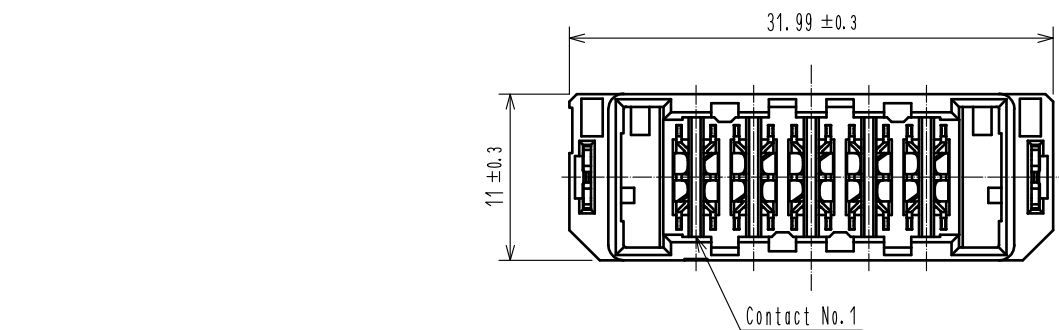

2	COPPER ALLOY	CONTACT AREA: GOLD-PLATING 0.1 μm	4	POLYSTYRENE	
		LEAD AREA: TIN-PLATING 1.0 μm			
		UNDER PLATING: NICKEL 1.0 μm			
1	POLYAMIDE	BLACK UL94V-0	3	PHOSPHOR BRONZE	TIN-PLATING 3.0 μm
NO. MATERIAL		FINISH, REMARKS	NO. MATERIAL		FINISH, REMARKS
UNITS mm		SCALE 2 : 1	COUNT 1		DESCRIPTION OF REVISIONS
					DESIGNED AK. IWAHORI
					CHECKED HT. YAMAGUCHI
					DATE 20200406
HRS HIROSE ELECTRIC CO., LTD.		APPROVED : HS. OKAWA	20130313	DRAWING NO. EDC3-347275-00	
		CHECKED : KI. HIROKAWA	20130312	PART NO. FX30B-5S-3. 81DSA	
		DESIGNED : DK. AIMOTO	20130311	CODE NO. CL570-3503-0-00	
		DRAWN : DK. AIMOTO	20130311		

