


May.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.


A
B
C
D
E
F

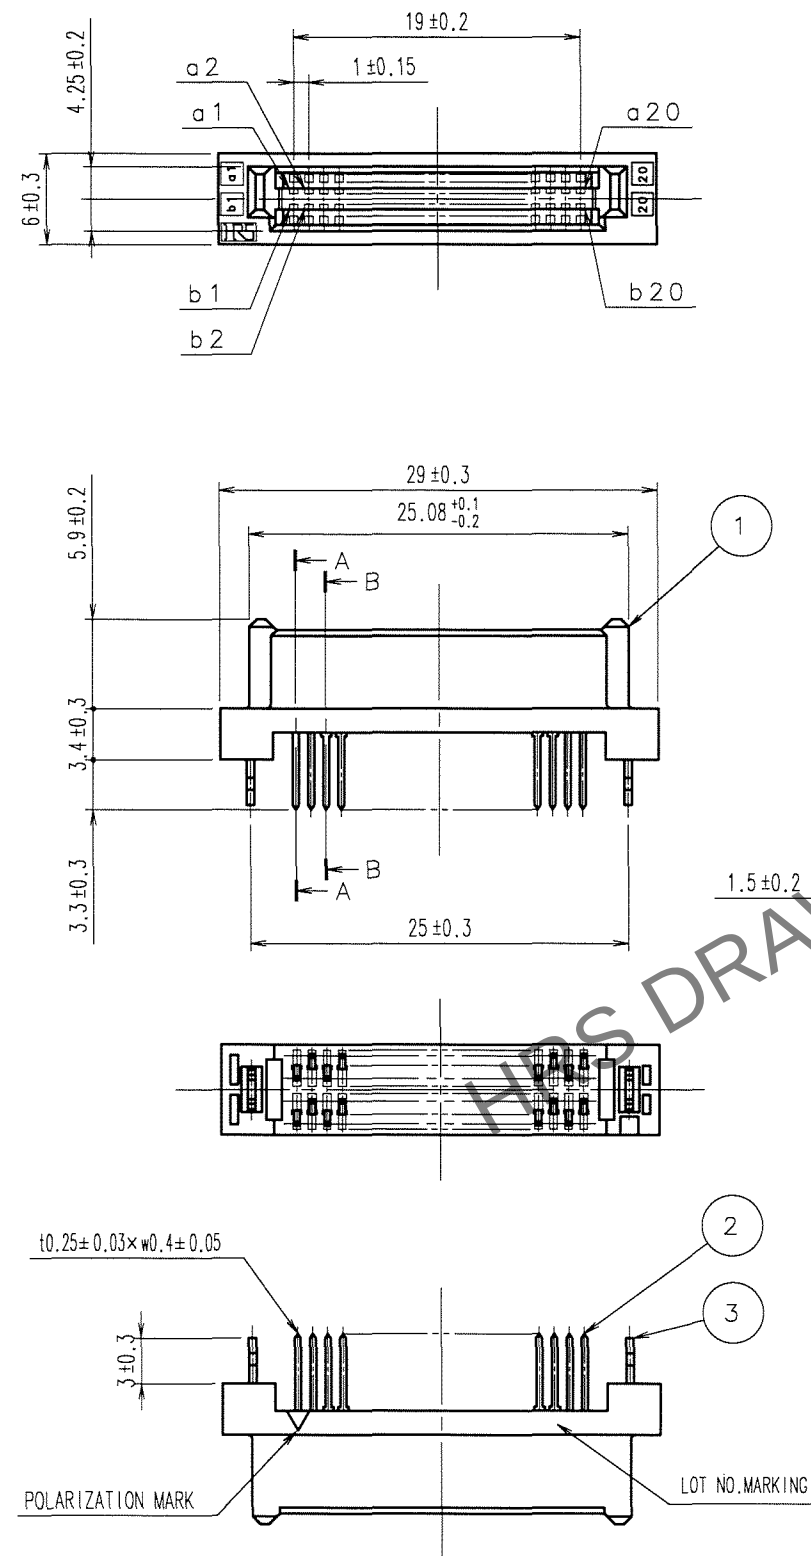

COUNT	DESCRIPTION OF REVISIONS	BY	CHKD	DATE	COUNT	DESCRIPTION OF REVISIONS	BY	CHKD	DATE
△				..	△				..
△				..	△				..
△				..	△				..

RECOMMENDED PC BOARD HOLE PATTERN (MOUNTING SIDE)

APPLICABLE BOARD THICKNESS, 1.6

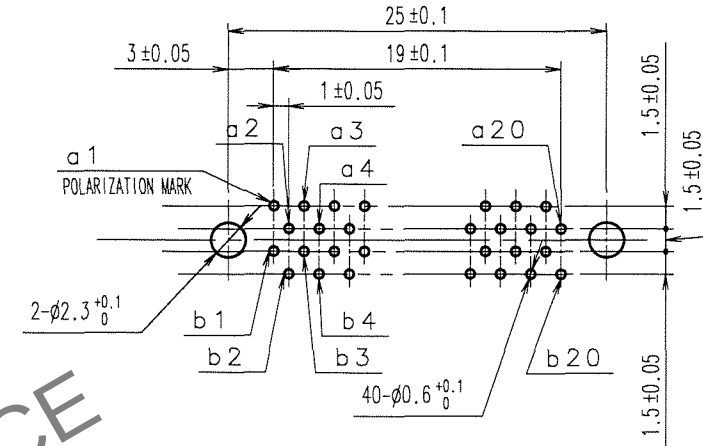


CONTACT SEQUENCE

SEQUENCE	PIN NO.
1	a1, a2, a19, a20 b1, b2, b19, b20
2	a3~a18 b3~b18

A-A (5:1)

B-B (5:1)

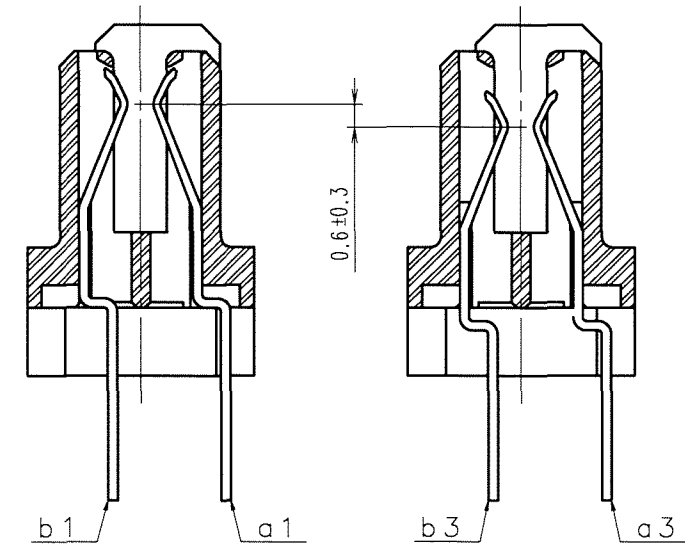

3	PHOSPHOR BRONZE	TIN-PLATING	2	PHOSPHOR BRONZE	CONTACT AREA : GOLD $0.1 \mu\text{m min.}$
1	POLYAMIDE	BEIGE UL94V-0			LEAD AREA : TIN-PLATING $1.2 \mu\text{m min.}$
NO.	MATERIAL	FINISH, REMARKS	NO.	MATERIAL	UNDER PLATING : NICKEL $1 \mu\text{m min.}$

CODE NO. (OLD) CL	DRAWN A. SUZUKAWA '06.10.06	DESIGNED M. Nakamura '06.10.06	CHECKED M. Ozawa '06.10.06	APPROVED H. Okawa '06.10.06	RELEASED ..
----------------------	-----------------------------------	--------------------------------------	----------------------------------	-----------------------------------	----------------

SCALE 2 : 1 UNITS mm	DRAWING NO. EDC3-151519-21 HRS HIROSE ELECTRIC CO., LTD	PART NO. FX5-40S2A-DSAL (71) CODE NO. CL575-0125-0-71	1/1
-------------------------------	--	--	-----