

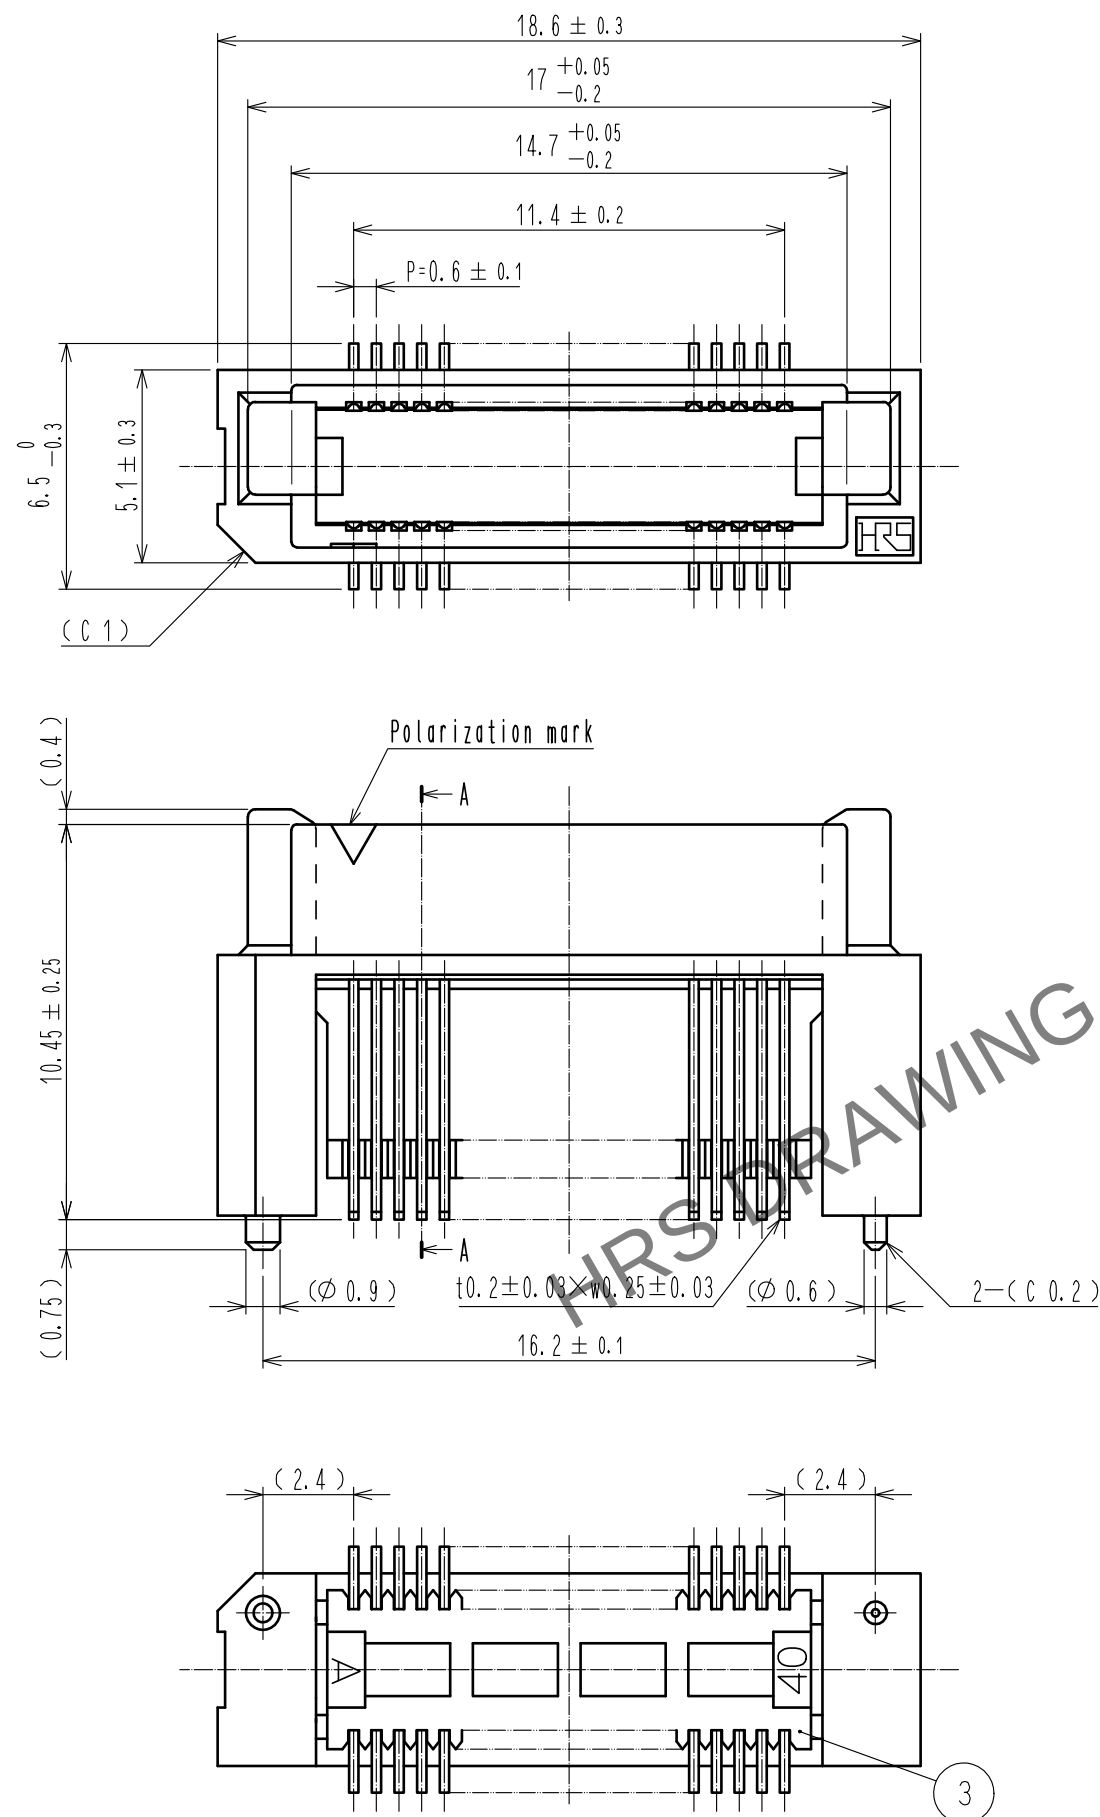


May.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

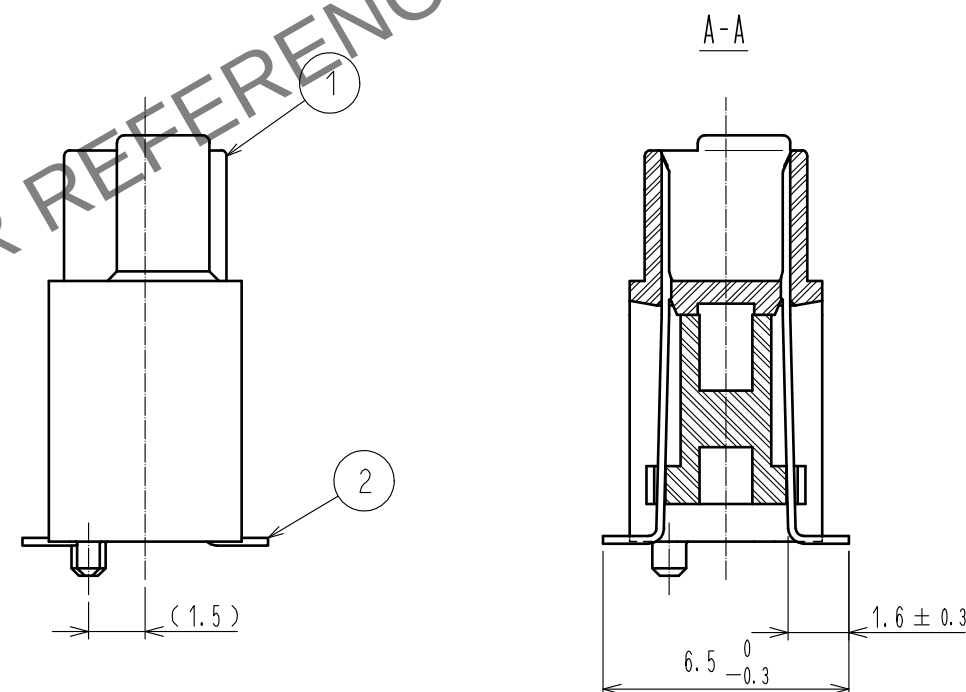

Recommended land pattern dimension of PCB (mounting side) (2:1)
(Recommended metal mask thickness: 0.15mm)

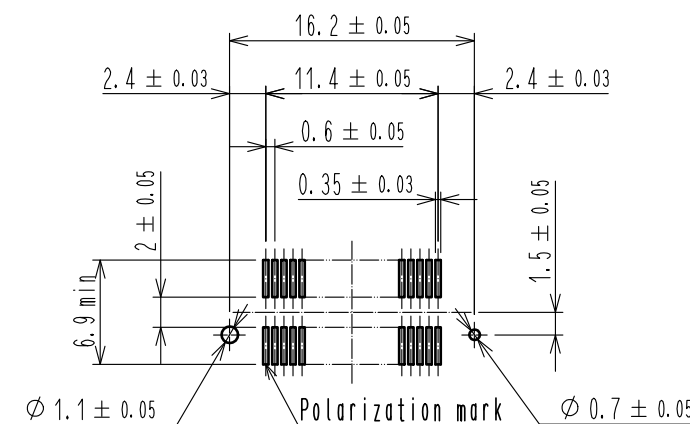


- Notes
- Lead CO-PLANARITY shall be 0.1mm max.
 - Embossed carrier tape packaging shall be applied to this product. See next page for details.
 - For modification, etc., preventive hole for sink mark may be added according to circumstances.
 - The dimensions in parentheses are for reference.

2	PHOSPHOR BRONZE	Contact area: Gold 0.1μm min.	5	POLYESTER	(Top cover tape)
		Lead area: Tin-plating 2μm min.			
		Under plating: Nickel 1μm min.			
1	PPS	Light brown (UL94V-0)	4	POLYSTYRENE	(Embossed carrier tape)
NO. MATERIAL		FINISH . REMARKS	NO. MATERIAL		FINISH . REMARKS
UNITS mm		SCALE 5 : 1	COUNT 1		DESCRIPTION OF REVISIONS DIS-F-00006417
APPROVED : HS. OKAWA		20091113		DESIGNED KS. NAKAJIMA	
CHECKED : HT. YAMAGUCHI		20091113		CHECKED HT. YAMAGUCHI	
DESIGNED : SY. KAMIGA		20091112		DATE 20200803	
DRAWN : HK. SUNADORI		20091112		DRAWING NO. EDC-151169-92-22	
HIROSE ELECTRIC CO., LTD.		PART NO. FX8C-40P-SV6(92)		CODE NO. CL578-0609-5-92	
1		1		1	

Added precaution

May.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

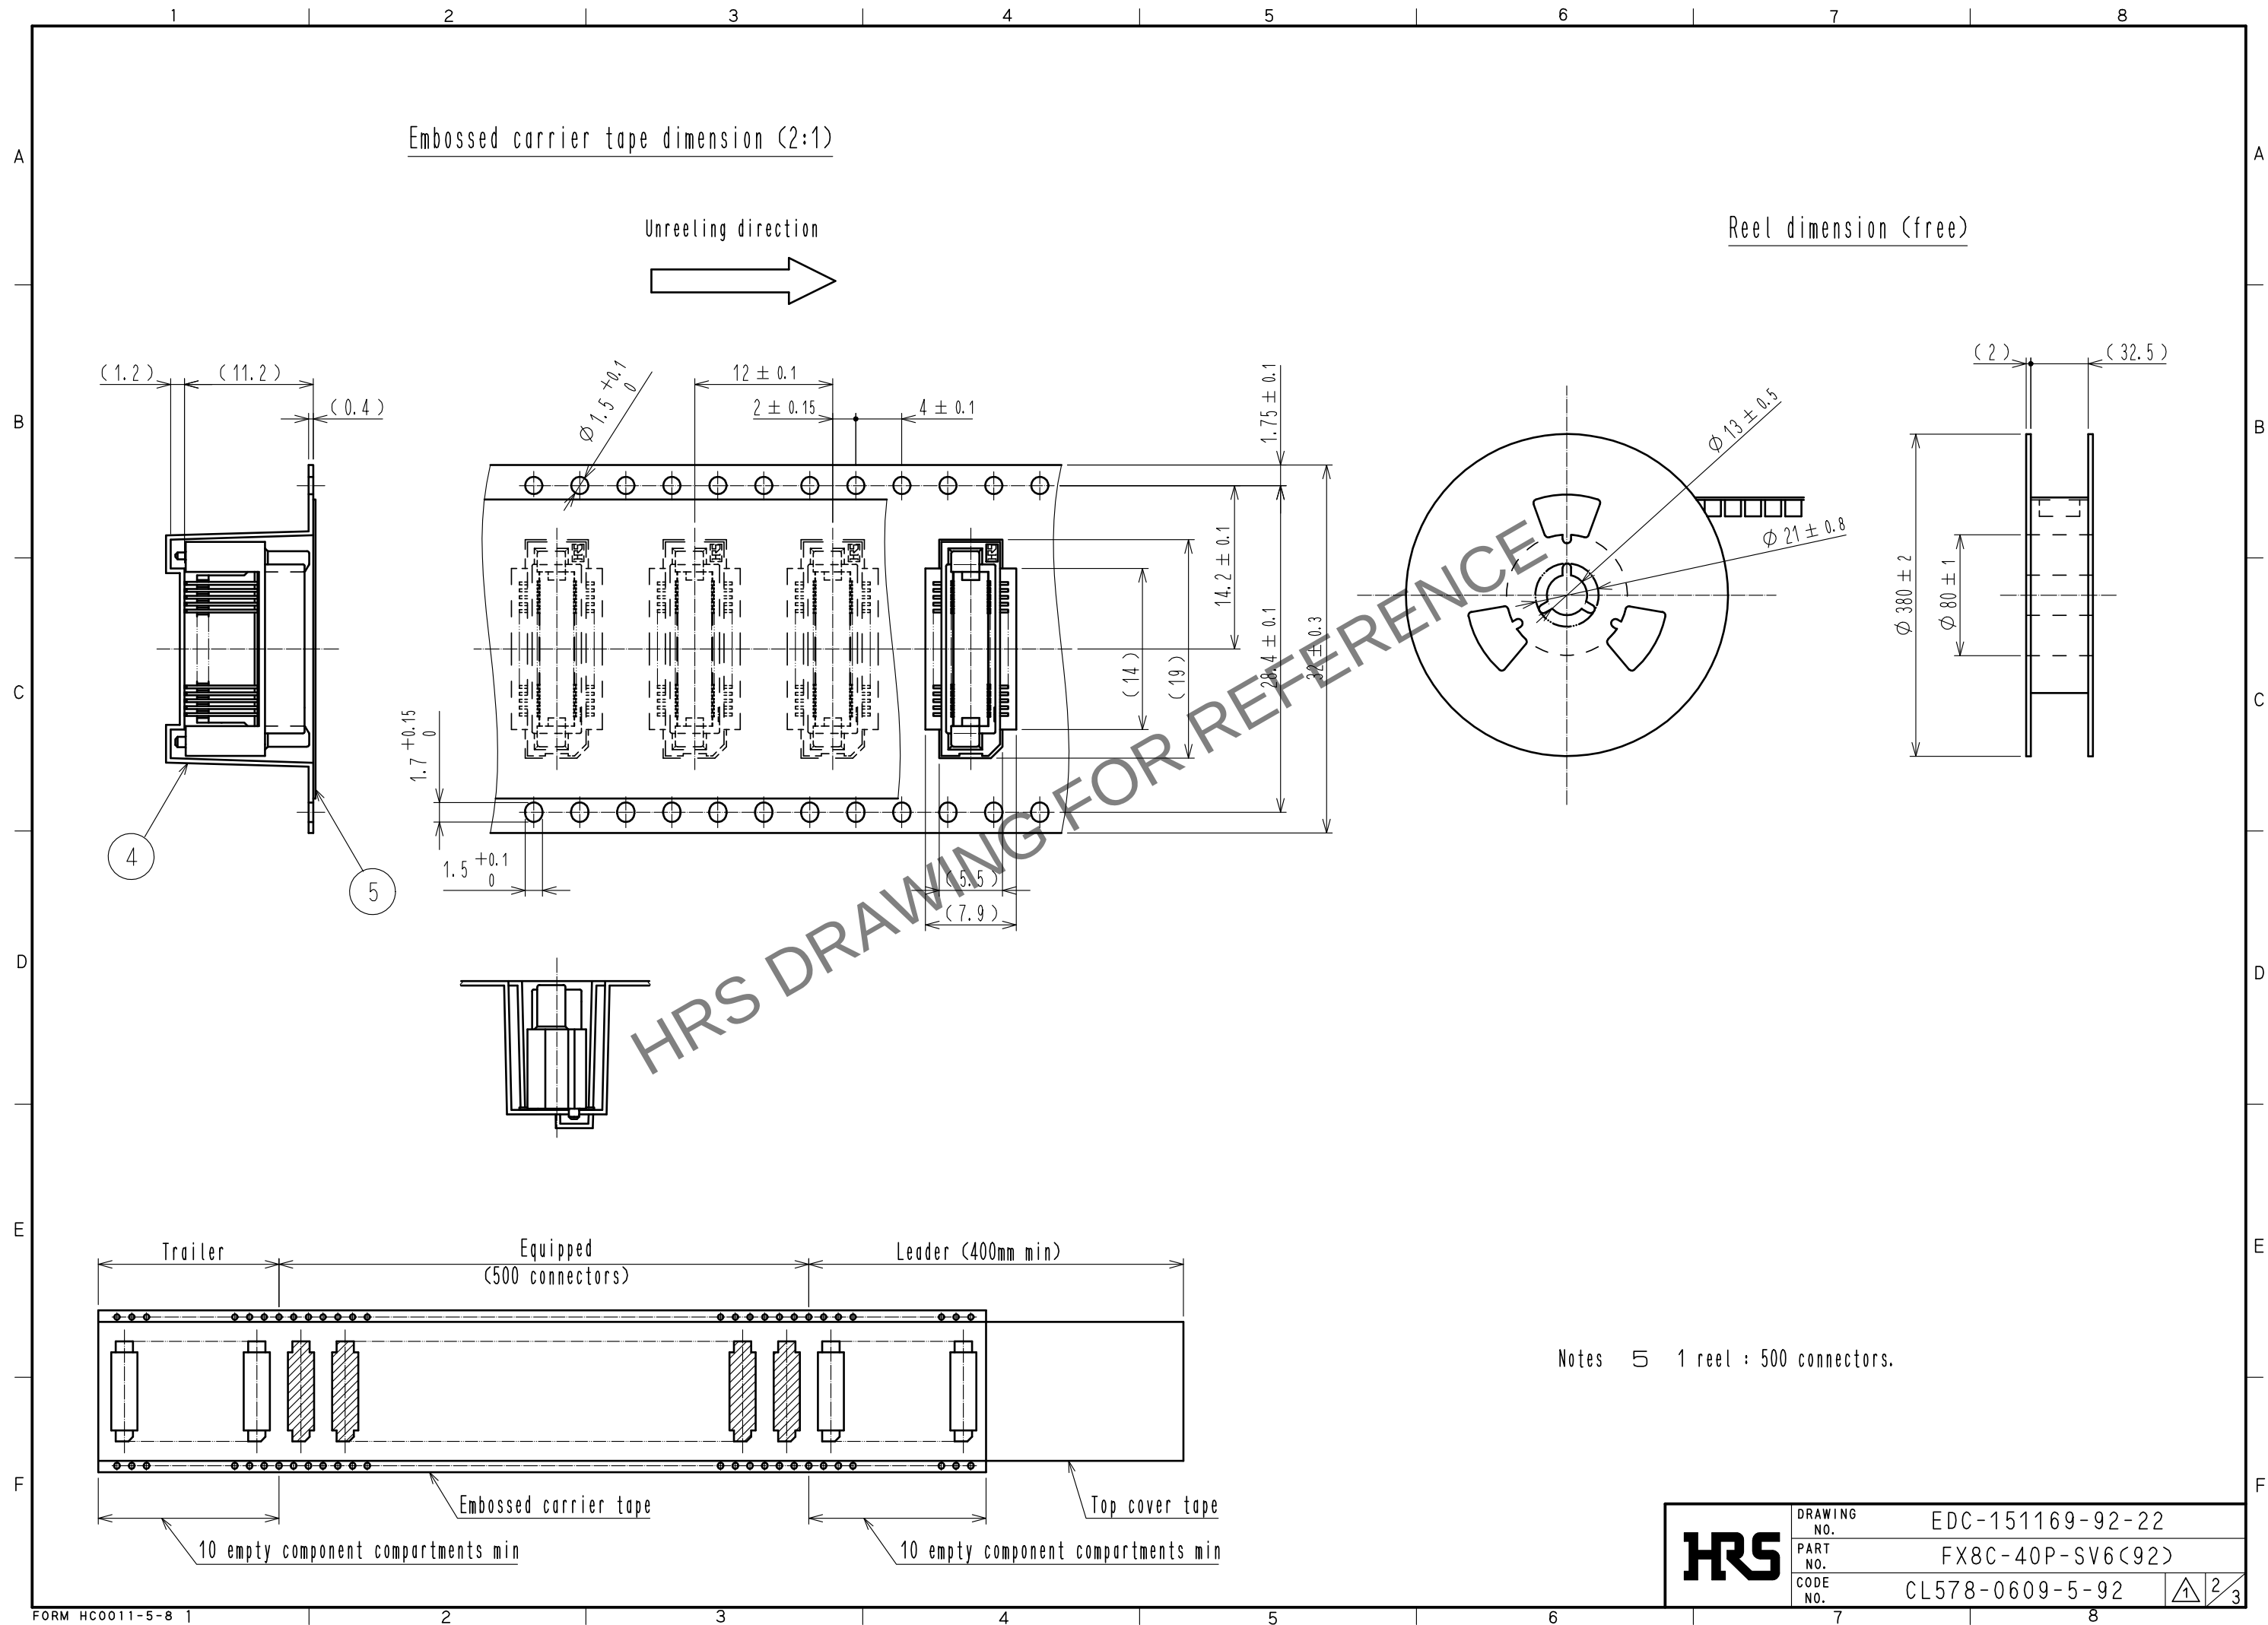



May.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

【Precaution】

When a board with multiple connectors mounted is mated, the connector may be damaged or deformed.
Please divide one side of the board so only one connector is mated per board.

OK

NG

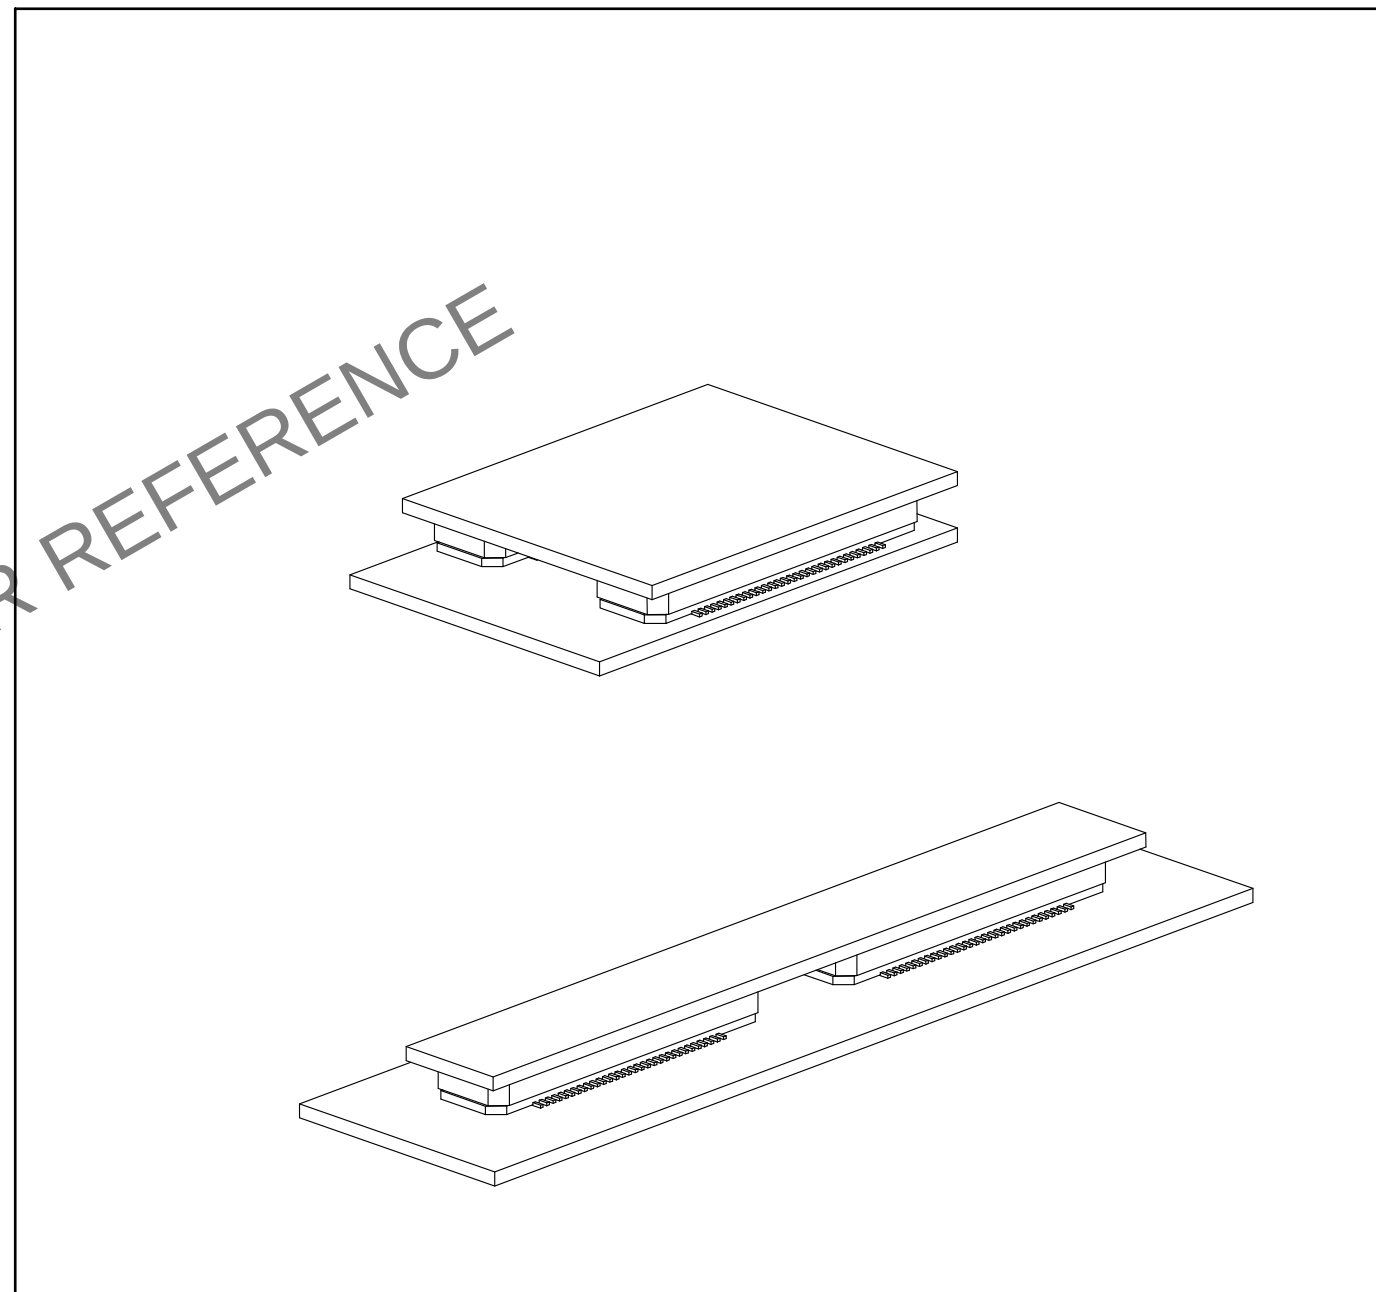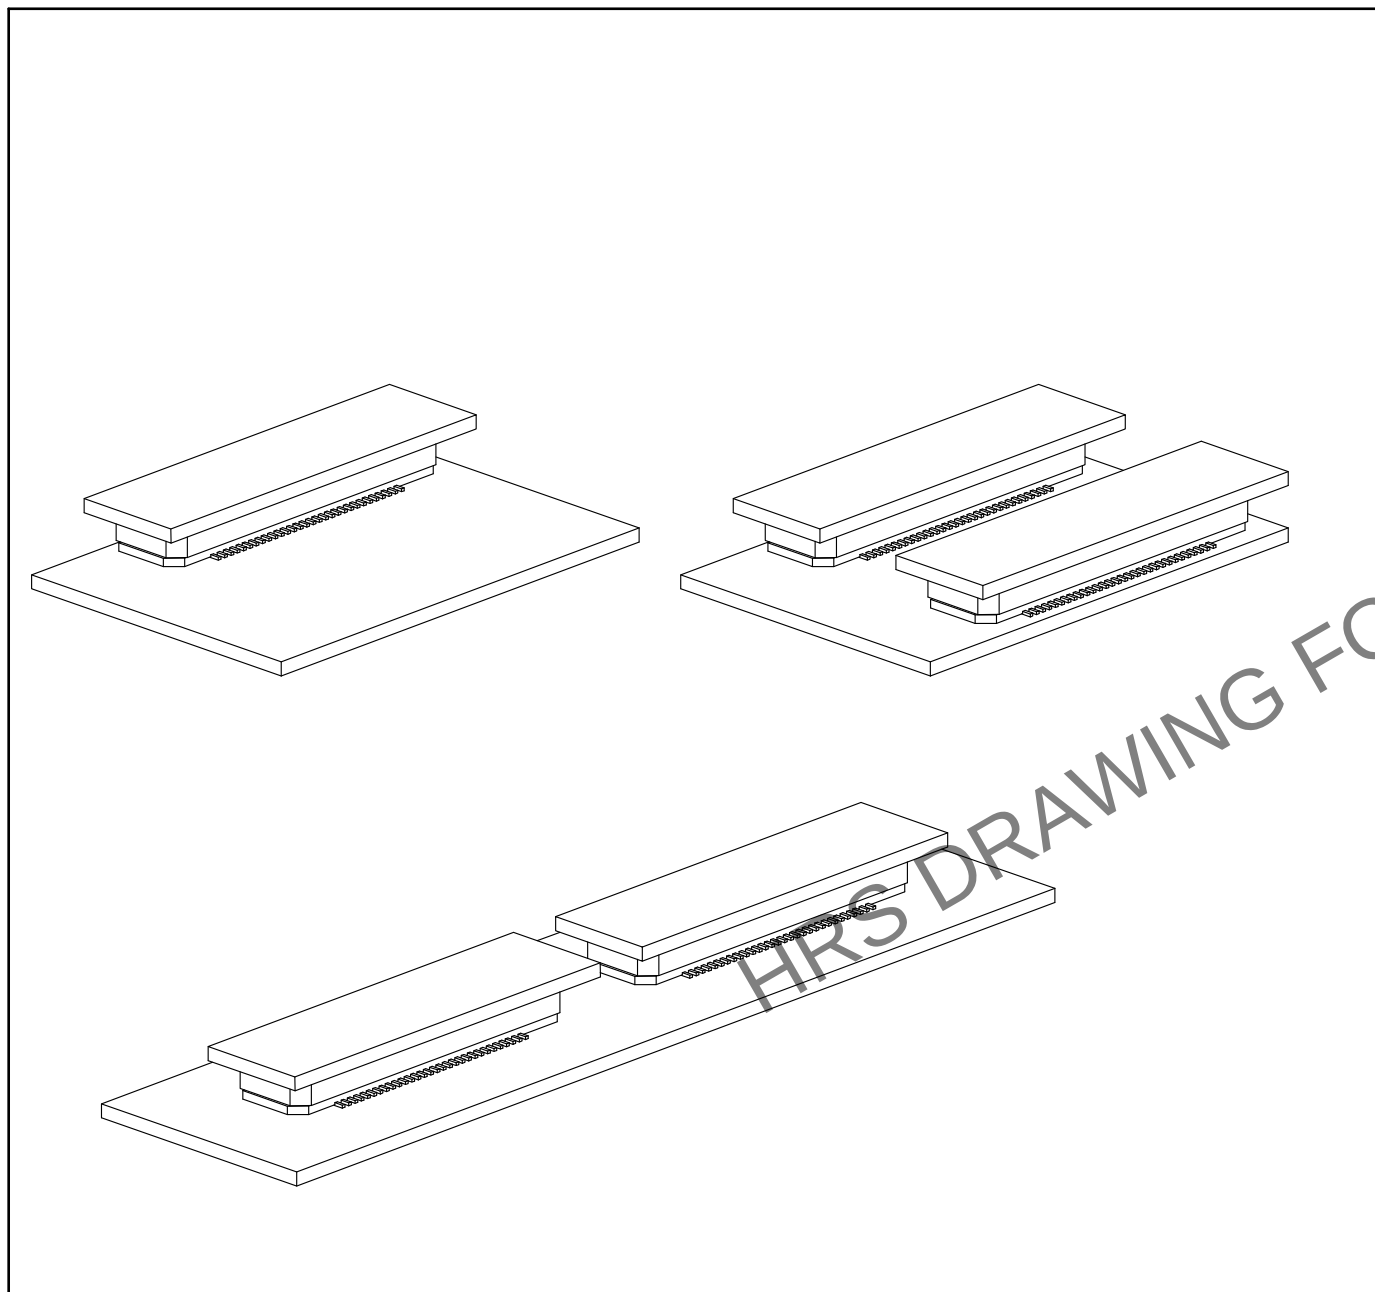

HRS

DRAWING NO.	EDC-151169-92-22
PART NO.	FX8C-40P-SV6(92)
CODE NO.	CL578-0609-5-92